

REV.	DATE	DRN.	CHK.	NOTES
.	-	-	-	-

North elevation

East elevation

South elevation

Check condition and fixing of iron cramp and timber that it supports.

De-frass and remove decayed timber back to sound material. Form new top surface to decayed top chord of bracket using new section of kiln dried European Oak bedded into Repair Care 2 part resin.


New corbel from kiln dried European Oak, shaped to match existing like-for-like.

Check all pegs for condition and firmness. Supply and fix new green oak pegs as required where existing are damaged, rotted or missing.


Prop structure and fit new top chord to bracket from kiln dried European Oak, shaped to match existing like-for-like. To have mitred corner junction with front wall plate.

Existing roof tiles and bedding seem to be in good condition and are omitted from drawing for clarity. Allow for careful propping during works and for making good mortar upon completion using lime mortar as specification.

New kiln dried European Oak indicated thus: To be stained to match surrounding oak as specification.

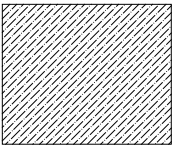

Porch canopy as proposed
Showing repairs
Scale 1: 10 @ A3

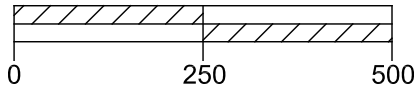

www.lee-evans.co.uk | office@lee-evans.co.uk | 01227 784444

PROJECT
Refurbishment of Vestry Cottage, Angmering;

CLIENT
St Margarets Church Angmering

DATE
22/08/2025

DRAWING TITLE
Porch canopy as proposed
Showing repairs

SCALE
1:10 @ A3

DRAWING NUMBER
9482-AA-(30)-04

REVISION
1st