




Plot 27



Plot 27 service

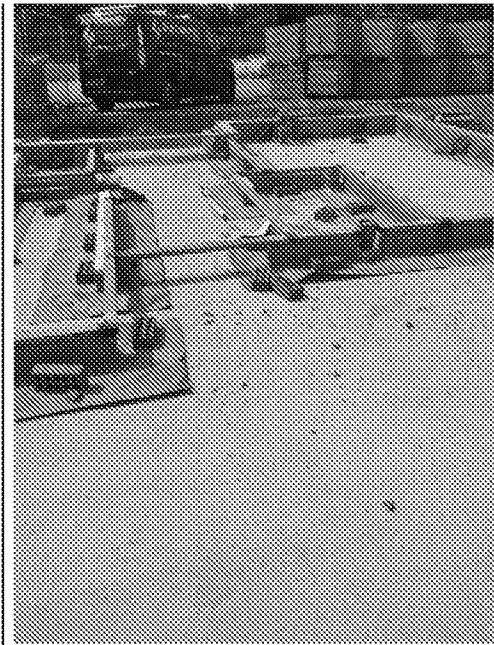

Plot 27 damage




Plot 27 corner damage




Plot 28




Plot 28 corner needs sealing

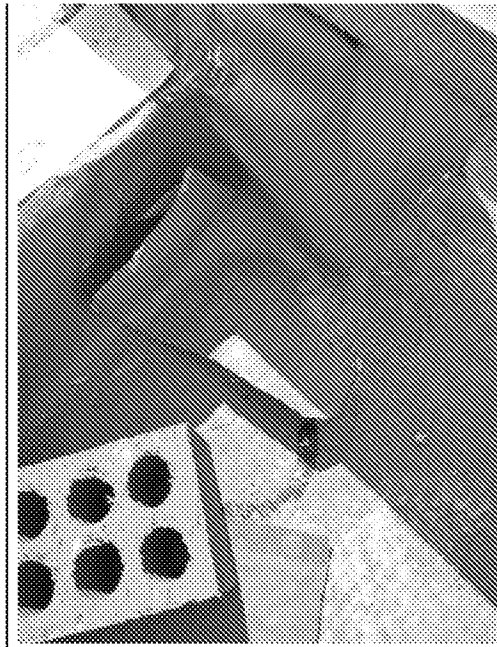


Plot 28 lapping needs sealing

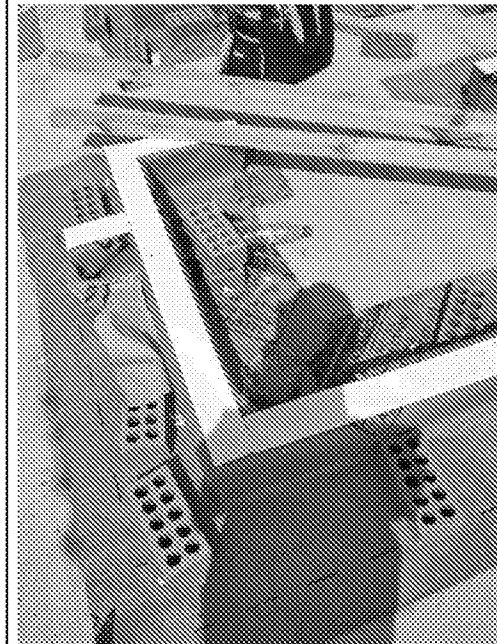


Plot 28 tape for frame

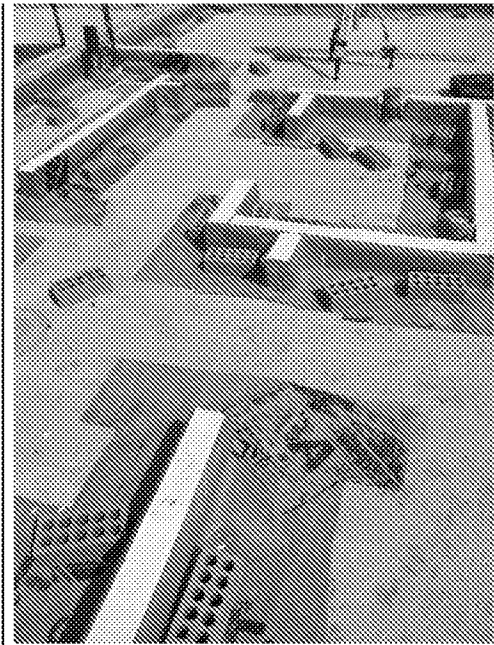


Plot 29

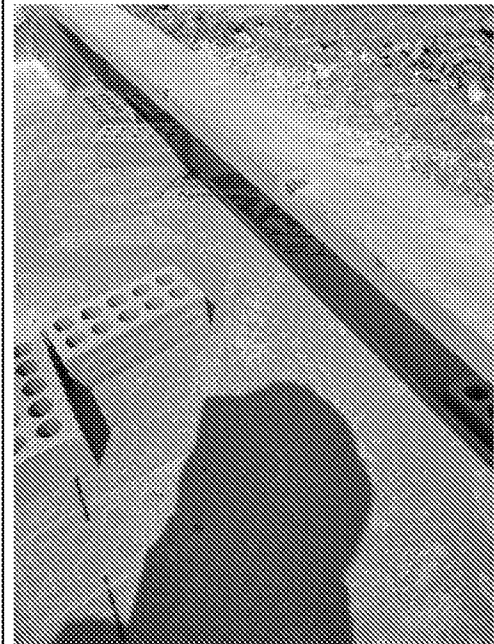


Plot 29 threshold

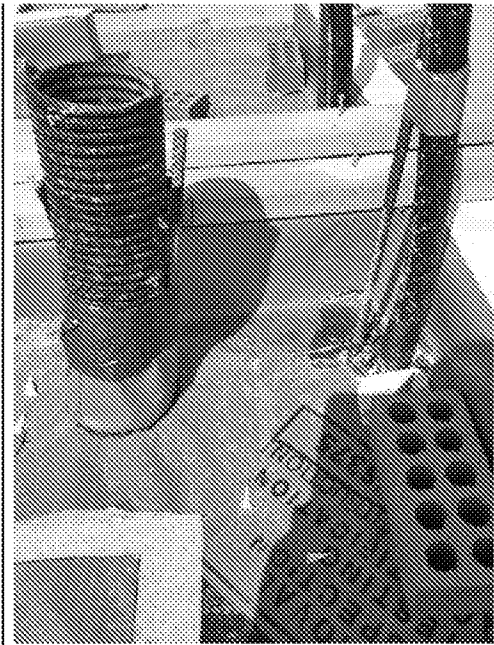


Plot 29 services

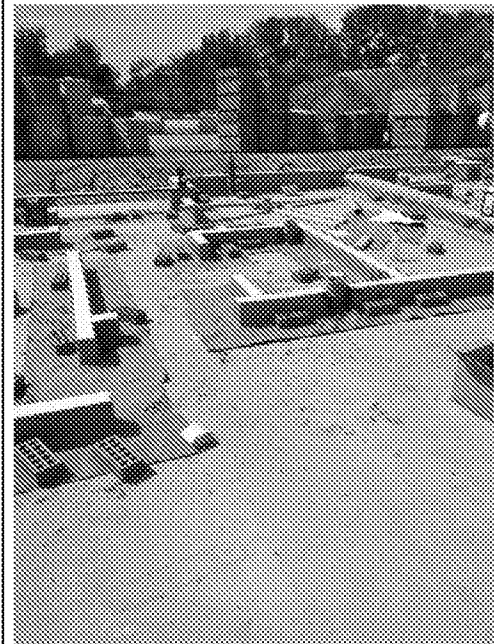


Plot 30

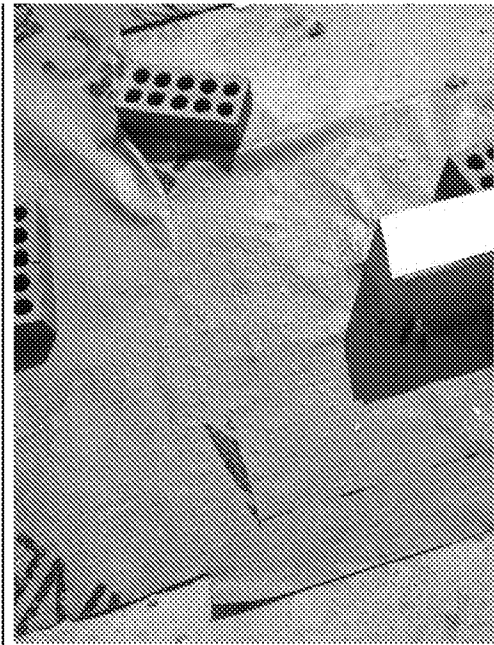


Plot 30 joins

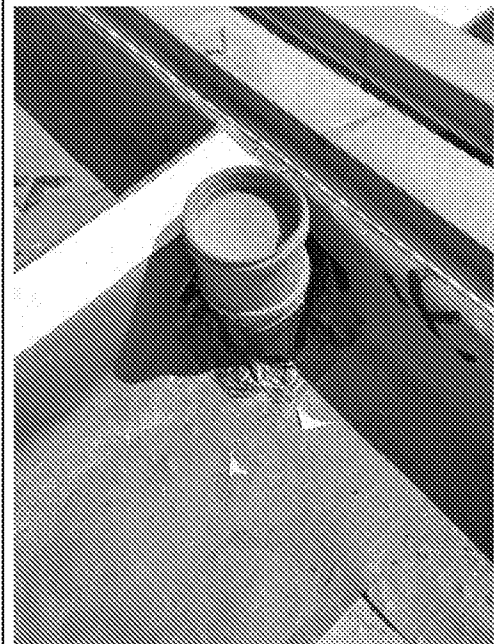

Plot 30 services

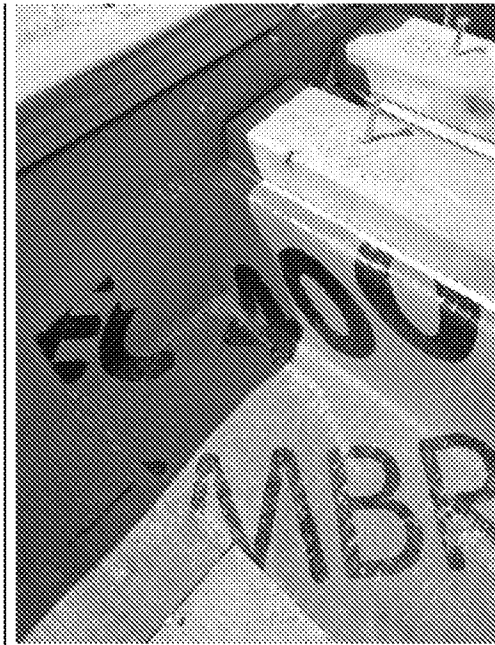


Plot 30 corner

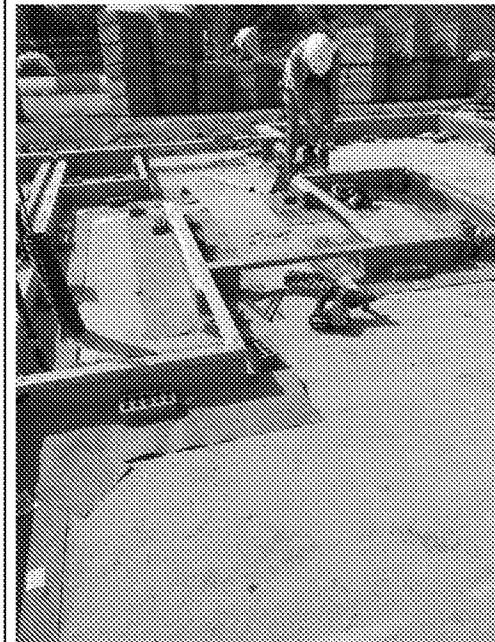

Plot 31



Plot 31 corner

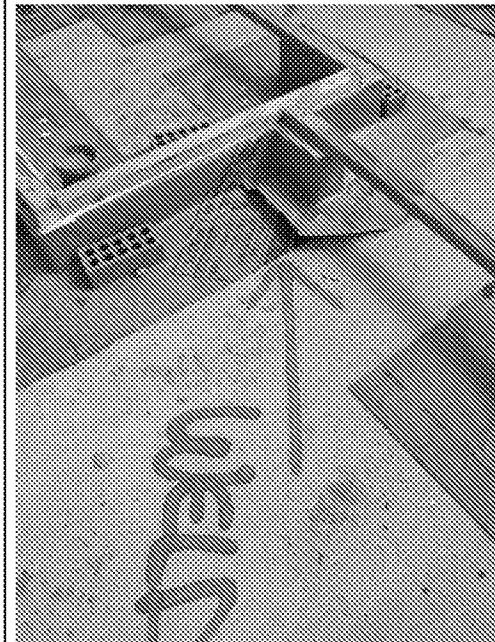


Plot 31 seal needs attention




Plot 31 edge detail




Plot 32

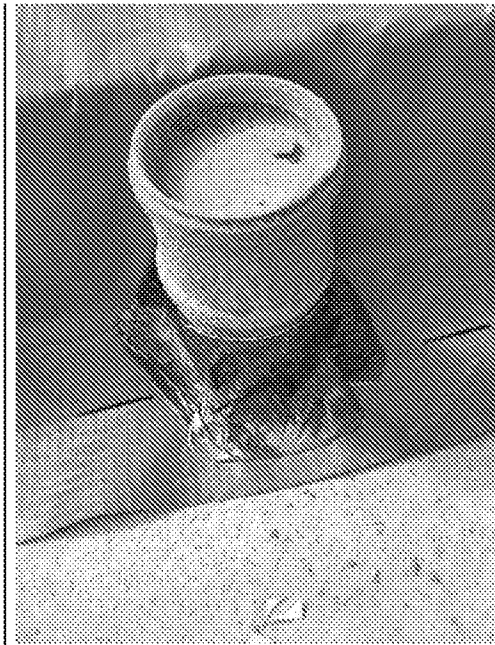

Plot 32 service

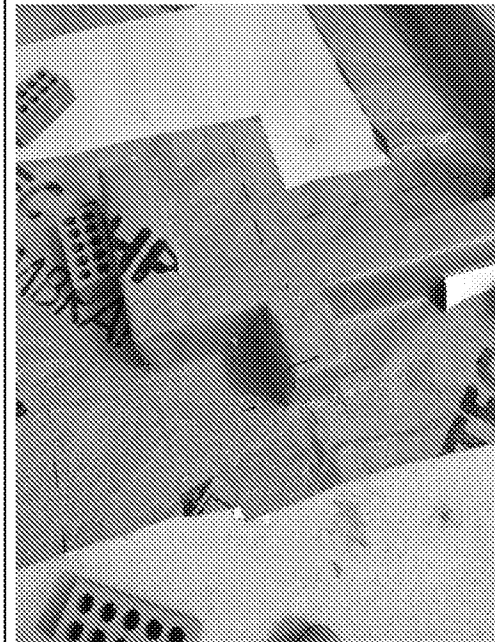


Plot 32 corner

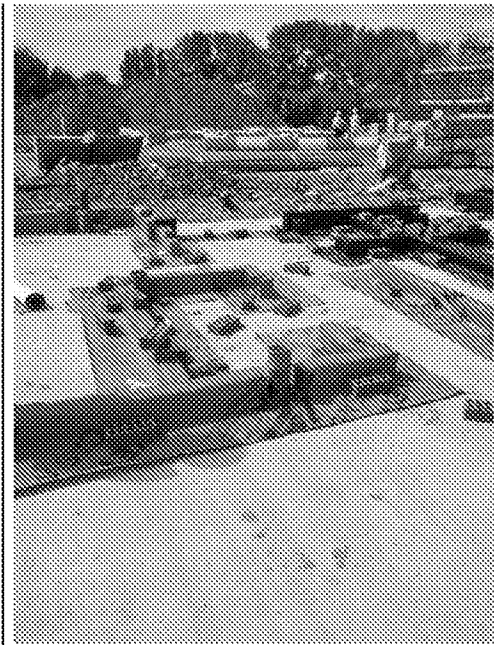

Plot 33



Plot 33 service

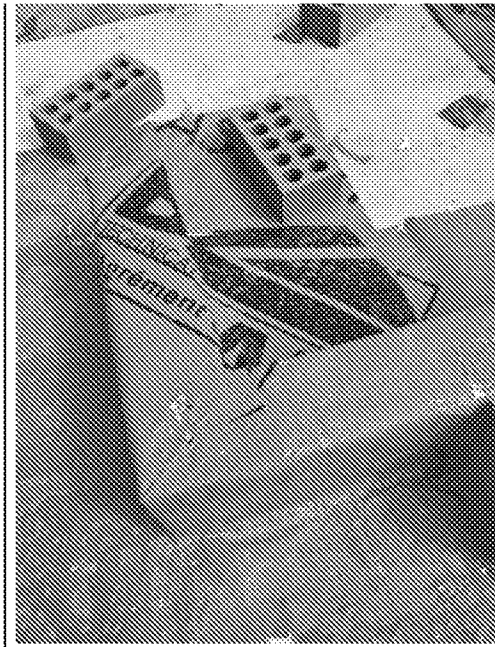

Plot 33 corner

5. PASS/FAIL

The gas protection measures
inspected:

Details of issues

Approved by

No users

Date

Project Name	Cornfield Close
Project No.	GE18103
Client	Thakeham Homes
Geo-Environmental Project Manager's Email	[REDACTED]
Date	01/10/2020, 11:52
Site Engineer	[REDACTED]
 William Hughes	[REDACTED]
Weather at time of inspection	Sunny
Gas Characteristic Situation	Characteristic Situation 2
Type of development and building/block checked	Residential - terraced houses
Plot No.	Plots 36-37 complete, Plots 38-39 in progress
Foundation Type	Suspended
Gas Protection Type	Passive
What is being inspected	☐ Venting ☒ Membrane ☐ Venting and Membrane

1. MEMBRANE

1.1 Condition of sub-grade and underside of membrane	Good condition. Membrane sealed in Plots 36-37
1.2 Gas membrane type	Keytec 400 HP
1.3 Gas membrane condition	Good condition. Any damage patched with tape
Jointing tape product	Heat welded joints
1.5 Lapping design	Min 150mm overlap
1.6 Laps, welds and joints seals	Welded joints sealed. In good condition
1.7 Service seals	Sealed using membrane and tape. All well sealed, no damage

Engineer's Prelim Assessment (Mem)

Pass

4. PHOTOGRAPHS

Photographs

(14 records)

Photograph	Photograph Title



Plot 36



Plot 36 Service seal



Plot 36 Under stairs



Plot 36 Joins



Plot 36 Patch repairs



Plot 36 sides




Plot 36 Front room




Plot 37



Plot 37 Joins and a patch repair

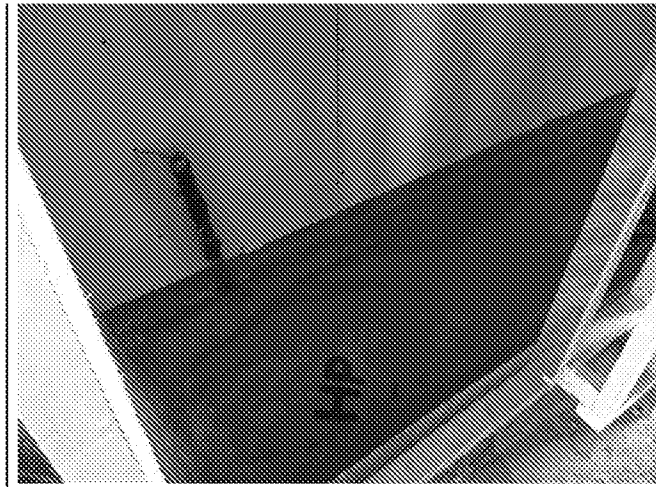

Plot 37 Under stairs

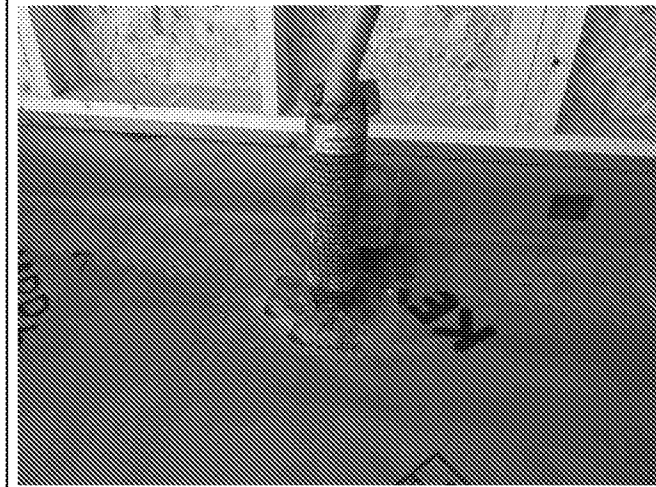

Plot 37 Service seal



Plot 37 Front room



Plot 38



Plot 39 in progress

5. PASS/FAIL

The gas protection measures
inspected:

Details of issues

Approved by

No users

Date

Project Name	Cornfield Close
Project No.	GE18103
Client	Thakeham
Geo-Environmental Project Manager's Email	
Date	15/10/2020, 12:17
Site Engineer	

No users

Weather at time of inspection	Warm, dry, sunny
Gas Characteristic Situation	Characteristic Situation 2
Type of development and building/block checked	Residential.
Plot No.	40-42 complete, 43 inpl progress
Foundation Type	Suspended
Gas Protection Type	Passive
What is being inspected	☐ Venting ☒ Membrane ☐ Venting and Membrane

1. MEMBRANE

1.1 Condition of sub-grade and underside of membrane	Good condition where visible (Plot 42 & 43). Membranes sealed in Plots 40 & 41.
1.2 Gas membrane type	Red Keytec gas membrane.
1.3 Gas membrane condition	Good condition. Holes patched during inspection.
Jointing tape product	Heat welded joints.
1.5 Lapping design	Min 150mm overlap.
1.6 Laps, welds and joints seals	Welded joints well sealed and in good condition. Awaiting final site photos of Plot 43 complete.
1.7 Service seals	Service seals using membrane and tape. All in good condition

Engineer's Prelim Assessment (Mem)


Pass

4. PHOTOGRAPHS

Photographs

(24 records)

Photograph	Photograph Title

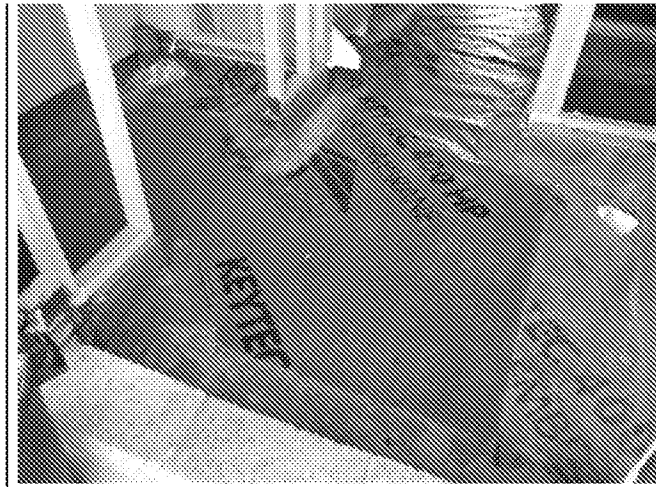

Plot 40 - floors sealed




Plot 40 - example of service seal




Plot 40 - Corner detail



Plot 40 - under stairs

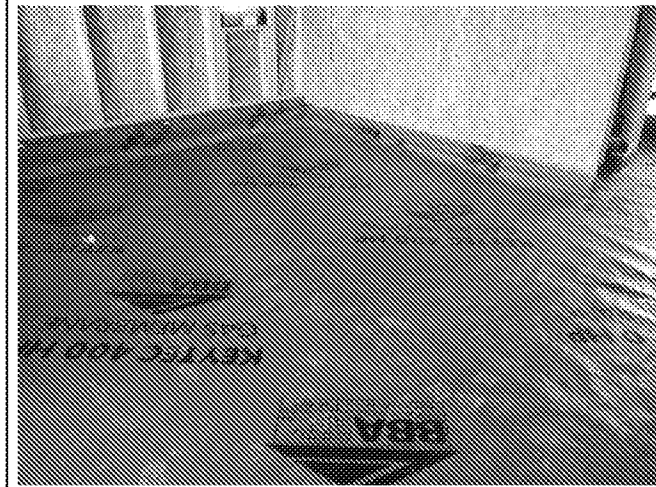

Plot 40 - floors sealed

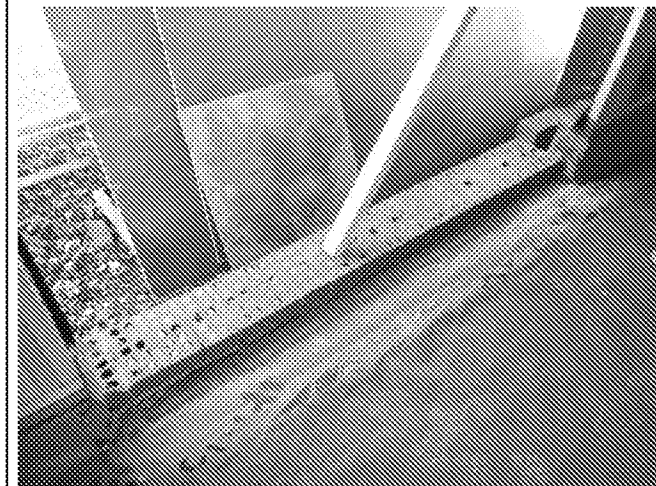

Plot 40 - Threshold



Plot 41 - Threshold




Plot 41 - Floor and services sealed



Plot 41 - under stairs sealed



Plot 41 - floors sealed

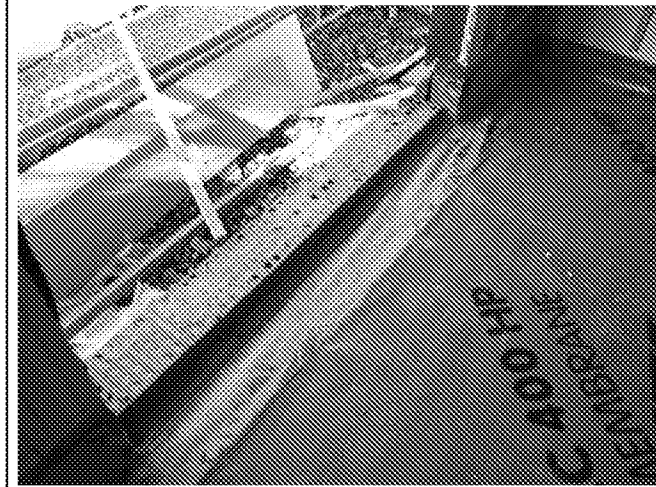

Plot 41 - Threshold




Plot 41 - Holes patched during inspection



Plot 42 - services in progress




Plot 42 - Floor in progress

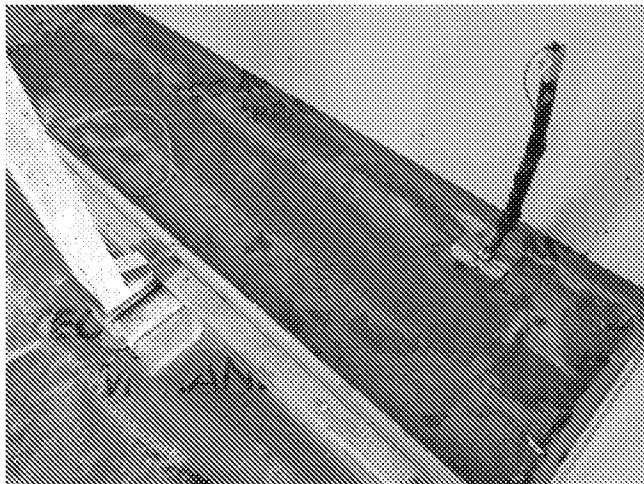

Plot 42 - under stairs sealed



Plot 42 - floors sealed

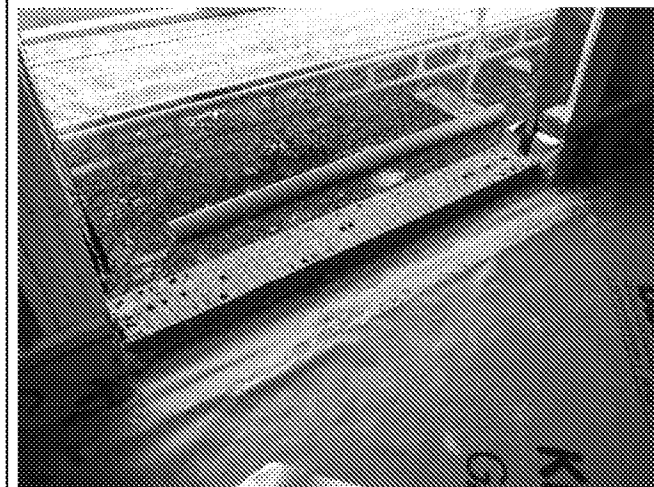

Plot 42 - Threshold sealed




Plot 42 - Floor completed during visit



Plot 42 - service seals completed during inspection



Plot 43 - in progress

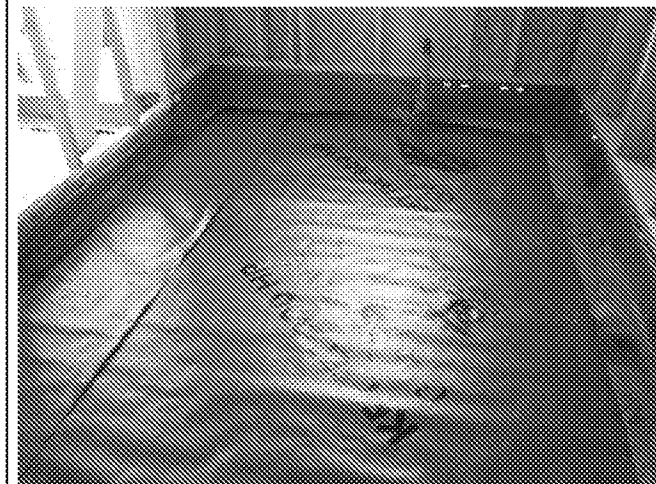


Plot 43 - in progress



Plot 43 - in progress



Plot 43 - in progress

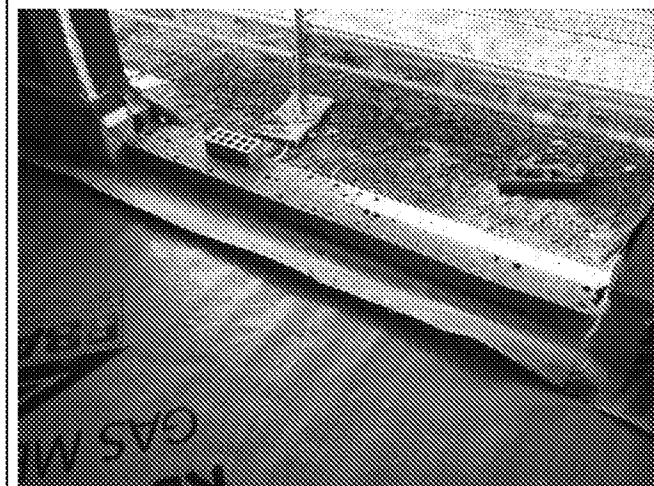

Plot 43 - in progress

5. PASS/FAIL

The gas protection measures inspected:

Details of issues

Approved by

No users

Date

Project Name	Cornfield Close
Project No.	GE18103
Client	Thakeham Homes
Geo-Environmental Project Manager's Email	
Date	29/10/2020, 11:01
Site Engineer	

No users

Weather at time of inspection	Drizzle, overcast, cool
Gas Characteristic Situation	Characteristic Situation 2
Type of development and building/block checked	Semi detached houses
Plot No.	Plots 32-35 (infills) plot 35 incomplete
Foundation Type	Suspended
Gas Protection Type	Passive
What is being inspected	☐ Venting ☒ Membrane ☐ Venting and Membrane

1. MEMBRANE

1.1 Condition of sub-grade and underside of membrane	Membrane sealed so unable to inspect
1.2 Gas membrane type	Keytech 400 HP gas membrane (red)
1.3 Gas membrane condition	Membrane generally in good condition some dust and saw dust
Jointing tape product	Heat sealed joins, tape around services
1.5 Lapping design	At least 150mm
1.6 Laps, welds and joints seals	All joins, welds and seals heat sealed and well sealed. A few holes/damage identified during visit, but were repaired in the presence of the engineer.
1.7 Service seals	Services sealed with site made seals and eated tape

Engineer's Prelim Assessment (Mem)

Pass

4. PHOTOGRAPHS


Photographs

(12 records)


Photograph	Photograph Title




Plot 32 overview

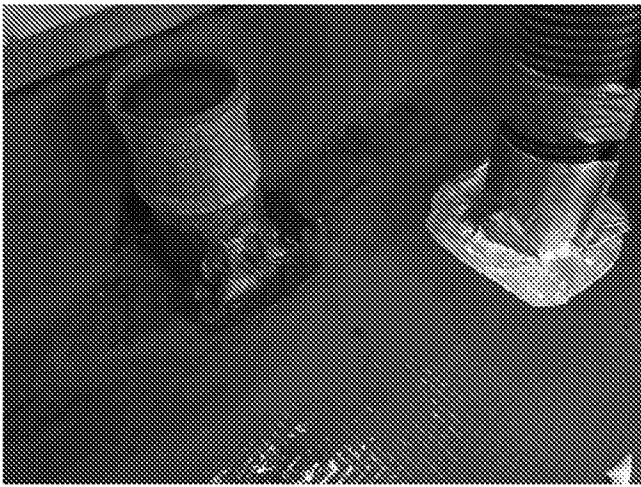

Plot 32 services

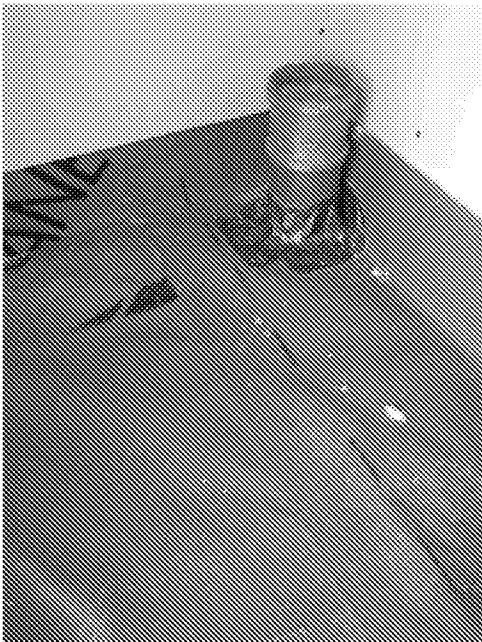

Plot 32 detail

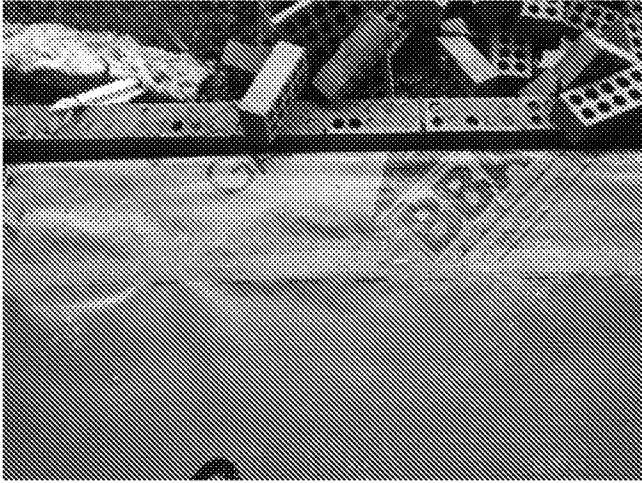	Plot 33 overview
	Plot 33 threshold
	Plot 33 patch repair



Plot 33 repair



Plot 33 timber frame



Plot 34 overview



Plot 34 membrane seal



Plot 34 services



Plot 34 detail extra membrane to protect threshold beneath

5. PASS/FAIL

Gas Protection Measures Inspection Report

The gas protection measures
inspected:

Details of issues

Approved by

No users

Date

Project Name	Cornfield Close
Project No.	GE18103
Client	Thakeham Homes
Geo-Environmental Project Manager's Email	[REDACTED]
Date	12/11/2020, 12:24
Site Engineer	 Katie O'Dea [REDACTED]
Weather at time of inspection	Warm, sunny, dry.
Gas Characteristic Situation	Characteristic Situation 2
Type of development and building/block checked	Residential
Plot No.	Plots 28-31
Foundation Type	Suspended
Gas Protection Type	Passive
What is being inspected	☐ Venting ☒ Membrane ☐ Venting and Membrane

1. MEMBRANE

1.1 Condition of sub-grade and underside of membrane	Underside of membrane unable to be inspected as fully sealed. Gravel removed from some areas of subgrade and membrane subsequently patched up in Plots 28 and 30.
1.2 Gas membrane type	Keytec gas membrane.
1.3 Gas membrane condition	Good condition. Dusty with some debris in areas due to construction work within the plots. Any holes identified were patched during the inspection visit.
Jointing tape product	Heat sealed joints with some tape patching.
1.5 Lapping design	Min 150mm overlap
1.6 Laps, welds and joints seals	Heat sealed joints with some tape patching.
1.7 Service seals	Services sealed with tape.

Engineer's Prelim Assessment (Mem)


Pass

4. PHOTOGRAPHS


Photographs

(26 records)

Photograph	Photograph Title

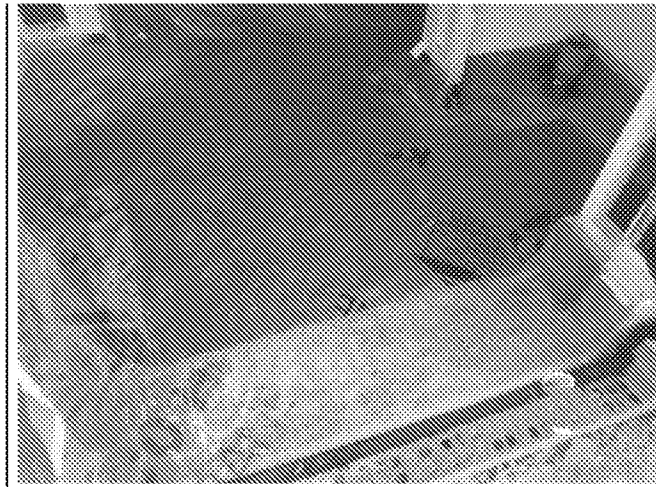

Plot 31 - Threshold

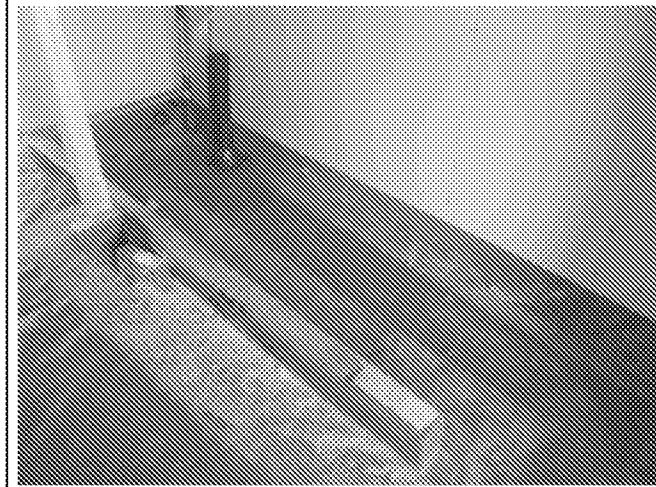

Plot 31 - Under stairs



Plot 31 - Floor and service seals



Plot 31 - Service seals. Bricks to hold membrane in shape




Plot 31 - Floor



Plot 31 - Threshold



Plot 30 - Threshold

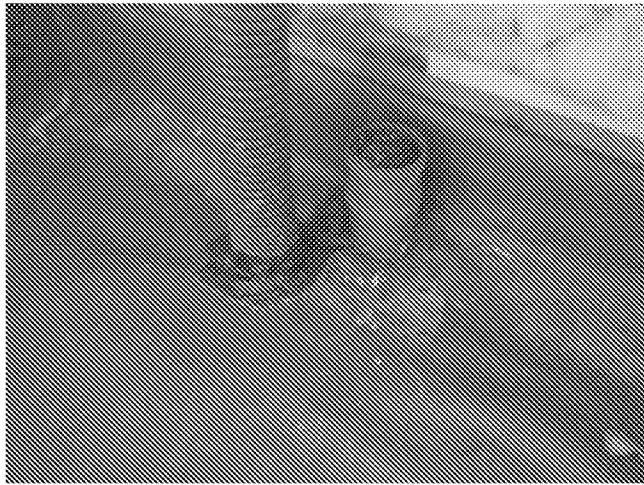

Plot 30 - Service seals



Plot 30 - Under stairs



Plot 30 - Floor



Plot 30 - Patching after removal of debris under membrane



Plot 30 - Threshold



Plot 29 - Threshold and entrance hallway



Plot 29 - Floor




Plot 29 - Under stairs



Plot 29 - Patching after removal of debris under membrane



Plot 29 - Floor with some patching

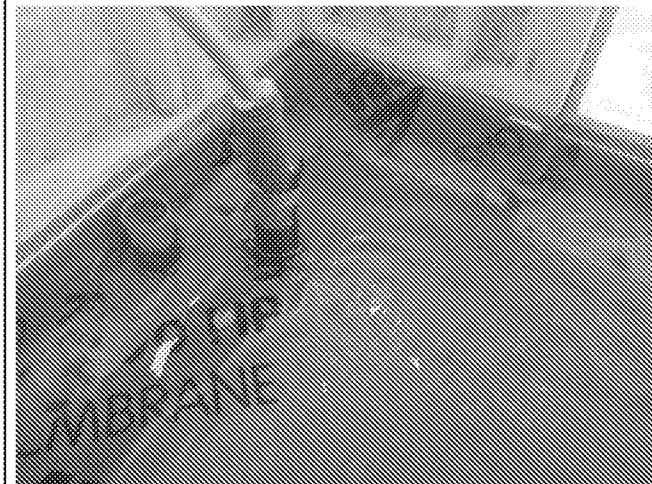

Plot 28 - Service seals




Plot 28 - Floor



Plot 28 - Floor with patching after removal of debris from under membrane



Pot 28 - Floor with some patching

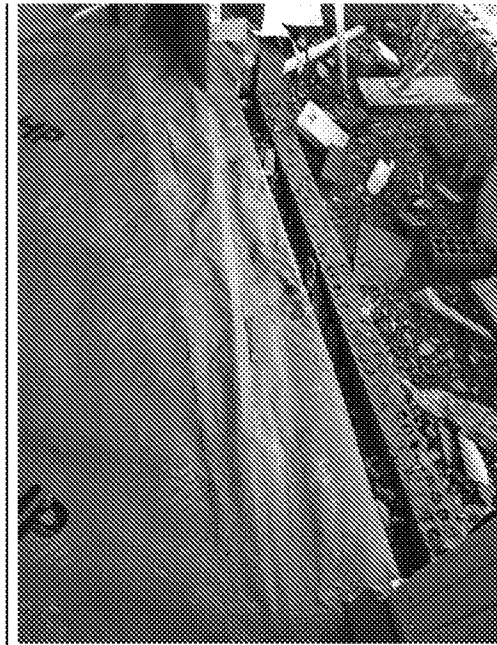

Plot 28 - Threshold with some patching




Plot 28 - Floor



Plot 28 - Floor with patching after removal of debris from under membrane



Plot 28 - Debris visible under membrane in doorway

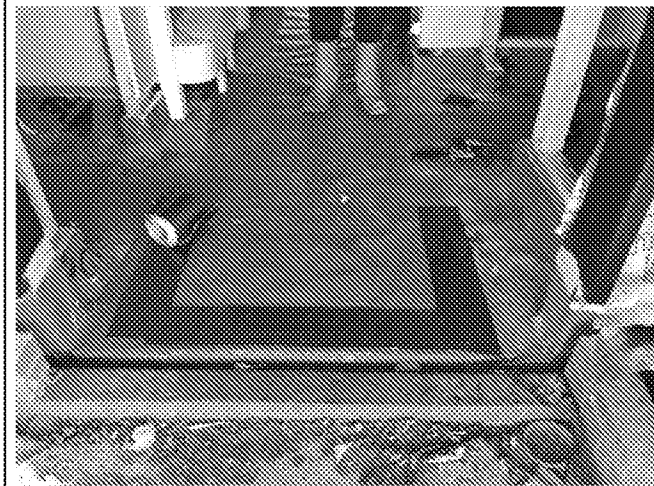

Plot 28 - Doorway area with patching after removal of debris from under membrane

5. PASS/FAIL

The gas protection measures inspected:

Details of issues

Approved by

No users

Date

Project Name	Cornfield Close
Project No.	GE18103
Client	Thakeham
Geo-Environmental Project Manager's Email	
Date	19/11/2020, 14:23
Site Engineer	

No users

Weather at time of inspection	Dry, cold, slightly cloudy
Gas Characteristic Situation	Characteristic Situation 2
Type of development and building/block checked	Terrace houses
Plot No.	24-27
Foundation Type	Suspended
Gas Protection Type	Passive
What is being inspected	☐ Venting ☒ Membrane ☐ Venting and Membrane

1. MEMBRANE

1.1 Condition of sub-grade and underside of membrane	Membrane sealed so unable to inspect
1.2 Gas membrane type	Key tech 400hp gas membrane (Red)
1.3 Gas membrane condition	Generally in good condition
Jointing tape product	Heat sealed double sided tape
1.5 Lapping design	At least 150mm
1.6 Laps, welds and joints seals	All heat sealed and taped joints
1.7 Service seals	Site made seals, all well sealed with heat sealed taped joints

Engineer's Prelim Assessment (Mem)

Pass

4. PHOTOGRAPHS

Photographs

(12 records)

Photograph	Photograph Title



Plot 27 services




Plot 27 detail



Plot 27 overview



Plot 26 corner and service

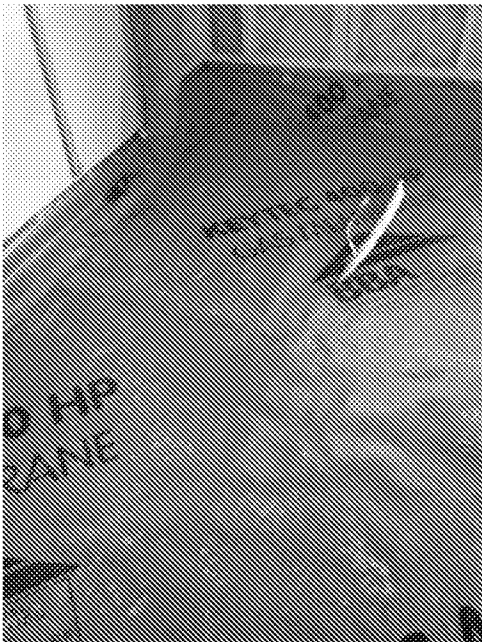


Plot 26 overview




Plot 26 repair



Plot 25 overview

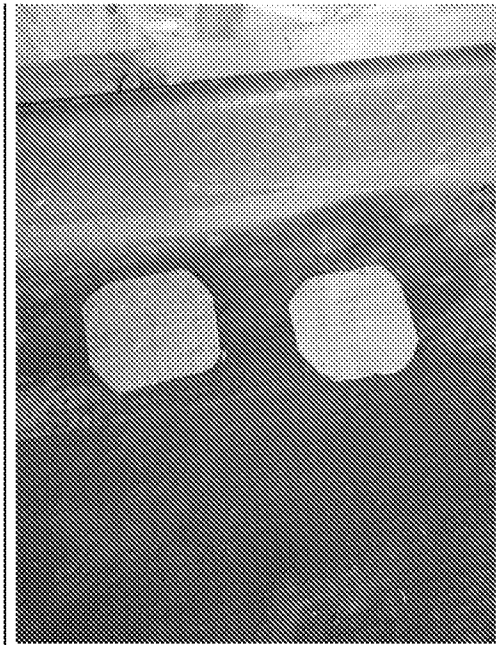

Plot 25 repairs

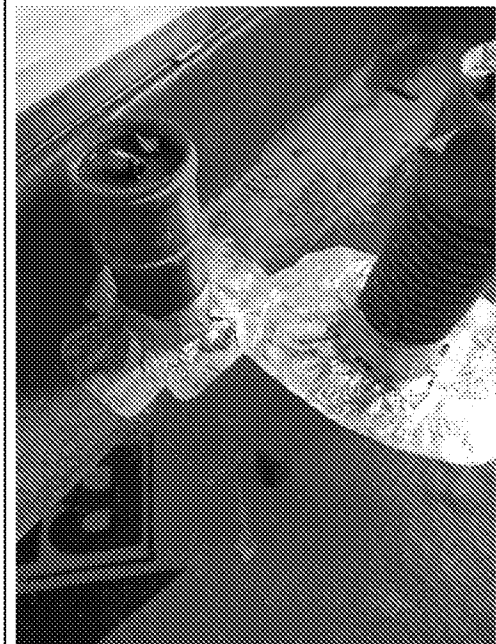


Plot 25 services



Plot 24 services



Plot 24 detail

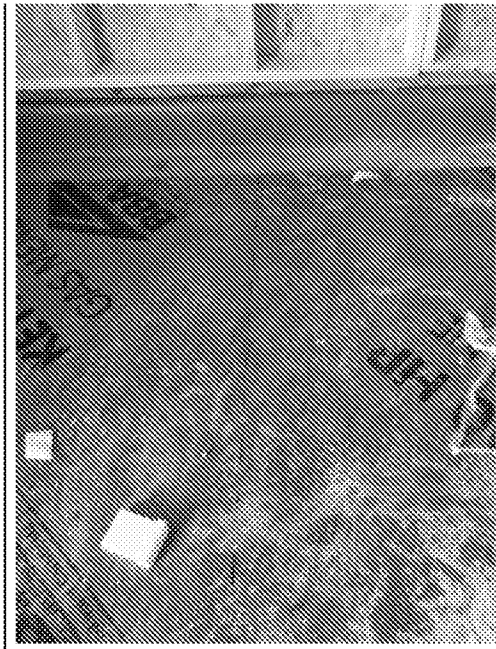

Plot 24 membrane join

5. PASS/FAIL

The gas protection measures inspected:

Details of issues

Approved by

No users

Date

Project Name	Cornfield Close, Littlehampton
Project No.	GE18103
Client	Thakeham Homes
Geo-Environmental Project Manager's Email	
Date	26/11/2020, 13:34
Site Engineer	

No users

Weather at time of inspection	Cool, cloudy dry
Gas Characteristic Situation	Characteristic Situation 2
Type of development and building/block checked	Residential with garages
Plot No.	16-17
Foundation Type	Raft
Gas Protection Type	Passive
What is being inspected	☐ Venting ☒ Membrane ☐ Venting and Membrane

1. MEMBRANE

1.1 Condition of sub-grade and underside of membrane	Unable to inspect. Fully sealed.
1.2 Gas membrane type	Red Keytec gas membrane
1.3 Gas membrane condition	Generally good condition. Any holes identified were patched during the visit.
Jointing tape product	Heat sealed joints.
1.5 Lapping design	Min 150mm overlap
1.6 Laps, welds and joints seals	Heat sealed joints with some tape patching.
1.7 Service seals	Services sealed with tape.

Engineer's Prelim Assessment (Mem)


Pass

4. PHOTOGRAPHS

Photographs

(10 records)

Photograph	Photograph Title

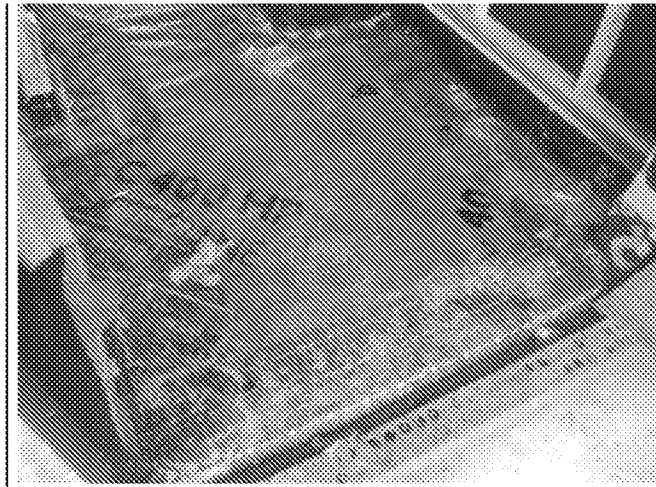

Plot 16 - threshold



Plot 16 - service seals



Plot 16 - under stairs



Plot 16 - floor and corner



Plot 16 - threshold



Plot 17 - entrance



Plot 17 - floor and service seal



Plot 17 - under stairs



Plot 17 - floor



Plot 17 - floor and corner details

5. PASS/FAIL

The gas protection measures inspected:

Details of issues

Approved by

No users

Date

Project Name	Cornfield Close
Project No.	GE18103
Client	Thakeham Homes
Geo-Environmental Project Manager's Email	[REDACTED]
Date	03/12/2020, 12:30
Site Engineer	[REDACTED]
 Katie O'Dea	[REDACTED]
Weather at time of inspection	Rainy, cold
Gas Characteristic Situation	Characteristic Situation 2
Type of development and building/block checked	Residential
Plot No.	18-19 complete, 50-59 perimeters
Foundation Type	Raft
Gas Protection Type	Passive
What is being inspected	☐ Venting ☒ Membrane ☐ Venting and Membrane

1. MEMBRANE

- | | |
|--|--|
| 1.1 Condition of sub-grade and underside of membrane | Underside of 18-19 unable to inspect - sealed. Underside if 50-59 in good condition. |
| 1.2 Gas membrane type | Red Keytec gas membrane |
| 1.3 Gas membrane condition | Generally good condition. Perimeter 50-59 membrane held in place with bricks to prevent wind damage. |
| Jointing tape product | Heat welded joints with some tape. |
| 1.5 Lapping design | Minimum 150mm overlap |
| 1.6 Laps, welds and joints seals | Heat welded joints with some tape. All well sealed. |
| 1.7 Service seals | Services well sealed in Plots 18-19. Plots 50-59 service seals in progress. |

Engineer's Prelim Assessment (Mem)

Pass

4. PHOTOGRAPHS


Photographs

(34 records)

Photograph	Photograph Title



Plot 18 - floor

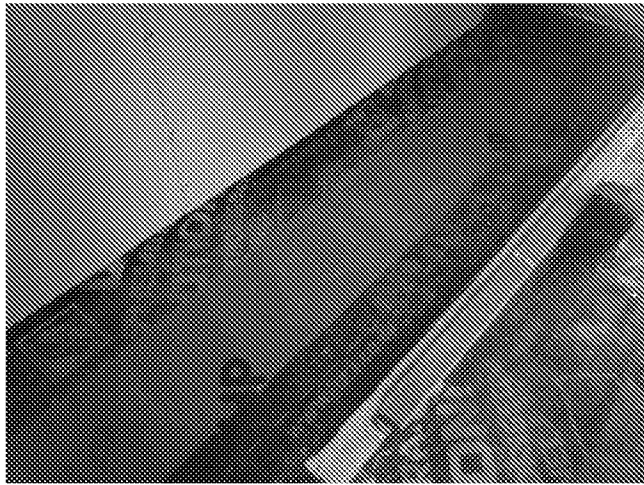

Plot 18 - under stairs



Plot 18 - floor



Plot 18 - Threshold



Plot 18 - Patching



Plot 18 - service seal




Plot 19 - Floor



Plot 19 - service seal



Plot 19 - floor

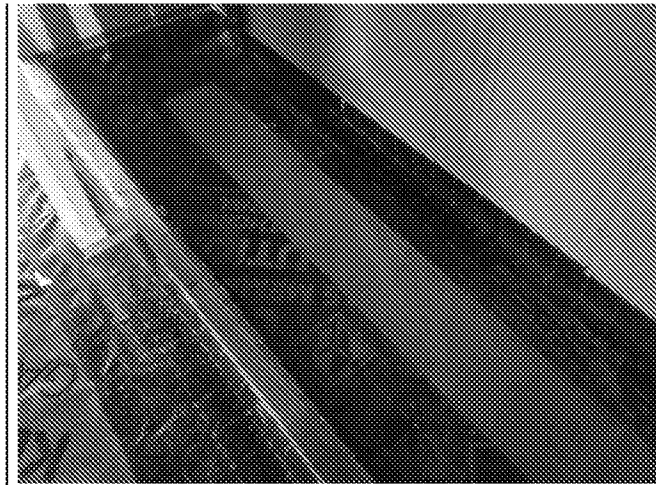

Plot 19 - under stairs




Plot 19 - Threshold



Plot 19 - Floor




Plot 50-51 perimeter

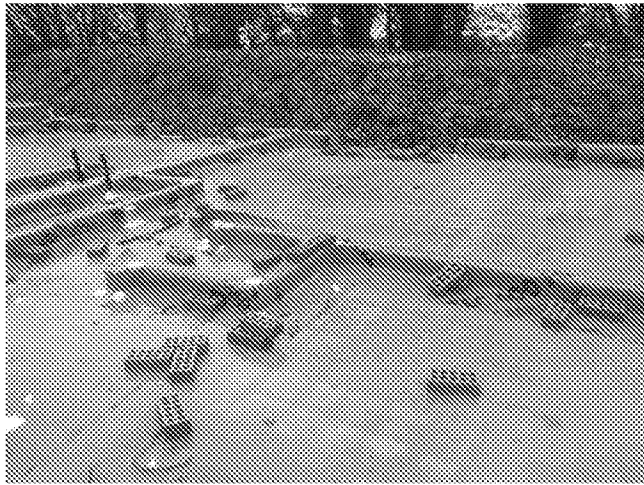

Plot 50-51 - perimeter



Plot 50-51 perimeter

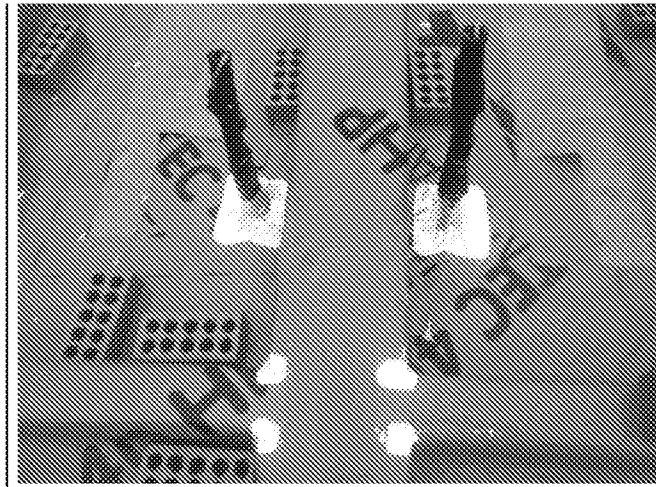


Plot 50-51 service seals



Plot 50-51 perimeter




Plot 52-53 perimeter

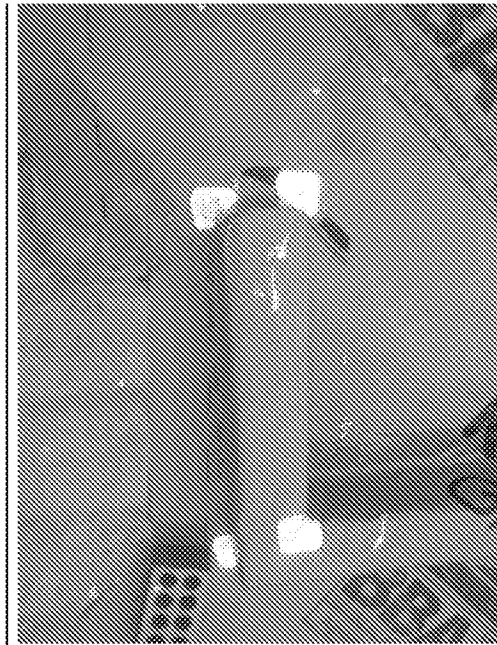




Plot 52-53 perimeter corner detail




Plot 52-53 perimeter

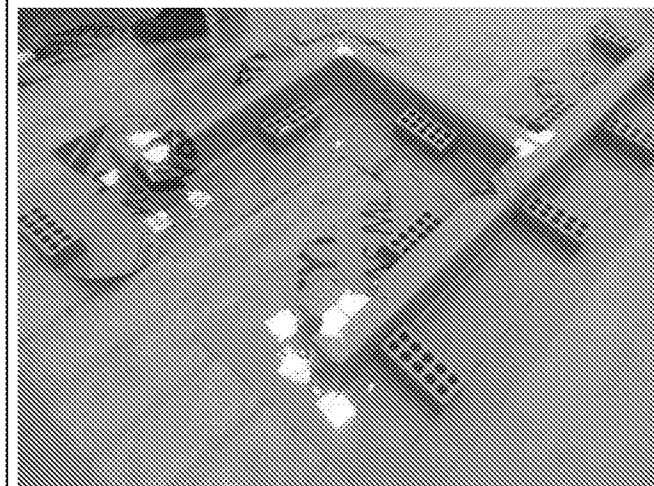

Plot 52-53 perimeter

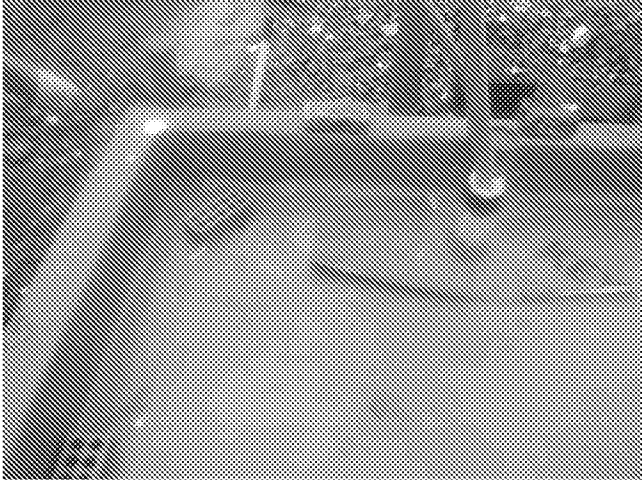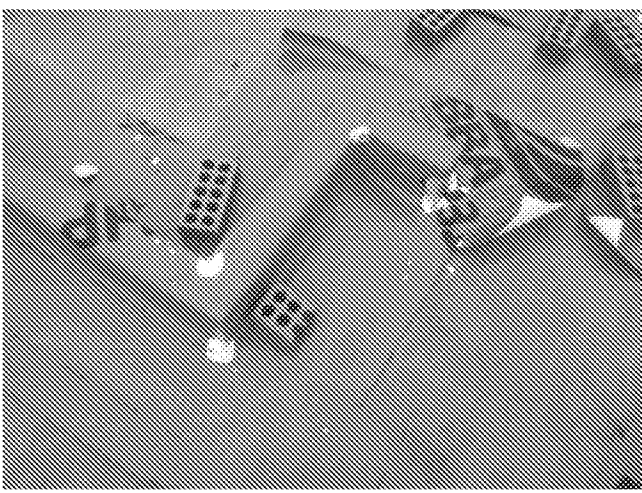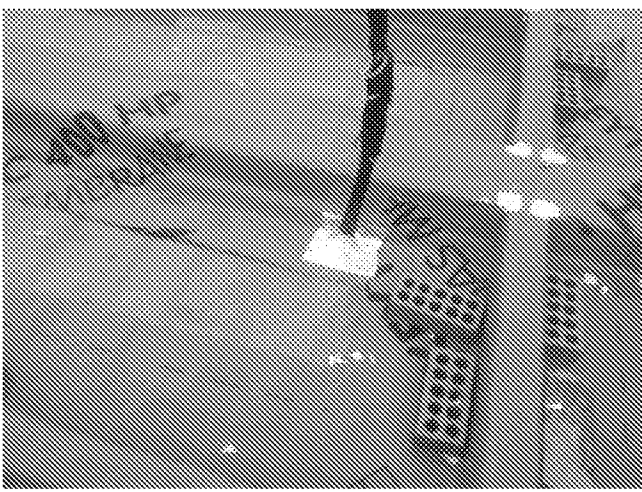	Plot 52-53 perimeter services not yet sealed
	Plot 52-53 perimeter
	Plot 52-53 perimeter services sealed

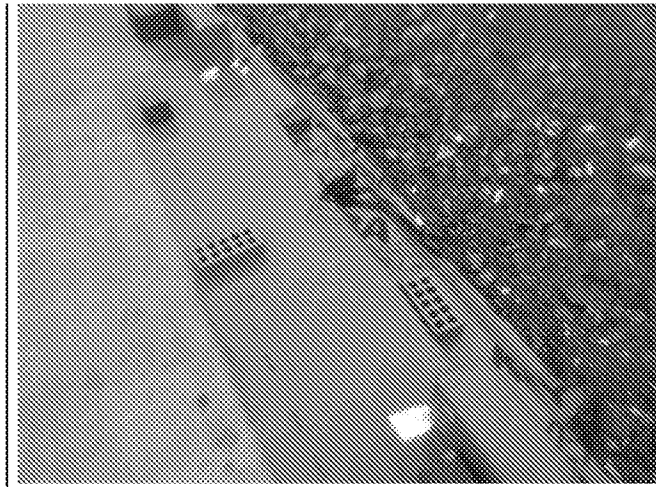


Plot 52-53 perimeter




Plot 52-53 perimeter



Plot 56-57 perimeter

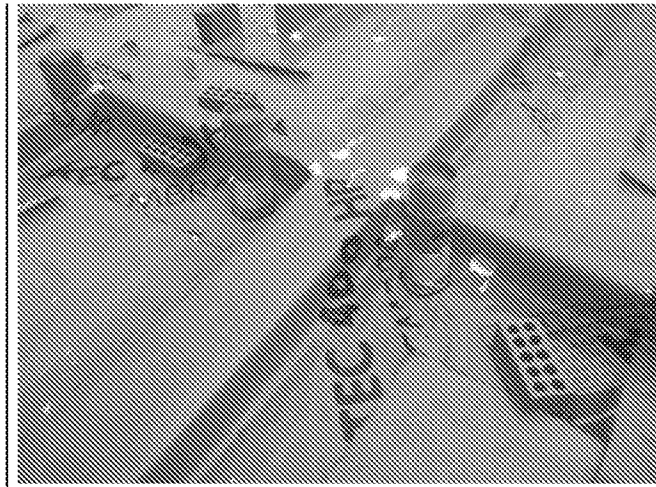

Plot 56-57 perimeter Service seals

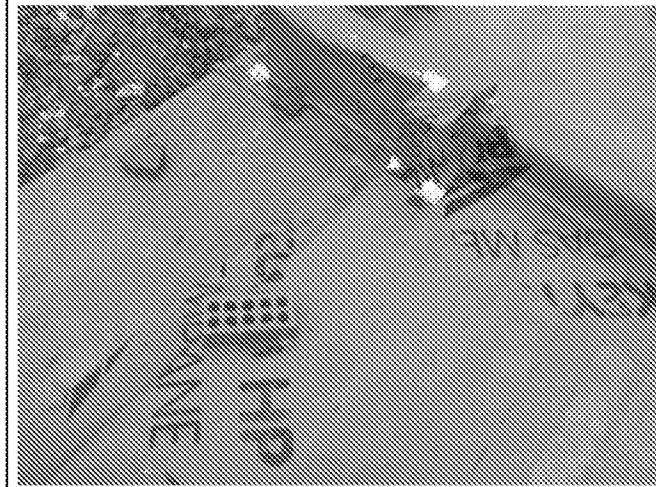


Plot 56-57 perimeter



Plot 56-57 perimeter



Plot 58-59 perimeter

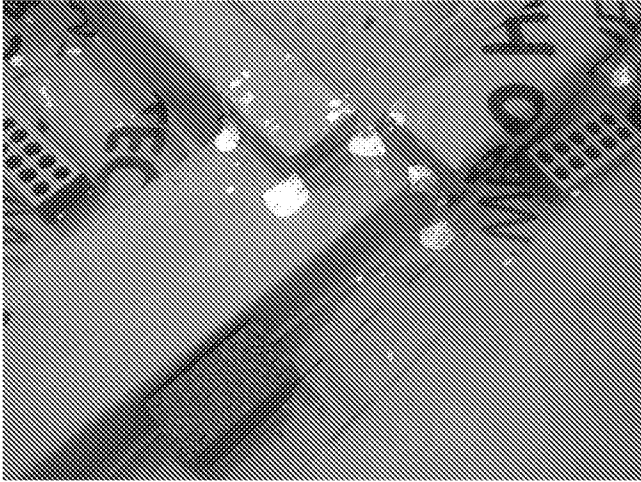

Plot 58-59 perimeter



Plot 58-59 perimeter service seal



Plot 58-59 perimeter Threshold

5. PASS/FAIL

The gas protection measures inspected:

Details of issues

Approved by

No users

Date

Project Name	Cornfield Close
Project No.	GE18103
Client	Thakeham Homes
Geo-Environmental Project Manager's Email	[REDACTED]
Date	10/12/2020, 08:32
Site Engineer	 Tom Grace [REDACTED]
Weather at time of inspection	Overcast with light rain, 8 degrees C.
Gas Characteristic Situation	Characteristic Situation 2
Type of development and building/block checked	Residential semi-detached with private gardens.
Plot No.	20 - 21 complete
Foundation Type	Raft
Gas Protection Type	Passive
What is being inspected	☐ Venting ☒ Membrane ☐ Venting and Membrane

1. MEMBRANE

1.1 Condition of sub-grade and underside of membrane	Concrete slab in good condition. Inspected roll of red Keytec gas membrane, new roll in good condition.
1.2 Gas membrane type	Red Keytec 400 HP gas membrane
1.3 Gas membrane condition	New rolls, good condition.
Jointing tape product	Heat welded joints with occasional tape
1.5 Lapping design	>150mm overlap
1.6 Laps, welds and joints seals	All neat and well sealed
1.7 Service seals	Services sealed correctly.

Engineer's Prelim Assessment (Mem)

Pass

4. PHOTOGRAPHS

Photographs

(17 records)

Photograph	Photograph Title




Plot 20 prior to install. Concrete slab in good condition.



Plot 21 prior to install concrete slab in good condition.



Plot 20 - entrance

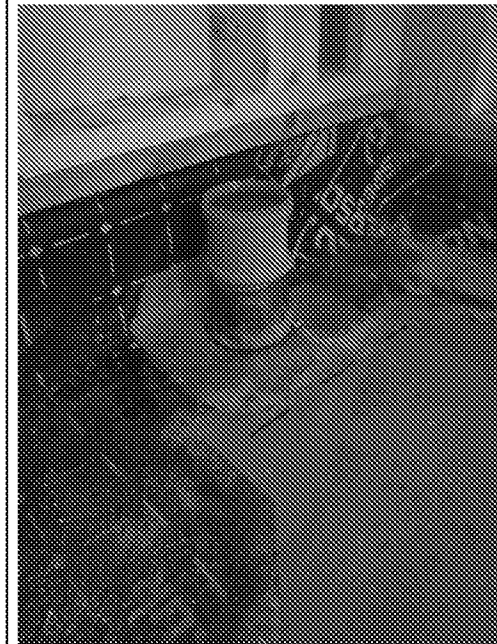

Plot 20 - sealed foul outlet WC




Plot 20 - sealed water in & foul outlet
Kitchen




Plot 20 - front of property all good.



Plot 20 - rear of property all good.

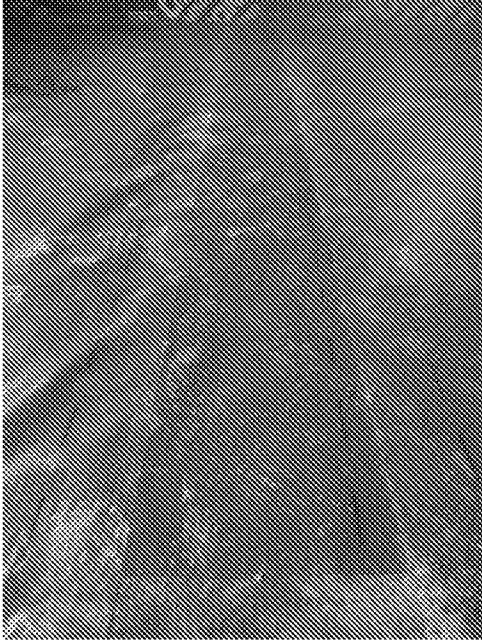

Plot 20 - all overlaps well jointed and sealed, >150mm overlap.

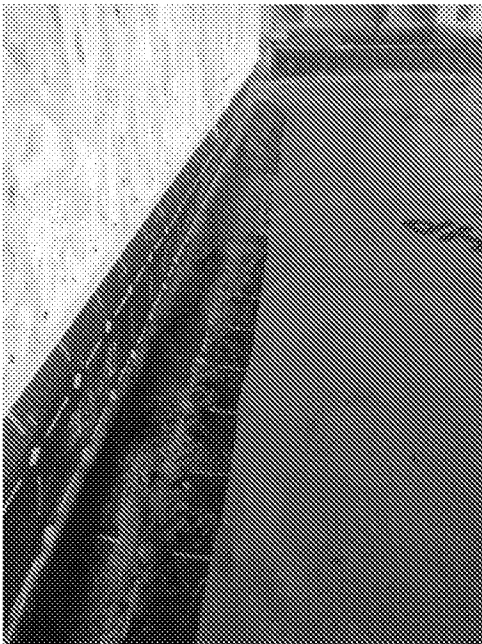


Plot 20 - perimeter seals all good.



Plot 20 - tape well sealed



Plot 21 - entrance

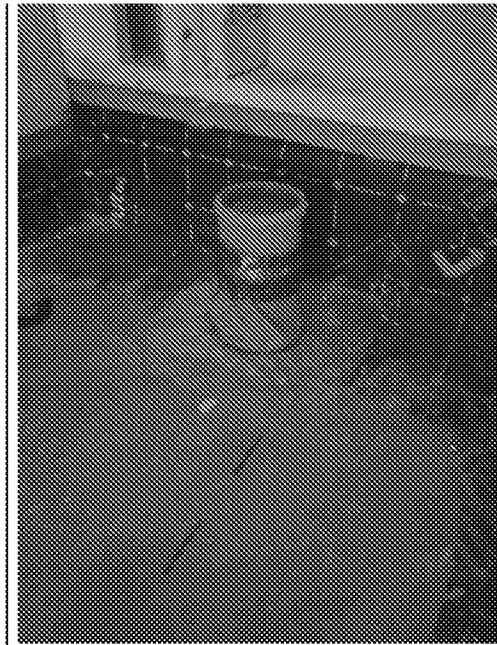

Plot 21 - foul outlet sealed WC



Plot 21 - water in and foul outlet sealed Kitchen.



Plot 21 - front of property all good.

	Plot 21 - rear of property all good.
	Plot 21 - all overlaps well jointed and sealed with >150mm overlap.
	Plot 21 - perimeter well sealed.

5. PASS/FAIL

Gas Protection Measures Inspection Report

The gas protection measures
inspected:

Details of issues

Approved by

No users

Date

Project Name	GE18103
Project No.	Cornfield Close
Client	Thakeham
Geo-Environmental Project Manager's Email	[REDACTED]
Date	17/12/2020, 12:35
Site Engineer	[REDACTED]
 Fiona Goode	[REDACTED]
Weather at time of inspection	Cool, slight breeze, dry
Gas Characteristic Situation	Characteristic Situation 3
Type of development and building/block checked	Semi-detached
Plot No.	22 and 23 (infills)
Foundation Type	Suspended
Gas Protection Type	Passive
What is being inspected	☐ Venting ☒ Membrane ☐ Venting and Membrane

1. MEMBRANE

1.1 Condition of sub-grade and underside of membrane	Unable to inspect as sealed
1.2 Gas membrane type	Keytec 400 hp gas resistant membrane
1.3 Gas membrane condition	Generally in good condition
Jointing tape product	Heat sealed joins with some taping
1.5 Lapping design	At least 150mm
1.6 Laps, welds and joints seals	All heat sealed and well sealed
1.7 Service seals	Services sealed with site made seals, all well sealed

Engineer's Prelim Assessment (Mem)

Pass

4. PHOTOGRAPHS

Photographs

(10 records)


Photograph	Photograph Title




Plot 22 overview




Plot 22 membrane joins

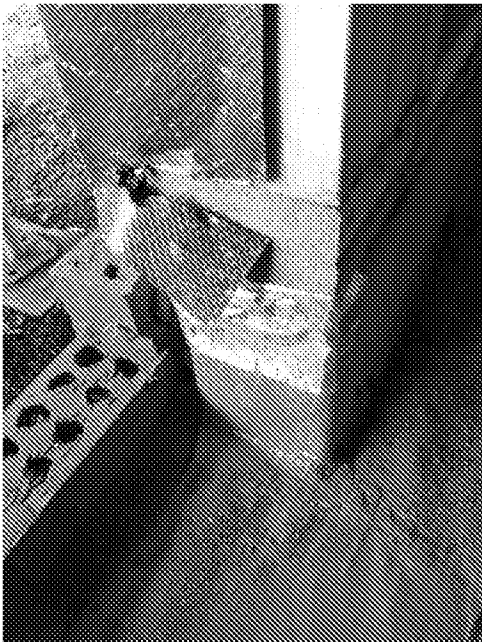


Plot 22 patch repair

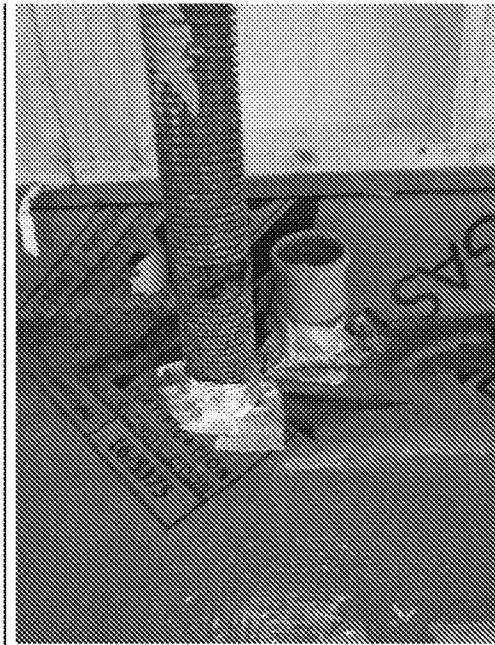

Plot 22 services

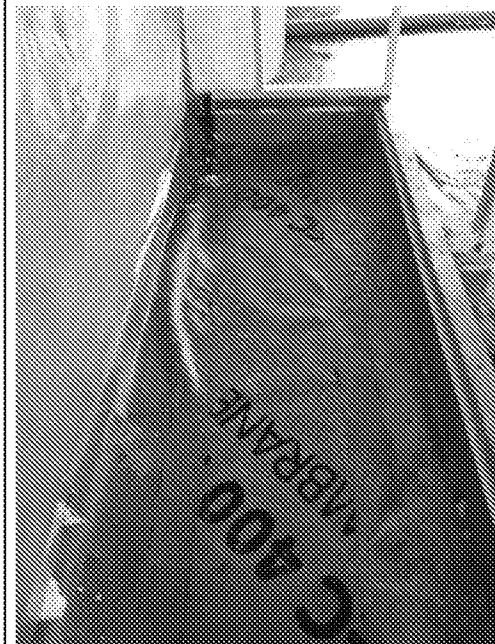

Plot 22 understair detail

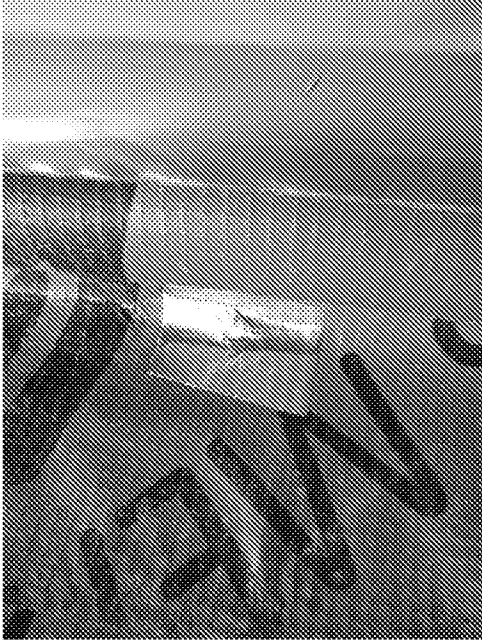


Plot 23 patch repair



Plot 23 corner detail



Plot 23 overview

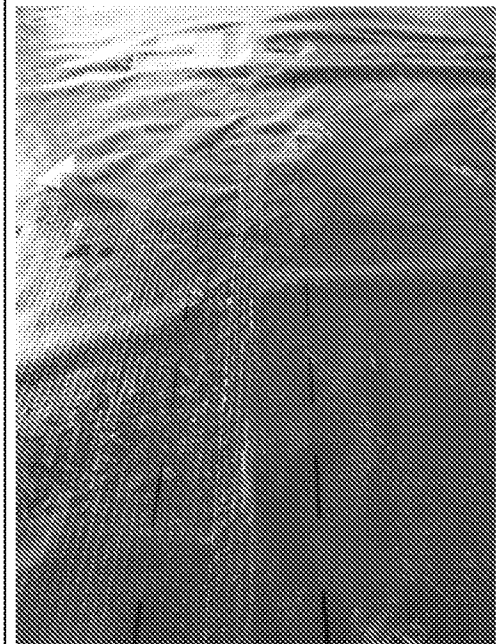

Plot 23 membrane joins



Plot 23 services

5. PASS/FAIL

The gas protection measures
inspected:

Details of issues

Approved by

No users

Date

Project Name	Cornfield Close, Littlehampton
Project No.	GE18103
Client	Thakeham
Geo-Environmental Project Manager's Email	
Date	21/01/2021, 11:32
Site Engineer	

No users

Weather at time of inspection	Dry, cool.
Gas Characteristic Situation	Characteristic Situation 2
Type of development and building/block checked	Residential and garages
Plot No.	Plots 47-49
Foundation Type	Suspended
Gas Protection Type	Passive
What is being inspected	☐ Venting ☒ Membrane ☐ Venting and Membrane

1. MEMBRANE

1.1 Condition of sub-grade and underside of membrane	Membrane fully sealed, unable to see underside.
1.2 Gas membrane type	Black gas membrane
1.3 Gas membrane condition	Surface muddy due to foot traffic in bad weather. Some leaves and debris on surface as plots not fully roofed and without windows. Otherwise in good condition. Any holes patched during site visit.
Jointing tape product	Heat welded joints.
1.5 Lapping design	Min 150mm
1.6 Laps, welds and joints seals	All in good condition.
1.7 Service seals	Service seals in good condition.

Engineer's Prelim Assessment (Mem)


Pass

4. PHOTOGRAPHS

Photographs

(18 records)

Photograph	Photograph Title

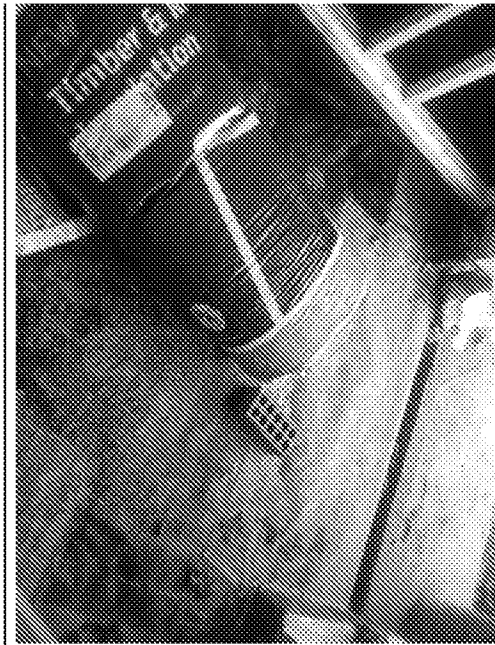

Plot 49 entrance. Undergoing insulation.




Plot 49 floor.



Plot 49 floor and service seal.



Plot 49 floor.

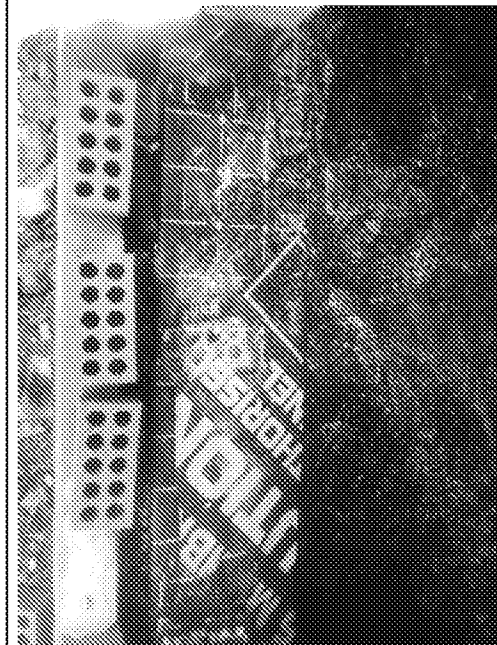


Plot 49 Threshold.



Plot 49 patching.



Plot 48 floor.

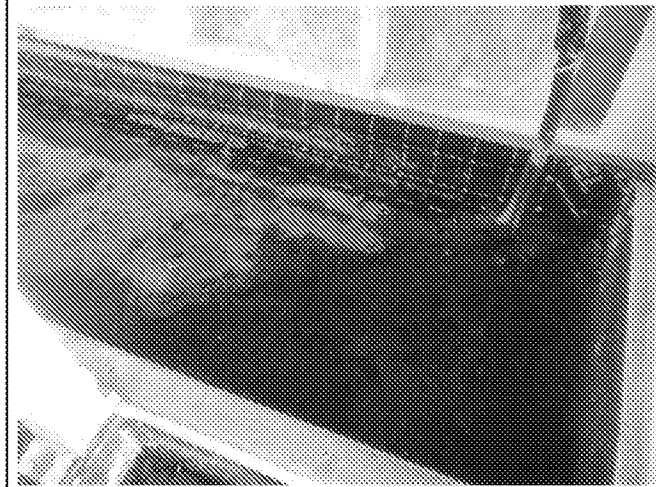


Plot 48 under stairs and service seal.




Plot 48 hallway.



Plot 48 floor.

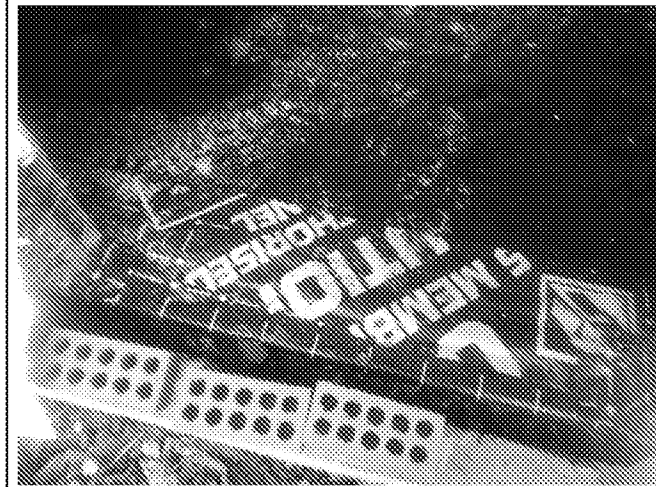

Plot 48 threshold.

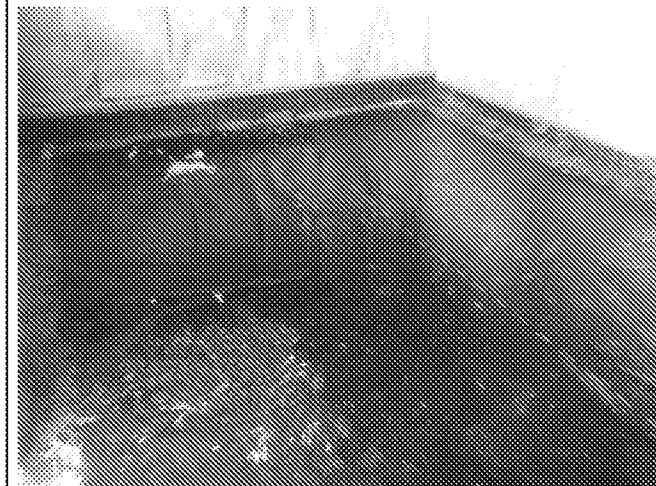

Plot 47 floor.




Plot 47 under stairs.




Plot 47 service seals.



Plot 47 floor.

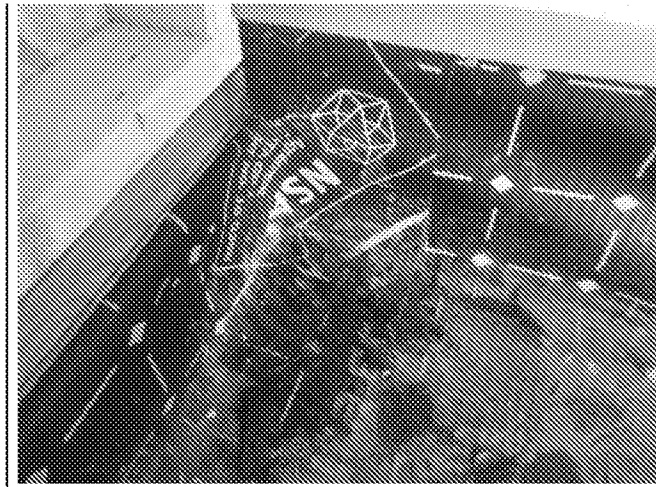

Plot 47 corner detail.

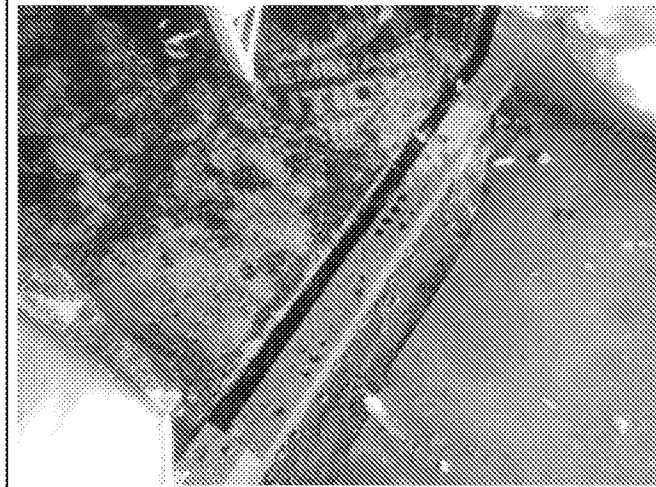

Plot 47 Threshold



Plot 47 patching.

5. PASS/FAIL

The gas protection measures
inspected:

Details of issues

Approved by

No users

Date

Project Name	Cornfield Close
Project No.	GE18103
Client	Thakeham Homes
Geo-Environmental Project Manager's Email	[REDACTED]
Date	26/01/2021, 09:38
Site Engineer	[REDACTED]
 Katie Brayne	[REDACTED]
Weather at time of inspection	Light rain, overcast.
Gas Characteristic Situation	Characteristic Situation 2
Type of development and building/block checked	Residential and garages
Plot No.	Block A (60 +61) 44, 45, 46
Foundation Type	Suspended
Gas Protection Type	Passive
What is being inspected	☐ Venting ☒ Membrane ☐ Venting and Membrane

1. MEMBRANE

1.1 Condition of sub-grade and underside of membrane	Membrane fully sealed, underside appears to have been swept.
1.2 Gas membrane type	Red gas membrane.
1.3 Gas membrane condition	60 and 61 selotex laid, lifted to inspect below.
Jointing tape product	Heat welded.
1.5 Lapping design	150mm minimum
1.6 Laps, welds and joints seals	All in very good condition.
1.7 Service seals	Sealed satisfactory.

Engineer's Prelim Assessment (Mem)

Pass

4. PHOTOGRAPHS

Photographs

(34 records)

Photograph	Photograph Title

	60 bathroom
	60 lounge
	60 lounge



60 lounge




60 kitchen





Service sealed and laped.

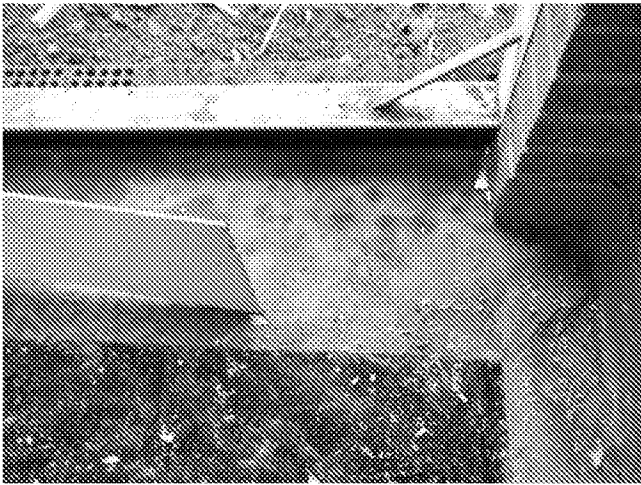

Laped patio.



60 kitchen diner.




60 Kitchen diner.




61



61

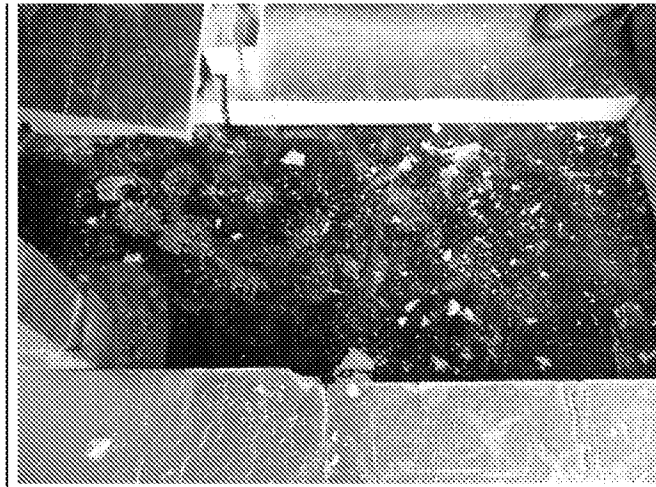

61

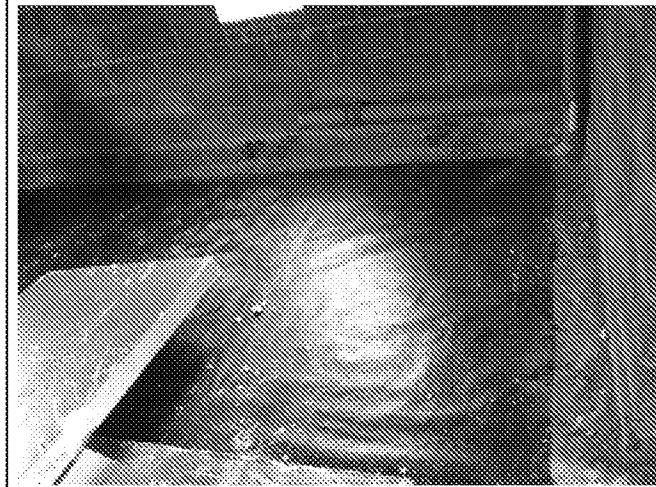


61



61



61

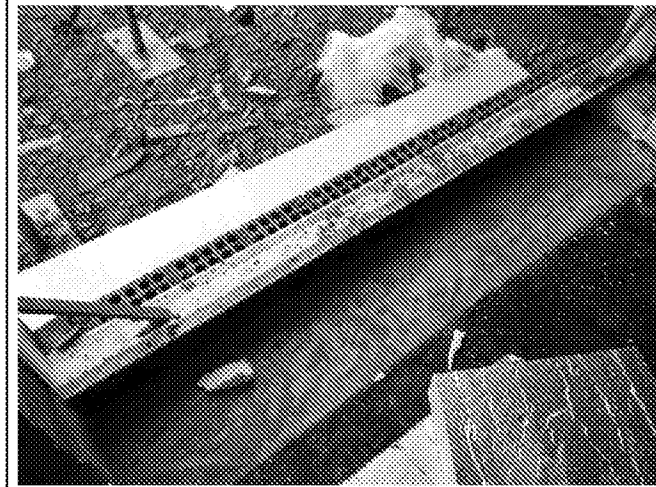

61



61



44



44




44




44



44

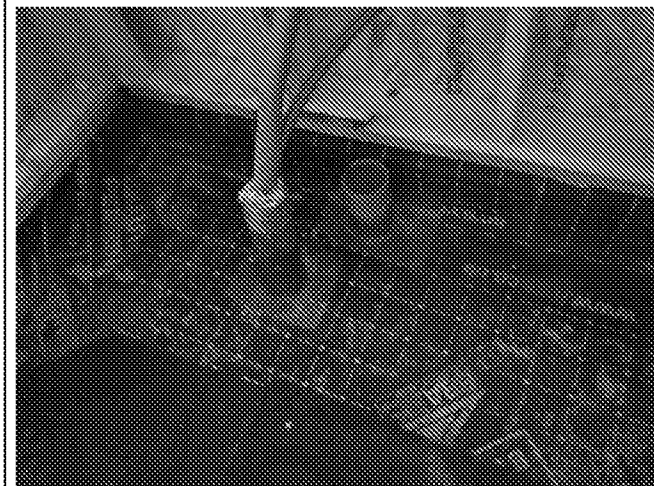

45

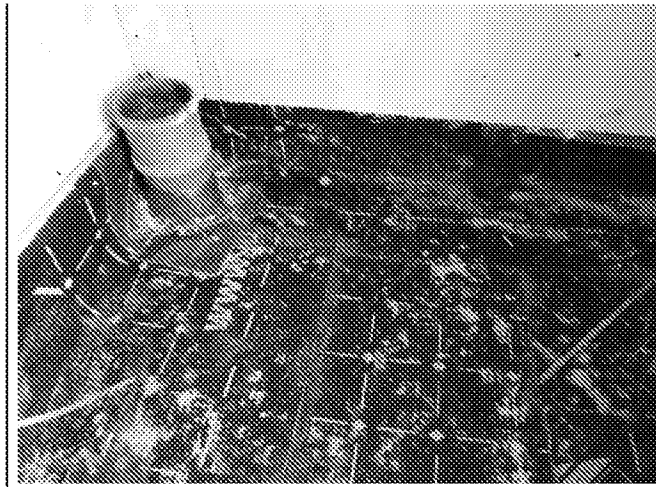

45



45



45




46



46



46

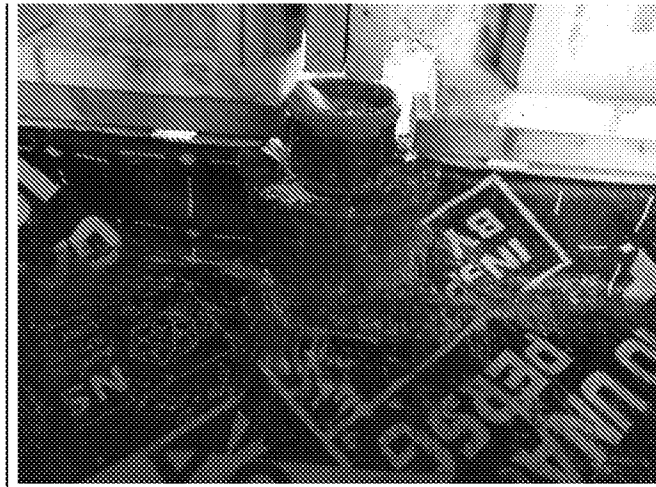


46



46



46

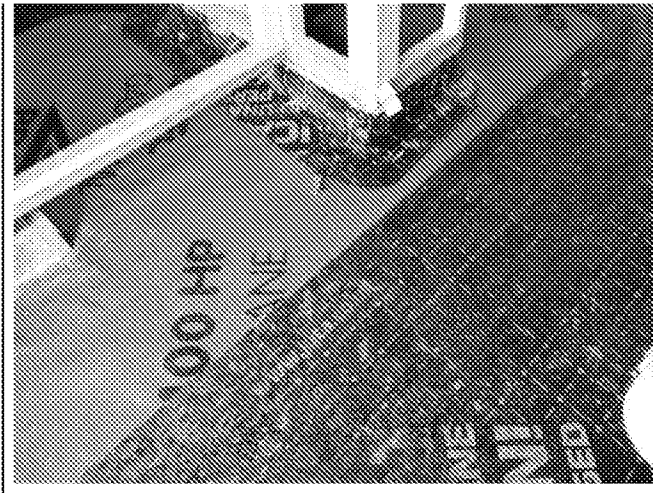

Nail under walkway. Plot 46 fail.

5. PASS/FAIL

The gas protection measures inspected:

Details of issues

Approved by

No users

Date

Project Name	Cornfield Close
Project No.	GE18103
Client	Thakeham Homes
Geo-Environmental Project Manager's Email	[REDACTED]
Date	11/02/2021, 14:04
Site Engineer	[REDACTED]
 Fiona Goode	[REDACTED]
Weather at time of inspection	Cold, overcast, breezy
Gas Characteristic Situation	Characteristic Situation 2
Type of development and building/block checked	Semi-detached houses
Plot No.	Plot 50 - 53
Foundation Type	Suspended
Gas Protection Type	Passive
What is being inspected	☐ Venting ☒ Membrane ☐ Venting and Membrane

1. MEMBRANE

1.1 Condition of sub-grade and underside of membrane	Unable to inspect as sealed
1.2 Gas membrane type	Black unbranded juta GP1 gas resistant membrane
1.3 Gas membrane condition	Membrane in very good condition well swept
Jointing tape product	Heat sealed double sided tape
1.5 Lapping design	At least 150mm overlap
1.6 Laps, welds and joints seals	Heat sealed, all well sealed
1.7 Service seals	Site made seals, well sealed

Engineer's Prelim Assessment (Mem)

Pass

4. PHOTOGRAPHS

Photographs

(14 records)


Photograph	Photograph Title



Plot 50 overview



Plot 50 joins

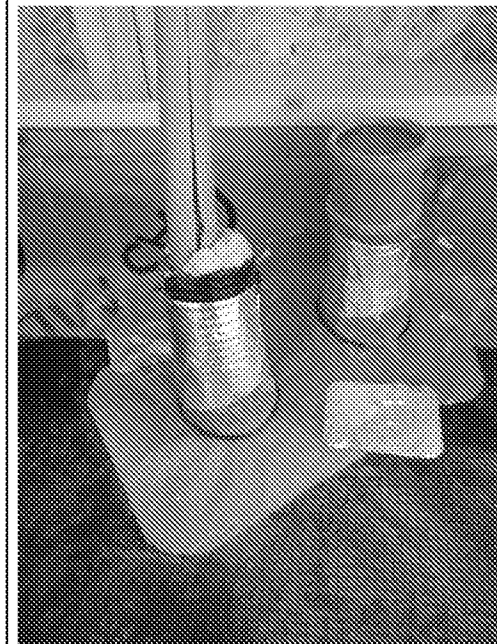

Plot 50 services



Plot 50




Plot 51



Plot 51 services



Plot 51 overview

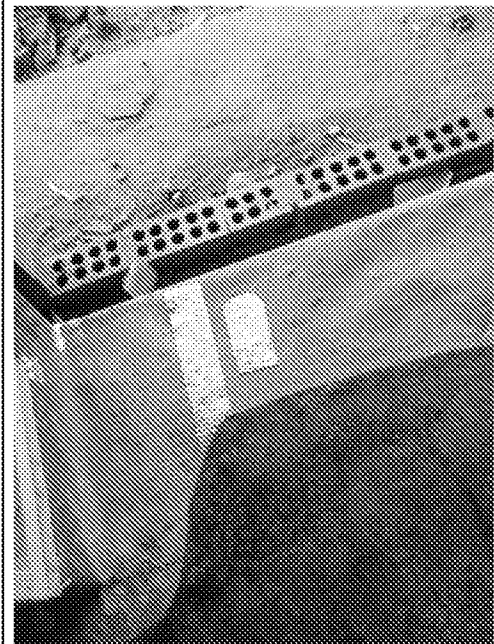


Plot 51 repairs




Plot 52



Plot 52 overview

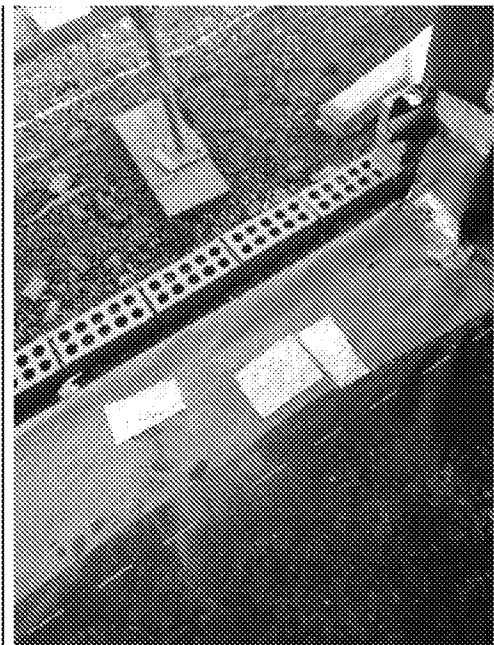


Plot 52 patch repair

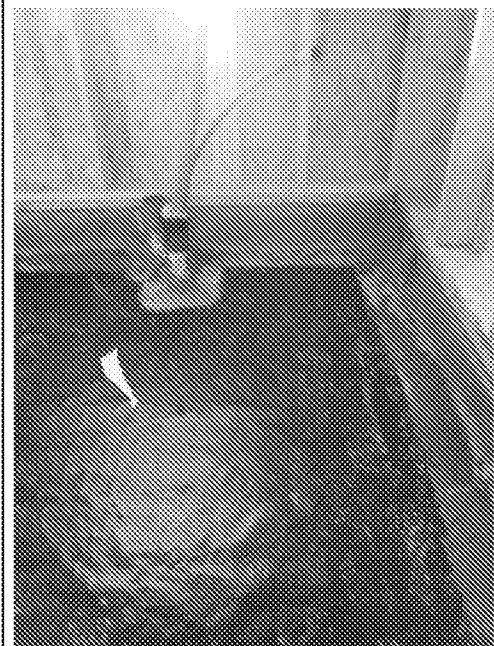

Plot 53



Plot 53 joins

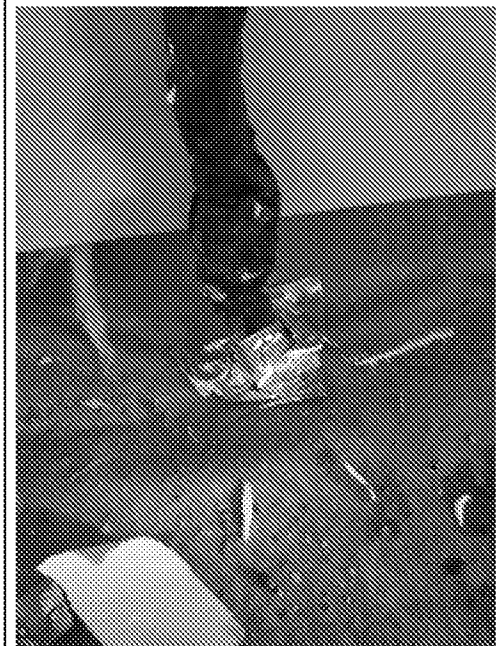

Plot 53 service seal

5. PASS/FAIL

The gas protection measures
inspected:

Details of issues

Approved by

No users

Date

Project Name	Cornfield Close, Littlehampton
Project No.	GE18103
Client	Thakeham Homes
Geo-Environmental Project Manager's Email	
Date	25/02/2021, 11:39
Site Engineer	

No users

Weather at time of inspection	Dry, cloudy, mild
Gas Characteristic Situation	Characteristic Situation 2
Type of development and building/block checked	Residential
Plot No.	Plots 54-57
Foundation Type	Suspended
Gas Protection Type	Passive
What is being inspected	☐ Venting ☒ Membrane ☐ Venting and Membrane

1. MEMBRANE

1.1 Condition of sub-grade and underside of membrane	Unable to inspect, membrane fully sealed.
1.2 Gas membrane type	Red Keytec gas membrane.
1.3 Gas membrane condition	Gas membrane generally in good condition. Any holes identified were repaired during the site visit.
Jointing tape product	Heat welded joints.
1.5 Lapping design	Min 150mm overlap.
1.6 Laps, welds and joints seals	All in good condition.
1.7 Service seals	Service seals all in good condition.

Engineer's Prelim Assessment (Mem)

Pass

4. PHOTOGRAPHS


Photographs

(25 records)

Photograph	Photograph Title




Plot 54 entrance

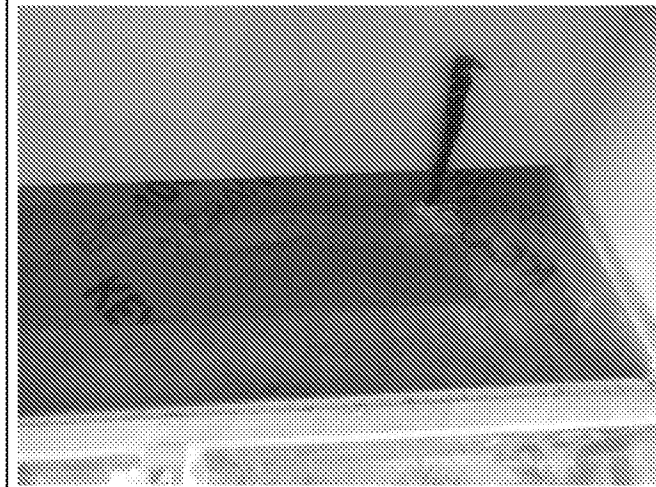


Plot 54 under stairs



Plot 54 floor

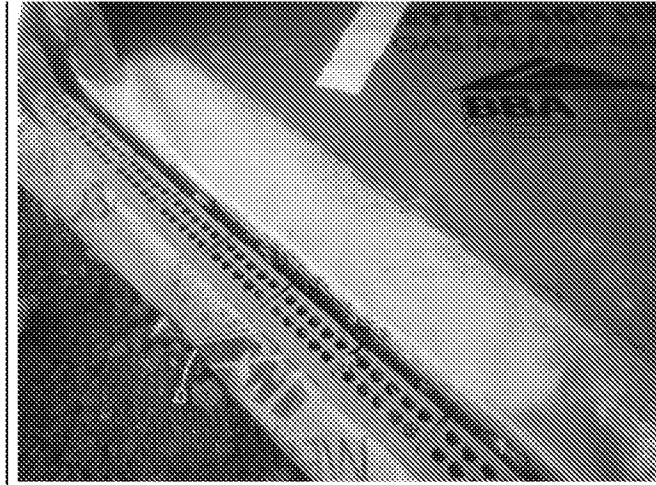


Plot 54 threshold

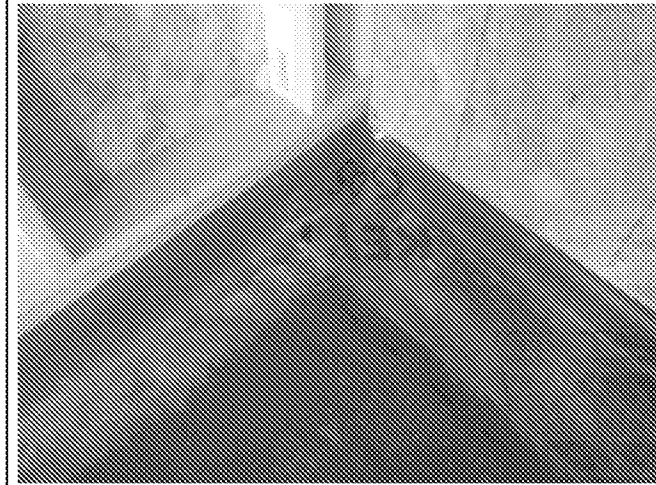

Plot 54 corner detail



Plot 55 entrance

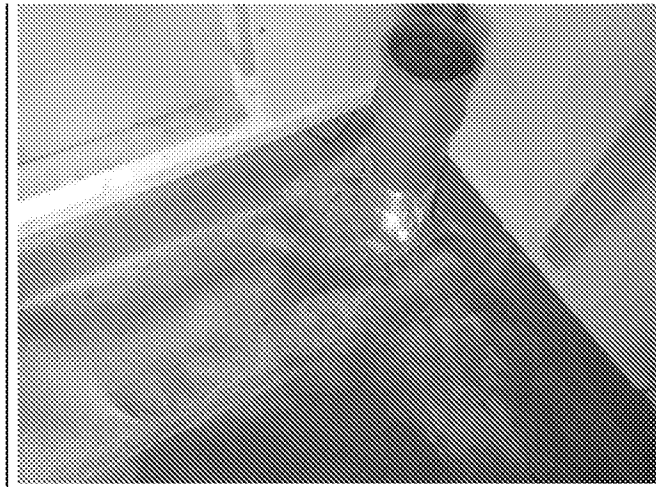

Plot 55 service seal



Plot 55 floor




Plot 55 under stairs



Plot 55 floor



Plot 55 floor and threshold

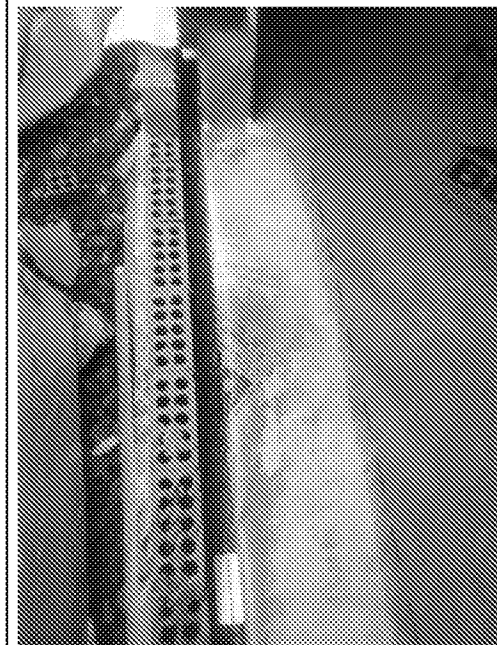

Plot 55 threshold



Plot 55 patch repair



Plot 56 threshold



Plot 56 floor




Plot 56 under stairs




Plot 56 service seals



Plot 56 floor

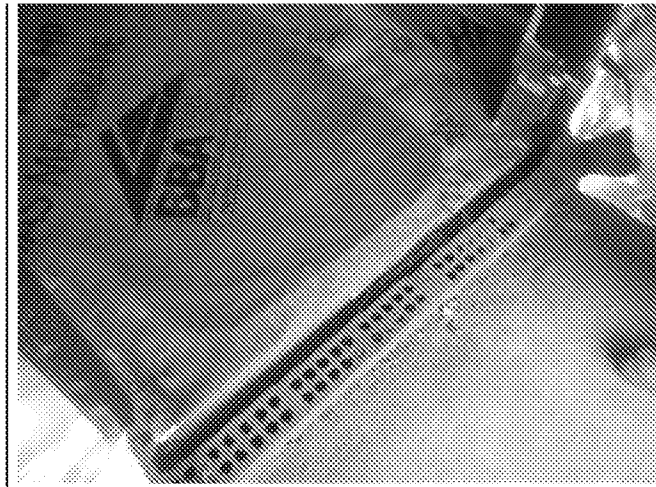


Plot 56 threshold

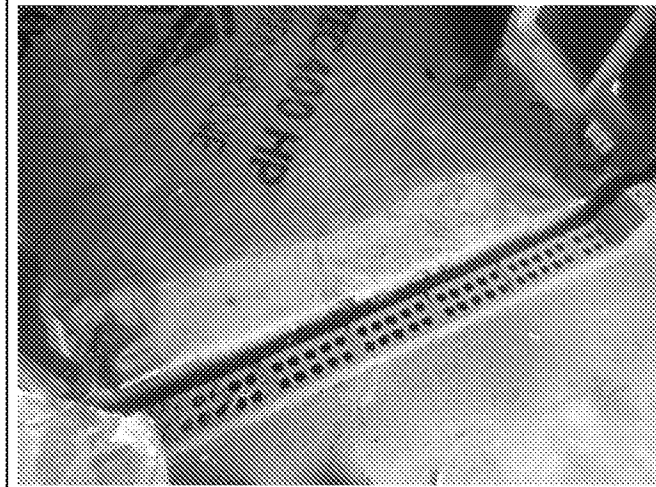

Plot 57 threshold



Plot 57 service seals

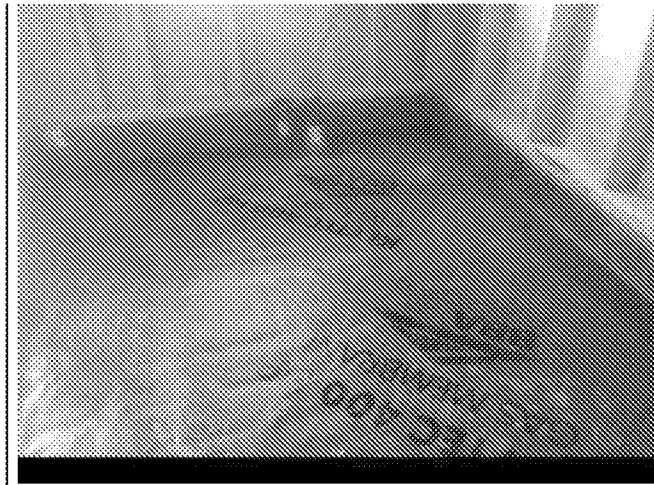

Plot 57 floor and service seals



Plot 57 under stairs



Plot 57 threshold



Plot 57 floor and patching underway

5. PASS/FAIL

The gas protection measures inspected:

Details of issues

Approved by

No users

Date

Project Name	Cornfield Close
Project No.	GE18103
Client	Thakeham Homes
Geo-Environmental Project Manager's Email	[REDACTED]
Date	11/03/2021, 13:36
Site Engineer	 Katie O'Dea [REDACTED]
Weather at time of inspection	Sunny, cool, windy
Gas Characteristic Situation	Characteristic Situation 2
Type of development and building/block checked	Residential
Plot No.	58-59
Foundation Type	Suspended
Gas Protection Type	Passive
What is being inspected	☐ Venting ☒ Membrane ☐ Venting and Membrane

1. MEMBRANE

1.1 Condition of sub-grade and underside of membrane .

1.2 Gas membrane type .

1.3 Gas membrane condition .

Jointing tape product .

1.5 Lapping design .

1.6 Laps, welds and joints seals .

1.7 Service seals .

Engineer's Prelim Assessment (Mem)

Pass

4. PHOTOGRAPHS

Photographs

(14 records)

Photograph	Photograph Title



Plot 58



Plot 58 floor and service seal





Plot 58 under stairs



Plot 58 floor




Plot 58 Threshold




Plot 58 patch repair



Plot 59

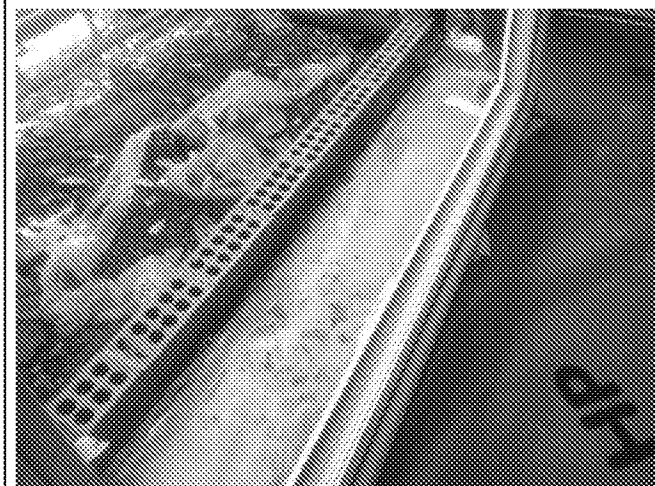

5. PASS/FAIL

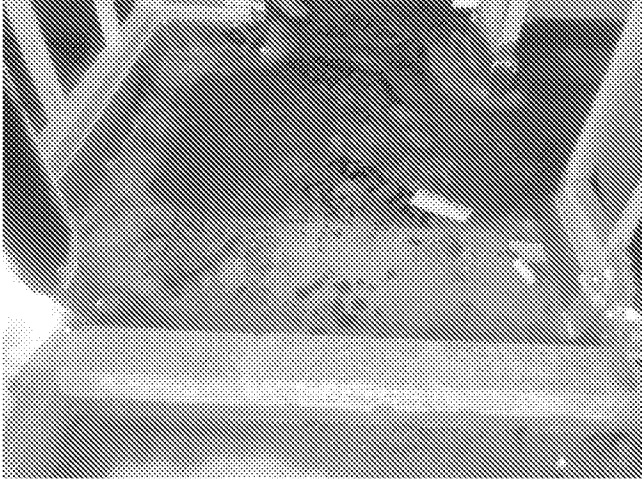The gas protection measures inspected:

Details of issues

Approved by

No users

Date

Project Name	Cornfield Close
Project No.	GE18103
Client	Thakeham
Geo-Environmental Project Manager's Email	[REDACTED]
Date	17/03/2021, 10:39
Site Engineer	 Fiona Goode [REDACTED]
Weather at time of inspection	Dry, cool, breezy
Gas Characteristic Situation	Characteristic Situation 2
Type of development and building/block checked	Flats
Plot No.	Block A and Block B
Foundation Type	Suspended
Gas Protection Type	Passive
What is being inspected	☐ Venting ☒ Membrane ☐ Venting and Membrane

1. MEMBRANE

1.1 Condition of sub-grade and underside of membrane	Unable to inspect as sealed
1.2 Gas membrane type	Keytec 400 gas resistant membrane
1.3 Gas membrane condition	Block B - Main floor area generally clear however membrane did require sweeping. Materials were being stored on top of membrane in stairwell and a lot of rubble and debris on membrane in the smaller rooms Block A membrane needs clearing and materials being stored on it
Jointing tape product	Heat sealed joints mainly welded some heat sealed taped joints
1.5 Lapping design	At least 150mm overlap
1.6 Laps, welds and joints seals	All heat sealed joints. Block B - A large number of patch repairs are required Block A - seal around stairs is not sufficient
1.7 Service seals	Services sealed with site made seals, all well sealed


Engineer's Prelim Assessment (Mem)

Remedial Measures Required

4. PHOTOGRAPHS

Photographs

(15 records)

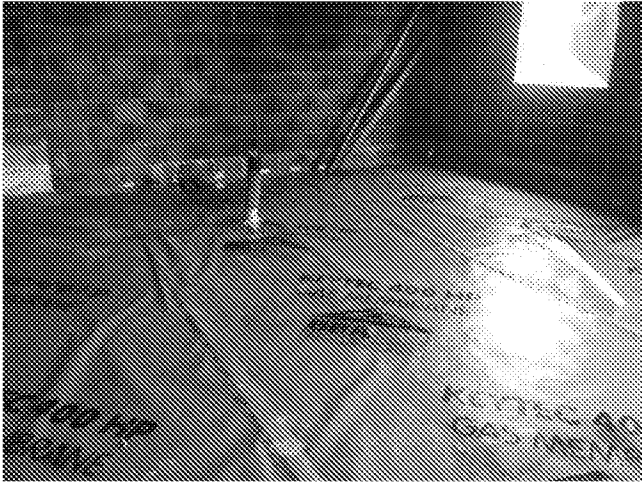Photograph	Photograph Title
	Block B overview
	Block B membrane joins
	Block B patch repairs