

## ALL HOURS PLUMBING

All Hours Plumbing Ltd  
70 Widley Road, Stamshaw  
Portsmouth, Hants  
Tel: [REDACTED]

### Project-Information

|                           |                  |                      |                     |
|---------------------------|------------------|----------------------|---------------------|
| Project Name:<br>Tye Lane | Contract Number: | Contact:<br>Aeropark | Date:<br>14/04/2026 |
|---------------------------|------------------|----------------------|---------------------|

|            |                                          |
|------------|------------------------------------------|
| Client:    | Aeropark                                 |
| Contact:   |                                          |
| Position:  |                                          |
| Road:      | Hounsdown House, Hounsdown Business Park |
| Town:      | Southampton                              |
| Post Code: | SO40 9LX                                 |
| County:    | Hampshire                                |
| Telephone: |                                          |

|             |                          |
|-------------|--------------------------|
| Contractor: | All Hours Plumbing Ltd   |
| Contact:    | Steve Guest              |
| Position:   | Owner                    |
| Road:       | 70 Widley Road, Stamshaw |
| Town:       | Portsmouth               |
| County:     | Hampshire                |
| Telephone:  | [REDACTED]               |
| Fax:        |                          |
| E-Mail:     | [REDACTED]               |


|            |             |
|------------|-------------|
| Site:      | Tye Lane    |
| Engineer:  |             |
| Position:  |             |
| Road:      | Tye Lane    |
| Town:      | Walberton   |
| County:    | West Sussex |
| Telephone: |             |

Inspection Report

|                                    |                                            |                                                  |                                                     |                     |        |
|------------------------------------|--------------------------------------------|--------------------------------------------------|-----------------------------------------------------|---------------------|--------|
| Date:<br>14/04/2026                | Job No:                                    | Weather:<br>Dry                                  | Operator:<br>Mick                                   | Section Number<br>2 | PLR:   |
| Present:                           | Vehicle:<br>[REDACTED]                     | Camera:<br>Camera 1                              | Preset:                                             | Cleaned:<br>Yes     | Grade: |
| Site: Tye Lane<br>Place: Walberton |                                            | Division:<br>District: S.W<br>Tape No: 1         | Start MH: SMH 14<br>End MH: SMH 13<br>Total Length: |                     |        |
| Purpose:<br>Use:<br>Catchment:     | Structural Defects<br>STORM<br>P1 Schedule | Size/Shape:<br>Material:<br>Lining:<br>Category: | Circular dia 375mm<br>PLASTIC                       |                     |        |

Position Code Observation

0.0M ST Start Of Survey  
0.0M WL Water Level 0 %

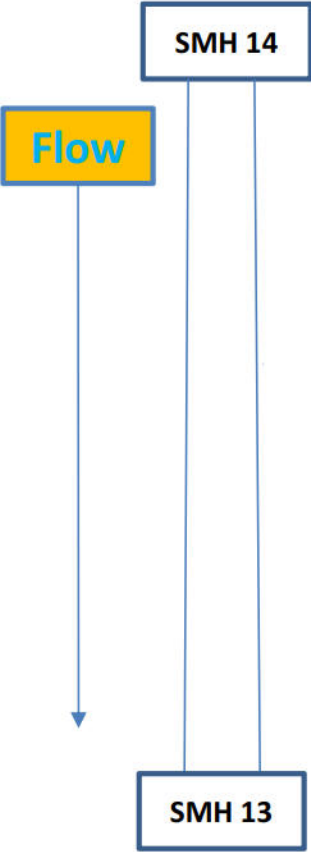

5.0M JN Line Drops In From The Left

6.1M JN Line Drops In From The Right

13.1M MH Camera Enters Manhole S 13

REM ; THERE ARE NO MAJOR DEFECTS WITH THIS SECTION OF PIPE


|                    |                         |
|--------------------|-------------------------|
| Structural Defects | Constructional Features |
| Service Defects    | Miscellaneous Features  |

Inspection Report

|                                    |                                            |                                                  |                                                     |                     |        |
|------------------------------------|--------------------------------------------|--------------------------------------------------|-----------------------------------------------------|---------------------|--------|
| Date:<br>14/04/2026                | Job No:                                    | Weather:<br>Dry                                  | Operator:<br>Mick                                   | Section Number<br>2 | PLR:   |
| Present:                           | Vehicle:<br>[REDACTED]                     | Camera:<br>Camera 1                              | Preset:                                             | Cleaned:<br>Yes     | Grade: |
| Site: Tye Lane<br>Place: Walberton |                                            | Division:<br>District: S.W<br>Tape No: 1         | Start MH: SMH 14<br>End MH: SMH 13<br>Total Length: |                     |        |
| Purpose:<br>Use:<br>Catchment:     | Structural Defects<br>STORM<br>P1 Schedule | Size/Shape:<br>Material:<br>Lining:<br>Category: | Circular dia 375mm<br>PLASTIC                       |                     |        |

Position Code Observation

0.0M ST Start Of Survey  
0.0M WL Water Level 0 %

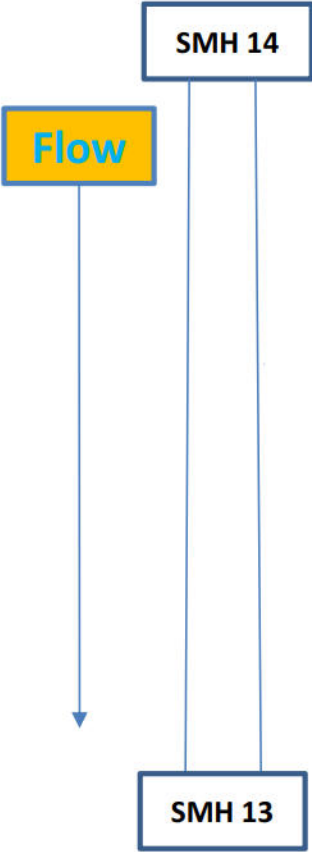

5.0M JN Line Drops In From The Left

6.1M JN Line Drops In From The Right

13.1M MH Camera Enters Manhole S 13

REM ; THERE ARE NO MAJOR DEFECTS WITH THIS SECTION OF PIPE


|                    |                         |
|--------------------|-------------------------|
| Structural Defects | Constructional Features |
| Service Defects    | Miscellaneous Features  |

Inspection Report

|                                    |                                            |                                                                             |                   |                                                     |        |
|------------------------------------|--------------------------------------------|-----------------------------------------------------------------------------|-------------------|-----------------------------------------------------|--------|
| Date:<br>14/04/2026                | Job No:                                    | Weather:<br>Dry                                                             | Operator:<br>Mick | Section Number<br>3                                 | PLR:   |
| Present:                           | Vehicle:<br>[REDACTED]                     | Camera:<br>Camera 1                                                         | Preset:           | Cleaned:<br>Yes                                     | Grade: |
| Site; Tye Lane<br>Place: Walberton |                                            | Division:<br>District: S.W<br>Tape No: 1                                    |                   | Start MH: SMH 13<br>End MH: SMH 12<br>Total Length: |        |
| Purpose:<br>Use:<br>Catchment:     | Structural Defects<br>STORM<br>P1 Schedule | Size/Shape: Circular dia 375mm<br>Material: PLASTIC<br>Lining:<br>Category: |                   |                                                     |        |

Position Code Observation

0.0M ST Start Of Survey  
0.0M WL Water Level 0 %

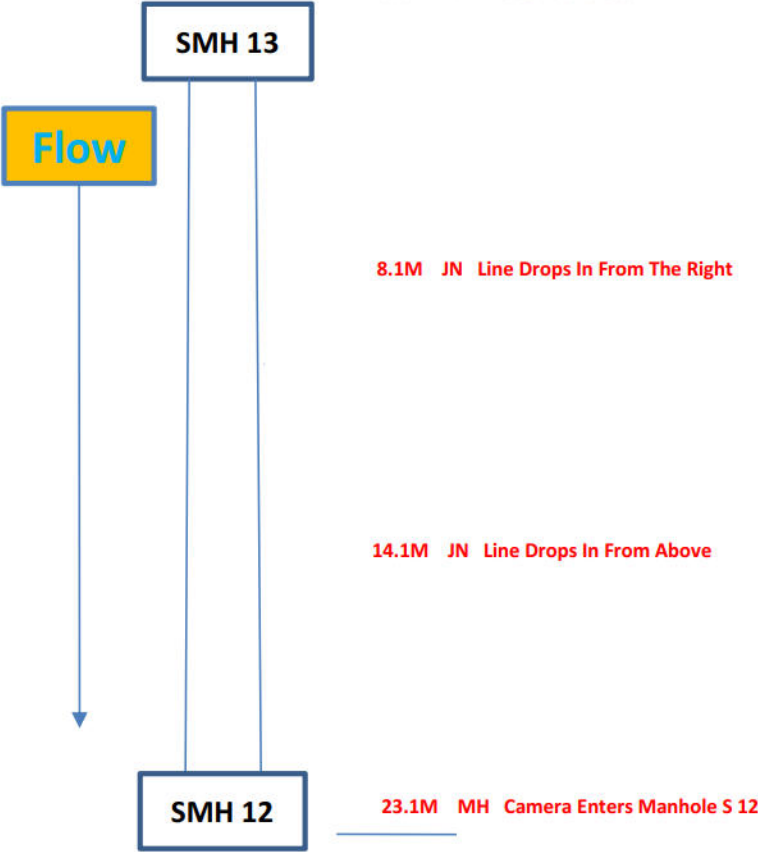

REM ; THERE ARE NO DEFECTS WITH THE PIPEWORK BUT THERE IS DEBRIS IN THE LINE, WE HAVE TRIED TO REMOVE AS MUCH AS WE CAN BY BACK JETTING THE LINE AS UNABLE TO GET LORRY NEAR TO MANHOLE S 12


|                    |                         |
|--------------------|-------------------------|
| Structural Defects | Constructional Features |
| Service Defects    | Miscellaneous Features  |

Inspection Report

|                                    |                                            |                                                                             |                   |                                                     |        |
|------------------------------------|--------------------------------------------|-----------------------------------------------------------------------------|-------------------|-----------------------------------------------------|--------|
| Date:<br>14/04/2026                | Job No:                                    | Weather:<br>Dry                                                             | Operator:<br>Mick | Section Number<br>4                                 | PLR:   |
| Present:                           | Vehicle:<br>[REDACTED]                     | Camera:<br>Camera 1                                                         | Preset:           | Cleaned:<br>Yes                                     | Grade: |
| Site; Tye Lane<br>Place: Walberton |                                            | Division:<br>District: S.W<br>Tape No: 1                                    |                   | Start MH: SMH 12<br>End MH: SMH 11<br>Total Length: |        |
| Purpose:<br>Use:<br>Catchment:     | Structural Defects<br>STORM<br>P1 Schedule | Size/Shape: Circular dia 450mm<br>Material: PLASTIC<br>Lining:<br>Category: |                   |                                                     |        |

Position Code Observation

0.0M ST Start Of Survey  
0.0M WL Water Level 0 %  
1.9M JN Line Drops In From Above

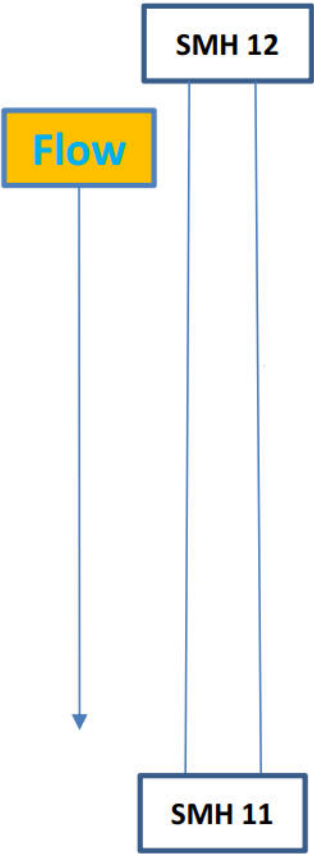

REM ; THERE ARE NO MAJOR DEFECTS WITH THIS SECTION OF PIPE


|                    |                         |
|--------------------|-------------------------|
| Structural Defects | Constructional Features |
| Service Defects    | Miscellaneous Features  |

Inspection Report

|                                                                     |                        |                                                                             |                   |                                                     |        |
|---------------------------------------------------------------------|------------------------|-----------------------------------------------------------------------------|-------------------|-----------------------------------------------------|--------|
| Date:<br>14/04/2026                                                 | Job No:                | Weather:<br>Dry                                                             | Operator:<br>Mick | Section Number<br>5                                 | PLR:   |
| Present:                                                            | Vehicle:<br>[REDACTED] | Camera:<br>Camera 1                                                         | Preset:           | Cleaned:<br>Yes                                     | Grade: |
| Site: Tye Lane<br>Place: Walberton                                  |                        | Division:<br>District: S.W<br>Tape No: 1                                    |                   | Start MH: SMH 11<br>End MH: SMH 10<br>Total Length: |        |
| Purpose: Structural Defects<br>Use: STORM<br>Catchment: P1 Schedule |                        | Size/Shape: Circular dia 450mm<br>Material: PLASTIC<br>Lining:<br>Category: |                   |                                                     |        |

Position Code Observation

0.0M ST Start Of Survey  
0.0M WL Water Level 0 %

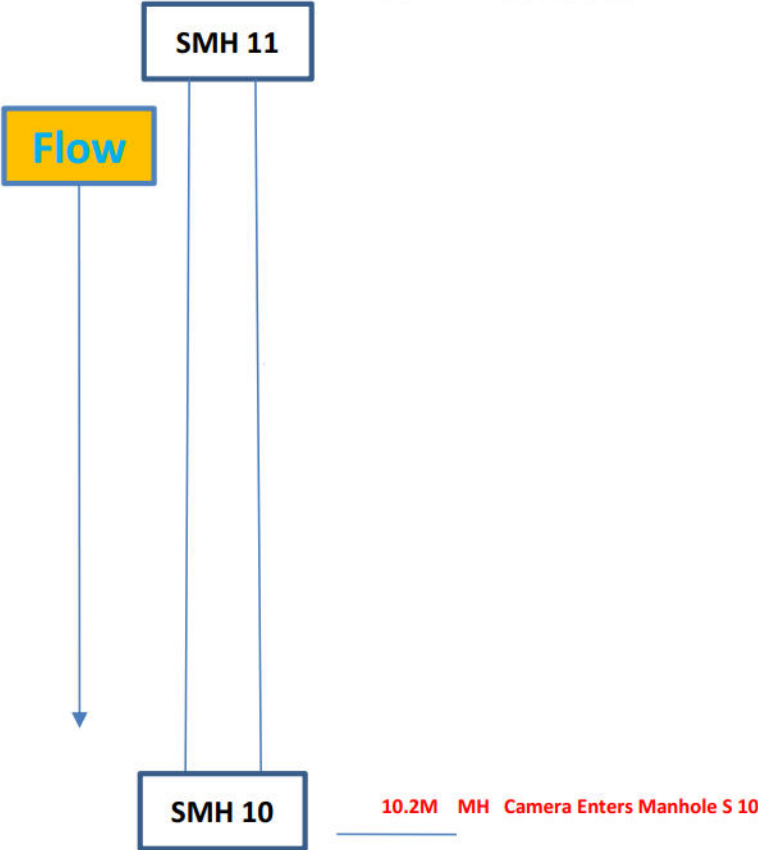

REM ; THERE ARE NO MAJOR DEFECTS WITH THIS SECTION OF PIPE


|                    |                         |
|--------------------|-------------------------|
| Structural Defects | Constructional Features |
| Service Defects    | Miscellaneous Features  |

Inspection Report

|                                    |                                            |                                                                             |                   |                                                    |        |
|------------------------------------|--------------------------------------------|-----------------------------------------------------------------------------|-------------------|----------------------------------------------------|--------|
| Date:<br>14/04/2026                | Job No:                                    | Weather:<br>Dry                                                             | Operator:<br>Mick | Section Number<br>6                                | PLR:   |
| Present:                           | Vehicle:<br>[REDACTED]                     | Camera:<br>Camera 1                                                         | Preset:           | Cleaned:<br>Yes                                    | Grade: |
| Site; Tye Lane<br>Place: Walberton |                                            | Division:<br>District: S.W<br>Tape No: 1                                    |                   | Start MH: SMH 9<br>End MH: SMH 10<br>Total Length: |        |
| Purpose:<br>Use:<br>Catchment:     | Structural Defects<br>STORM<br>P1 Schedule | Size/Shape: Circular dia 450mm<br>Material: PLASTIC<br>Lining:<br>Category: |                   |                                                    |        |

Position Code Observation

0.0M ST Start Of Survey  
0.0M WL Water Level 0 %

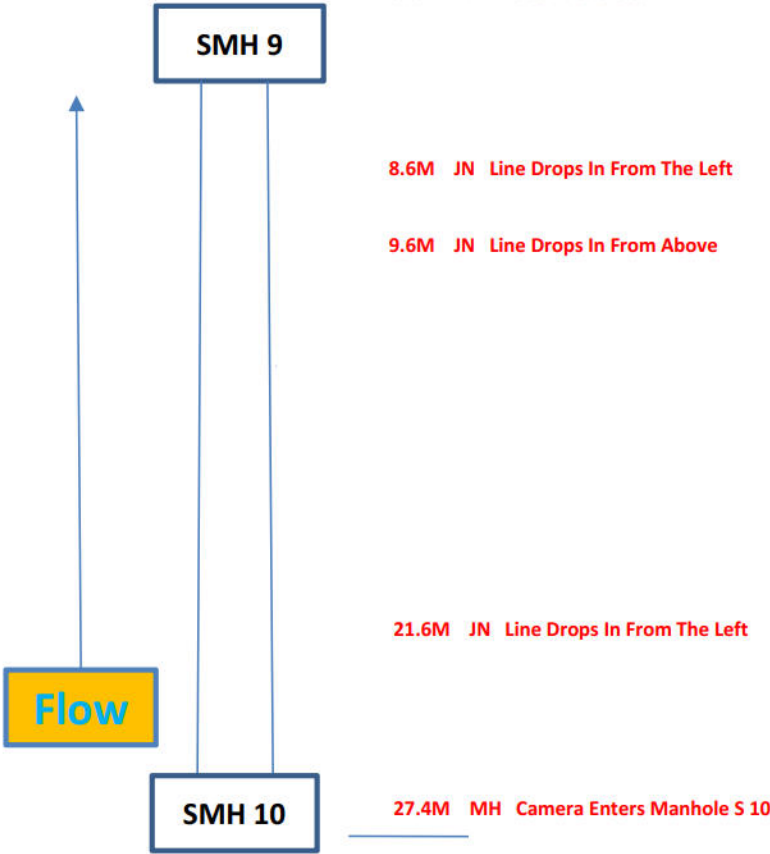

REM ; THERE ARE NO MAJOR DEFECTS WITH THIS SECTION OF PIPE


|                    |                         |
|--------------------|-------------------------|
| Structural Defects | Constructional Features |
| Service Defects    | Miscellaneous Features  |

Inspection Report

|                                    |                                            |                                                                             |                   |                                                   |        |
|------------------------------------|--------------------------------------------|-----------------------------------------------------------------------------|-------------------|---------------------------------------------------|--------|
| Date:<br>14/04/2026                | Job No:                                    | Weather:<br>Dry                                                             | Operator:<br>Mick | Section Number<br>7                               | PLR:   |
| Present:                           | Vehicle:<br>[REDACTED]                     | Camera:<br>Camera 1                                                         | Preset:           | Cleaned:<br>Yes                                   | Grade: |
| Site; Tye Lane<br>Place: Walberton |                                            | Division:<br>District: S.W<br>Tape No: 1                                    |                   | Start MH: SMH 9<br>End MH: SMH 8<br>Total Length: |        |
| Purpose:<br>Use:<br>Catchment:     | Structural Defects<br>STORM<br>P1 Schedule | Size/Shape: Circular dia 450mm<br>Material: PLASTIC<br>Lining:<br>Category: |                   |                                                   |        |

Position Code Observation

0.0M ST Start Of Survey  
0.0M WL Water Level 0 %

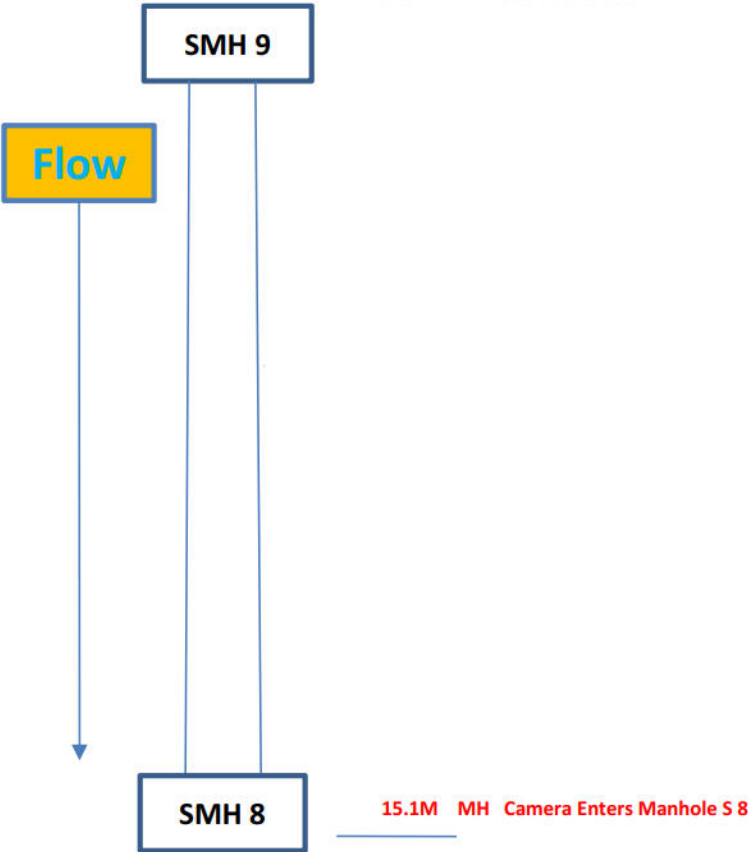

REM ; THERE ARE NO MAJOR DEFECTS WITH THIS SECTION OF PIPE

|                    |                         |
|--------------------|-------------------------|
| Structural Defects | Constructional Features |
| Service Defects    | Miscellaneous Features  |