amendments				
rev.	date	comment	auth.	chkd.
A	30.01.15	Minor Amendments	GM	MR

Garden

Patio

up

GF09
Office

GF08
WC

damp areas
to wall and
skeiling

GF07
Snug
(not surveyed)

GF06
Utility Room
(not surveyed)

plaster blown
internally at high
level

RWP

assumed line and position of existing
drainage (manholes shown indicative)

MH

SVP

kitchen waste
and gully

cpbd

GF05
Kitchen

damage to
ceiling over

primary timber
beams

Overflows DP
and gully

GF04
Cloakroom
(not surveyed)

GF02
Dining
(not surveyed)

Hall
(not surveyed)

Porch over

timber
panelling

water damage to floor

room thermostat

Porch

Door D1

Path

up

plaster blown
internally at high
level (defective
flashing at line of
porch roof and
external wall

GF03
Drawing Room

damage to
ceiling over

GF01
Family / Reception
(not surveyed)


timber
panelling

bench seat

Driveway

assumed
drain run


Rectory Lane

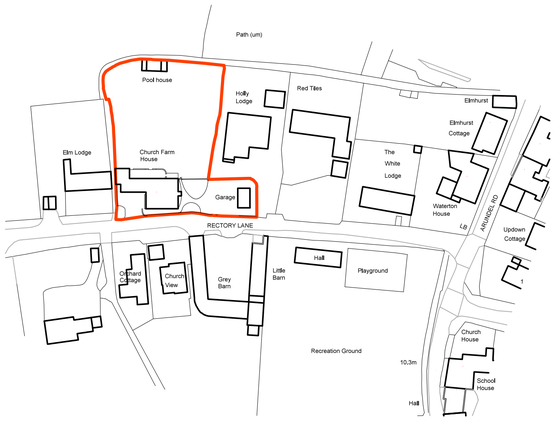

Location Plan

0 25 50 75 100

scale in metres 1:1250

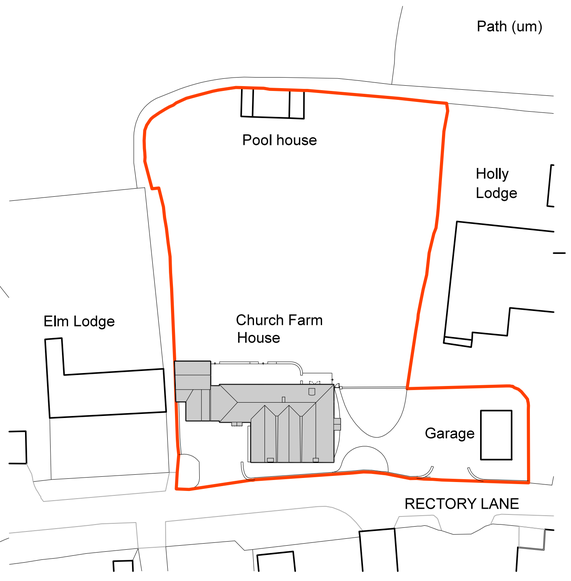

Block Plan

0 10 20 30 40

scale in metres 1:500

Ground Floor Plan

0 1 2 3 4 5 6 7 8 9 10

scale in metres 1:50

Note - Measured survey conducted in key areas only. All other areas drawn from limited visual and photographic survey only and should not be relied upon for dimensional accuracy.

client	drawing number	revision
Braithwaite & Co.	0343.EXG.001	A

project	drawing title
Church Farm House Rectory Lane Angmering	Existing Ground Floor and Location & Block Plans Measured Survey

drawn by	checked by	riba work stage	date	scale/original sheet size
GM	MR	MS	Dec '14	Varies @ A1

http://abirarchitects.co.uk studio@abirarchitects.co.uk
unit 01, Beta House, St John's Road, Hove, BN3 2FX, United Kingdom
Hove +44 (0)1273 724 384 Company No. 06877117

© ABIR Architects Ltd. Check all dimensions on site before work is undertaken. All goods, materials and workmanship to conform with current building regulations, BSS and COP's.

ABIR Architects Ltd

RIBA Chartered Practice