

From: Amanda Scholes on behalf of Planning.Responses
Sent: 01 July 2020 09:39
To: Planning Scanning
Subject: FW: F/9/20/DOC FW: 23314 Wick Farm, Ford - Arun Drainage Response
Attachments: Althon R10CA Headwall + 400mm Toe + Hinged Cranked grating.pdf; Althon R20B_Datasheet_and_Installation_Guide.pdf; 10_D_Site Layout.pdf; 21_D_Drainage and Levels - 1 of 6.pdf; 22_D_Drainage and Levels - 2 of 6.pdf; 23_D_Drainage and Levels - 3 of 6.pdf; 24_D_Drainage and Levels - 4 of 6.pdf; 25_A_Drainage and Levels - 5 of 6.pdf; 26_A_Drainage and Levels - 6 of 6.pdf

Amanda Scholes | Receptionist, Department, [Arun District Council](#) | Location: Ground Floor, Arun Civic Centre, Maltravers Road, Littlehampton, BN17 5LF

Internal: 37736 | External: +44 (0) 1903 737500 ext 37736 | E-mail: amanda.scholes@arun.gov.uk



Visit Arun's web site at [Error! Hyperlink reference not valid.](#)



Save the environment - think before you print.

From: Daun Johnson <Daun.Johnson@arun.gov.uk>
Sent: 01 July 2020 08:59
To: Planning.Responses <Planning.Responses@arun.gov.uk>
Subject: FW: F/9/20/DOC FW: 23314 Wick Farm, Ford - Arun Drainage Response

Daun Johnson
Technical Support Unit Assistant, Planning

T: 01903 737762
E: daun.johnson@arun.gov.uk

Arun District Council, Civic Centre, Maltravers Rd, Littlehampton, West Sussex, BN17 5LF
www.arun.gov.uk



Sign up to our newsletter [here](#)



From: Anita Gardner <Anita.Gardner@arun.gov.uk>
Sent: 01 July 2020 08:44
To: Planning <Planning@arun.gov.uk>
Subject: F/9/20/DOC FW: 23314 Wick Farm, Ford - Arun Drainage Response

Please scan as correspondence with consultee

Anita Gardner
Principal Planning Officer,
Directorate of Place

T: 01903 737529

E: Anita.Gardner@arun.gov.uk

Arun District Council, Civic Centre, Maltravers Rd, Littlehampton, West Sussex, BN17 5LF

www.arun.gov.uk



Sign up to our newsletter [here](#)



From: Anita Gardner

Sent: 25 June 2020 14:59

To: Paul Cann <Paul.Cann@arun.gov.uk>

Subject: FW: 23314 Wick Farm, Ford - Arun Drainage Response

Hi Paul,

Please can you let me know if the attached details are satisfactory for discharge?

[Anita Gardner](#) | Principal Planner, Directorate of Place, [Arun District Council](#) | Location: First Floor, Arun Civic Centre, Maltravers Road, Littlehampton, BN17 5LF

Internal: 37529 | External: +44 (0) 1903 737529 | E-mail: anita.gardner@arun.gov.uk

Arun is a CIL Charging Authority, for more information go to www.arun.gov.uk/cil

Visit Arun's web site at www.arun.gov.uk



Save the environment - think before you print.

From: John Hall [REDACTED]

Sent: 25 June 2020 14:14

To: Anita Gardner <Anita.Gardner@arun.gov.uk>; Dean, Paul <[REDACTED]>

Subject: FW: 23314 Wick Farm, Ford - Arun Drainage Response

Hello Anita & Paul,

Please see the string of emails below plus the additional information attached that you requested for the glasshouse & reservoir development at Wicks Farm, Ford.

Don't hesitate to come back to me if you need further clarification on anything.

Many thanks, John.

John Hall MBA MCIOrt
John Hall Consulting Ltd.
113 Limmer Lane
Felpham
West Sussex
PO22 7LR



[REDACTED]

From: Stuart Magowan [REDACTED]
Sent: 25 June 2020 12:51
To: John Hall [REDACTED]
Cc: CEP | Reception [REDACTED]; Mark Wren [REDACTED]
Subject: RE: 23314 Wick Farm, Ford - Arun Drainage Response

Hi John

I attach the updated drawings, coordinated with the details provided by Mark yesterday for your formal response to Paul Cann.

Please do not hesitate to contact me if you have any queries or if I can be of any assistance.

Regards

Stuart

Stuart Magowan
[REDACTED]



The Civil Engineering Practice
11 Tungsten Building
George Street
Fishergate
Sussex
BN41 1RA
[REDACTED]

As an ISO 9001 : 2008 certified company, we invite you to reply to this email with any feedback (positive or negative) that you would like to share. Any response will be reviewed by the directors and quality assurance department.

This transmission contains information which may be confidential and which may also be privileged. It is intended for the named addressee only. Unless you are the named addressee, or authorised to receive it for the addressee, you may not copy or use it, or disclose it to anyone else. If you have received this transmission in error, please contact [REDACTED]

Whilst this e-mail and any attachments are believed to be free of any virus, it is the recipient's responsibility to ensure that they are virus-free and no responsibility is accepted by The Civil Engineering Practice for any loss or damage arising in any way from receipt or use thereof.

The Civil Engineering Practice is GDPR compliant. The security of your data is important to us. Please contact us if you want to update, change, amend or remove your personal information.

From: John Hall [REDACTED]
Sent: 24 June 2020 20:57
To: Stuart Magowan [REDACTED]
Cc: CEP | Reception [REDACTED]
Subject: RE: 23314 Wick Farm, Ford - Arun Drainage Response

Thanks Stuart – John.

John Hall MBA MCIHort
John Hall Consulting Ltd.

113 Limmer Lane
Felpham
West Sussex
PO22 7LR

[REDACTED]

From: Stuart Magowan <[REDACTED]>
Sent: 24 June 2020 16:15
To: John Hall <[REDACTED]>
Cc: CEP | Reception <[REDACTED]>
Subject: RE: 23314 Wick Farm, Ford - Arun Drainage Response



Hi John

Yes, I spoke to Mark yesterday and we are making these changes, I aim to issue early tomorrow.

Regards

Stuart

Stuart Magowan

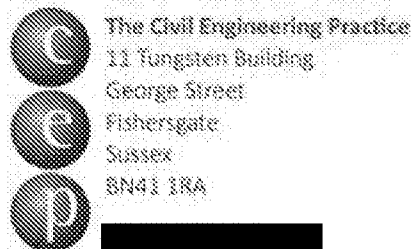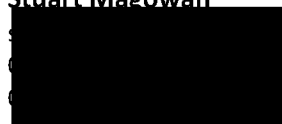

As an ISO 9001 : 2008 certified company, we invite you to reply to this email with any feedback (positive or negative) that you would like to share. Any response will be reviewed by the directors and quality assurance department.

This transmission contains information which may be confidential and which may also be privileged. It is intended for the named addressee only. Unless you are the named addressee, or authorised to receive it for the addressee, you may not copy or use it, or disclose it to anyone else. If you have received this transmission in error, please contact [REDACTED]

Whilst this e-mail and any attachments are believed to be free of any virus, it is the recipient's responsibility to ensure that they are virus-free and no responsibility is accepted by The Civil Engineering Practice for any loss or damage arising in any way from receipt or use thereof.

The Civil Engineering Practice is GDPR compliant. The security of your data is important to us. Please contact us if you want to update, change, amend or remove your personal information.

From: John Hall <[REDACTED]>
Sent: 24 June 2020 15:48
To: Stuart Magowan <[REDACTED]>
Subject: FW: 23314 Wick Farm, Ford - Arun Drainage Response

Hello Stuart,

Are you able to put this further information from Mark Wren together with yours so that I can send it all in as one response to ADC?

Many thanks, John.

John Hall MBA MCIHort
John Hall Consulting Ltd.
113 Limmer Lane
Felpham
West Sussex
PO22 7LR



From: Mark Wren <[redacted]>
Sent: 24 June 2020 14:50
To: Stuart Magowan [redacted] John Hall [redacted]
Cc: Andrew Hawes [redacted] Stuart Lever
[redacted]; Lee Clarke <[redacted]>; David Moore
[redacted] Steve Burgess <[redacted]>; CEP | Reception
Subject: RE: 23314 Wick Farm, Ford - Arun Drainage Response

Afternoon All,

Further to Stuart's issue of information we have updated our information as required to respond to Arun's comments and reflect relevant parts of the CEP design. A link to our information is included below.

<https://we.tl/t-sj9vnmYm2Y>

I spoke with Stuart M yesterday regarding any updates which may be required on his information which are minor but would be useful to tweak to ensure the packages are fully coordinated. I have included in the link a CAD file for ease:

- ✦ Twin pipes in and around the southern swale and pond to suit the Causeway model
- ✦ Flood compensation shown is based on Geodime's information not ours
- ✦ Headwall specifications on the southern ditch to suit the twin pipes
- ✦ Pond flow control specification to suit the Causeway model

One thing to highlight in relation to the responses below is that item 27 requests calculations for the reservoir system. I don't believe the CEP calculations include for the pipe network from the glasshouse to the reservoir. We were originally asked to design these pipes based on a rainfall intensity of 35mm/hr to match the design for the gutters and downpipes, resulting in the 450mm diameter pipes. This rainfall intensity does not represent that which would occur in a 1:100 year plus climate change event which would may lead to some localised flooding in short term events. Paul Cann may ask for the reservoir calculations to include these pipes and for a 1:100 year event which would increase their size.

For completeness I have copied the Arun comments and Stuart's responses below and added further comments.

1. It is noted that some infiltration will be possible but this has not been accounted for in the proposals in terms of the calculations which is fine.

Noted. No response required.
No further comment.

2. Is there a ditch on the eastern boundary? If so, include details on the plans.

No details provided. From available information there is no ditch in this location.
No further comment.

3. Please show the ditch on the western boundary on the plans. As per discussions with John Hall following a visit to site, it was noted that some sections of the ditch have been re-dug, whilst the section before discharge to the Network Rail ditch needs maintenance and un-filling where the dead tree is located. Please add suitable notes regarding the intended proposals.

Details of western boundary ditch are now shown on drawings 21 and 24 requested note now included.
No further comment, our drawings now indicate the western ditch as shown on the CEP drawings and we have adjusted the pipe routing also.

4. The existing northern boundary ditch is located within Network Rail land. As discussed, the intention is to now provide a new ditch parallel to that one and discharge to the western boundary ditch. Please also the drawings as necessary and provide a typical cross section and a longitudinal section.

The ditch along the northern boundary within the site to be cleared of vegetation, silt & debris, and to be regraded where necessary to provide continuous fall from headwall to western ditch. Additional levels information has been included on the plans indicating the top of bank and ditch base level.
No further comment, our drawings now indicate the northern ditch as shown on the CEP drawings and we have adjusted the pipe routing also.

5. Provide fully detailed construction drawing for the reservoir, including base levels and top of bank levels.

Additional details have now been included on drawing 51 along with a section through the reservoir and outgoing drainage (Hydrobrake).
No further comment.

6. Specify pipe invert level where discharging to northern ditch, ensuring as much freeboard as possible between ditch bed and pipe invert.

Pipe invert specified on drawing 22 allowing for 100mm freeboard within the design between ditch bed and pipe invert as requested.
No further comment, our drawings now indicate the pipe routing as shown on the CEP drawings.

7. Land drainage consent is required for the new northern ditch including the pipe and swale connection to this ditch. Forms enclosed. Fees will be £300 – see attached methods of payment.

Noted. John Hall to confirm any action
No further comment.

8. The new headwall into the northern ditch must not encroach into the ditch profile (detail this or add suitable note)

Requested note added onto drawing 22.
No further comment, our drawings now indicate the pipe routing as shown on the CEP drawings.

9. Provide construction details for all prefabricated headwalls. All 450mm pipe exits/entries to be fitted with suitable cranked grille.

See Althon detail 'R10CA Headwall + 400mm Toe + Hinged Cranked grating' for all headwalls serving 450mm pipes.
We have provided further details for the headwalls forming part of our design works into and around the southern boundary swale and pond.

10. Provide hydrobrake manufacturers technical details for each hydrobrake.

The Hydrobrake specifications added to drawings 22 and 24.

Hydrobrake specification is already on the drawing for the pond, refer to CEP drawing for the reservoir hydrobrake specification.

11. Inflows to reservoir – scour protection may be required beyond headwall aprons, depending on the construction of the reservoir.. Please provide fully detailed drawing.

The reservoir has been design to always retain a body of water therefore no scour protection is necessary.
No further comment.

12. Catchpit type W detail – include step rungs for access.

Steps added to catch pit detail on drawing 51.

Step rungs added to our detail also.

13. Reservoir outlet is at a very steep gradient and connecting at 90 degrees to the hydrobrake. Resultant flows could affect the performance of the hydrobrake – could this arrangement be revised to improve the situation.

Inlet and Outlet pipe to Hydrobrake manhole amended as requested as shown on drawing 22.

No further comment, our drawings now indicate the pipe routing as shown on the CEP drawings.

14. Swale connection to the new northern ditch – angle the point of entry to ensure flows merge in an improved manner.

Point of entry angled as requested see drawing 21.

No further comment, our drawings now indicate the pipe routing as shown on the CEP drawings.

15. Provide fully detailed insitu headwall construction details, for links between pond 1 and swale, and between swale 1 and 2.

See Althon detail 'R10CA Headwall + 400mm Toe + Hinged Cranked grating' for all headwalls serving 450mm pipes.

Detail provided for the in-situ headwall. In-situ needed due to narrow swale and twin pipes.

16. Incoming 225mm pipe to swale 2 – provide min. 100mm freeboard between swale bed and pipe invert.

Pipe invert specified on drawing 25 allowing for 100mm freeboard within the design between ditch bed and pipe invert as requested.

No further comment.

17. Pipe concrete bed and surround detail – specify the specific concrete mix on the detail itself.

Pipe concrete bed and surround detail shown on drawing 51.

Detail already part of information provided.

18. Car park area draining to swale 2 – is the surface to be of permeable construction? Provide fully detailed construction details. Provide perforated pipe construction details including structure on downstream end of pipes. Specify how upstream ends of pipes are to be terminated. Specify pipe invert levels/gradients.

The car park area draining to Swale 2 surface is permeable as per the detail on drawing 52. Further notes have been added to drawing 25 showing the Invert Level depths of the perforated Fin Drain.

No further comment, we have made note to refer to the CEP drawings for detailed specification.

- 19. The low areas on the southern perimeter of the greenhouse ie bottom of embankment – how is this to be drained? Provide details.**

A French Drain has been included to the bottom of the banks as shown on drawing 51.
No further comment, we have indicated the drain as shown on the CEP information.

- 20. Channel drains – specify the particular models and show the specific concrete mix on the construction detail. Specify invert levels/gradients.**

The Aco Channel specifications are shown on the drawings 25 & 26 and the Aco construction details on drawing 51. The channel and outlet invert levels are now shown on the drainage plans.
No further comment, we have made note to refer to the CEP drawings for detailed specification.

- 21. Outlets to swale 1 – provide min. 100mm freeboard between swale bed and pipe inverts.**

Pipe invert specified on drawing allowing for 100mm freeboard within the design between ditch bed and pipe invert as requested.
No further comment.

- 22. Provide positive fall on pond 1 (swale) bed.**

As noted above, there is infiltration present within the swales therefore no positive fall is proposed or required for the swale bed.
No further comment.

- 23. All pipes to connect soffit to soffit unless otherwise specified – add note.**

Please see Note 11 which has now been included to drainage plans.
Note already on drawings.

- 24. Areas draining to channel drains – presumably concrete surface – indicate on drawings.**

Areas draining to each Aco Channel now included on the drainage plans. The Aco Channel units have been sized using the Online Aco Design Tool.
No further comment, we have made note to refer to the CEP drawings for detailed specification.

- 25. Pond 1 system – provide pipe network numbered plan to support causeway flow calculations.**

The drainage network is made up of a number of swales and ponds with a limited pipe work, therefore the pipe network has not been modelled in Micro drainage. All pipes are sized to accommodate the impermeable area they serve and flow required for a 1 in 100 storm plus 40%CC.
Network plan provided within new information to suit Causeway Flow calculations.

- 26. Pond 1 and associated swales – show top of bank levels on all sides.**

Additional levels have been added to the top of all ponds and swales.
No further comment.

- 27. Provide causeway flow calculations for reservoir system. The CEP calculations provided were only preliminary and do not reflect the actual design.**

Please see attached updated Micro Drainage calculation.
No further comment, refer to CEP calculations.

28. Maintenance manual - to be a separate document. Needs to explain how each system is designed to work and specify who will be responsible for maintaining the system after construction. The manual provided is quite generic and not really site specific – please adjust as necessary. There needs to be a focus on catchpits, hydrobrakes, headwalls (grilles), perforated pipes, reservoir, ditch, etc maintenance.


Please see attached updated Maintenance Manual.

Updated maintenance statement provided which is more site specific having removed some elements not part of the final scheme.

Mark Wren
Senior Engineer



8 Pride Point Drive, Pride Park, Derby, DE24 8BX

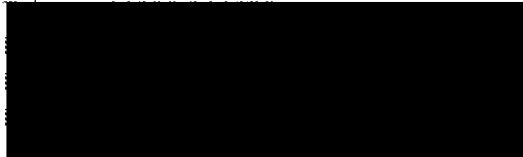

Visit us online at www.jacksonpl.co.uk

Jackson Consulting Engineers Ltd registered in England No. 6841756 Registered Office: The Mills, Canal Street, Derby DE1 2RJ

This e-mail is only intended for the person(s) to whom it is addressed and may contain confidential information. Unless stated to the contrary, any opinions or comments are personal to the writer and do not represent the official view of the company. If you have received this e-mail in error, please notify us immediately by reply e-mail and then delete this message from your system. Please do not copy it or use it for any purposes, or disclose its contents to any other person. Thank you for your co-operation.

From: Stuart Magowan <[REDACTED]>
Sent: 17 June 2020 10:12
To: John Hall [REDACTED]
Cc: Andrew Hawes [REDACTED]; Stuart Lever
[REDACTED]; Mark Wren <[REDACTED]>; Lee Clarke
[REDACTED]; David Moore ([REDACTED]); Steve
B [REDACTED] | Reception [REDACTED]
Subject: 23314 Wick Farm, Ford - Arun Drainage Response

Hi John and Team

We have now completed the run through of the comments received from Paul Cann at Arun District Council and have updated the design drawings and details as discussed. The following link will allow a download of the updated information for the team to review:

<https://www.dropbox.com/sh/els9g8pu0ijyoih/AADM9xJUec4srwLMWJBGO216a?dl=0>

We have included AutoCAD copies of the layouts for the team to use as required to ensure coordination of the designs.

The following are the proposed responses in ORANGE and notes for you in GREEN to each comment along with instructions to locate the corresponding information.

1. It is noted that some infiltration will be possible but this has not been accounted for in the proposals in terms of the calculations which is fine.

Noted. No response required.

2. Is there a ditch on the eastern boundary? If so, include details on the plans.

No details provided. From available information there is no ditch in this location.

3. Please show the ditch on the western boundary on the plans. As per discussions with John Hall following a visit to site, it was noted that some sections of the ditch have been re-dug, whilst the section before discharge to the Network Rail ditch needs maintenance and un-filling where the dead tree is located. Please add suitable notes regarding the intended proposals.

Details of western boundary ditch are now shown on drawings 21 and 24 requested note now included.

4. The existing northern boundary ditch is located within Network Rail land. As discussed, the intention is to now provide a new ditch parallel to that one and discharge to the western boundary ditch. Please also the drawings as necessary and provide a typical cross section and a longitudinal section.

The ditch along the northern boundary within the site to be cleared of vegetation, silt & debris, and to be regraded where necessary to provide continuous fall from headwall to western ditch. Additional levels information has been included on the plans indicating the top of bank and ditch base level.

5. Provide fully detailed construction drawing for the reservoir, including base levels and top of bank levels.

Additional details have now been included on drawing 51 along with a section through the reservoir and outgoing drainage (Hydrobrake).

6. Specify pipe invert level where discharging to northern ditch, ensuring as much freeboard as possible between ditch bed and pipe invert.

Pipe invert specified on drawing 22 allowing for 100mm freeboard within the design between ditch bed and pipe invert as requested.

7. Land drainage consent is required for the new northern ditch including the pipe and swale connection to this ditch. Forms enclosed. Fees will be £300 – see attached methods of payment.

Noted. John Hall to confirm any action

8. The new headwall into the northern ditch must not encroach into the ditch profile (detail this or add suitable note)

Requested note added onto drawing 22.

9. Provide construction details for all prefabricated headwalls. All 450mm pipe exits/entries to be fitted with suitable cranked grille.

See Althon detail 'R10CA Headwall + 400mm Toe + Hinged Cranked grating' for all headwalls serving 450mm pipes.

10. Provide hydrobrake manufacturers technical details for each hydrobrake.

The Hydrobrake specifications added to drawings 22 and 24.

11. Inflows to reservoir – scour protection may be required beyond headwall aprons, depending on the construction of the reservoir.. Please provide fully detailed drawing.

The reservoir has been design to always retain a body of water therefore no scour protection is necessary.

12. Catchpit type W detail – include step rungs for access.

Steps added to catch pit detail on drawing 51.

13. Reservoir outlet is at a very steep gradient and connecting at 90 degrees to the hydrobrake. Resultant flows could affect the performance of the hydrobrake – could this arrangement be revised to improve the situation.

Inlet and Outlet pipe to Hydrobrake manhole amended as requested as shown on drawing 22.

14. Swale connection to the new northern ditch – angle the point of entry to ensure flows merge in an improved manner.

Point of entry angled as requested see drawing 21.

15. Provide fully detailed insitu headwall construction details, for links between pond 1 and swale, and between swale 1 and 2.

See Althon detail 'R10CA Headwall + 400mm Toe + Hinged Cranked grating' for all headwalls serving 450mm pipes.

16. Incoming 225mm pipe to swale 2 – provide min. 100mm freeboard between swale bed and pipe invert.

Pipe invert specified on drawing 25 allowing for 100mm freeboard within the design between ditch bed and pipe invert as requested.

17. Pipe concrete bed and surround detail – specify the specific concrete mix on the detail itself.

Pipe concrete bed and surround detail shown on drawing 51.

18. Car park area draining to swale 2 – is the surface to be of permeable construction? Provide fully detailed construction details. Provide perforated pipe construction details including structure on downstream end of pipes. Specify how upstream ends of pipes are to be terminated. Specify pipe invert levels/gradients.

The car park area draining to Swale 2 surface is permeable as per the detail on drawing 52. Further notes have been added to drawing 25 showing the Invert Level depths of the perforated Fin Drain.

19. The low areas on the southern perimeter of the greenhouse ie bottom of embankment – how is this to be drained? Provide details.

A French Drain has been included to the bottom of the banks as shown on drawing 51.

20. Channel drains – specify the particular models and show the specific concrete mix on the construction detail. Specify invert levels/gradients.

The Aco Channel specifications are shown on the drawings 25 & 26 and the Aco construction details on drawing 51. The channel and outlet invert levels are now shown on the drainage plans.

21. Outlets to swale 1 – provide min. 100mm freeboard between swale bed and pipe inverts.

Pipe invert specified on drawing allowing for 100mm freeboard within the design between ditch bed and pipe invert as requested.

22. Provide positive fall on pond 1 (swale) bed.

As noted above, there is infiltration present within the swales therefore no positive fall is proposed or required for the swale bed.

23. All pipes to connect soffit to soffit unless otherwise specified – add note.

Please see Note 11 which has now been included to drainage plans.

24. Areas draining to channel drains – presumably concrete surface – indicate on drawings.

Areas draining to each Aco Channel now included on the drainage plans. The Aco Channel units have been sized using the Online Aco Design Tool.

25. Pond 1 system – provide pipe network numbered plan to support causeway flow calculations.

The drainage network is made up of a number of swales and ponds with a limited pipe work, therefore the pipe network has not been modelled in Micro drainage. All pipes are sized to accommodate the impermeable area they serve and flow required for a 1 in 100 storm plus 40%CC.

26. Pond 1 and associated swales – show top of bank levels on all sides.

Additional levels have been added to the top of all ponds and swales.

27. Provide causeway flow calculations for reservoir system. The CEP calculations provided were only preliminary and do not reflect the actual design.

Please see attached updated Micro Drainage calculation.

28. Maintenance manual - to be a separate document. Needs to explain how each system is designed to work and specify who will be responsible for maintaining the system after construction. The manual provided is quite generic and not really site specific – please adjust as necessary. There needs to be a focus on catchpits, hydrobrakes, headwalls (grilles), perforated pipes, reservoir, ditch, etc maintenance.


Please see attached updated Maintenance Manual.

If you have any queries or if I can be of any further assistance please do not hesitate to contact me.

Regards

Stuart

Stuart Magowan





The Civil Engineering Practice

11 Tungsten Building

George Street



Fishergate

Sussex



BN41 1RA

As an ISO 9001 : 2008 certified company, we invite you to reply to this email with any feedback (positive or negative) that you would like to share. Any response will be reviewed by the directors and quality assurance department.

This transmission contains information which may be confidential and which may also be privileged. It is intended for the named addressee only. Unless you are the named addressee, or authorised to receive it for the addressee, you may not copy or use it, or disclose it to anyone else. If you have received this transmission in error, please contact [REDACTED]

Whilst this e-mail and any attachments are believed to be free of any virus, it is the recipient's responsibility to ensure that they are virus-free and no responsibility is accepted by The Civil Engineering Practice for any loss or damage arising in any way from receipt or use thereof.

The Civil Engineering Practice is GDPR compliant. The security of your data is important to us. Please contact us if you want to update, change, amend or remove your personal information.

From: John Hall <[REDACTED]>

Sent: 15 June 2020 11:55

To: Stuart Magowan <[REDACTED]>

Subject: Call

Morning Stuart,

Please give me a call as soon as you can ref. our response to ADC concerning Wicks Farm.

Many thanks, John.

John Hall MBA MCIHort

John Hall Consulting Ltd.

113 Limmer Lane

Felpham

West Sussex

PO22 7LR

