



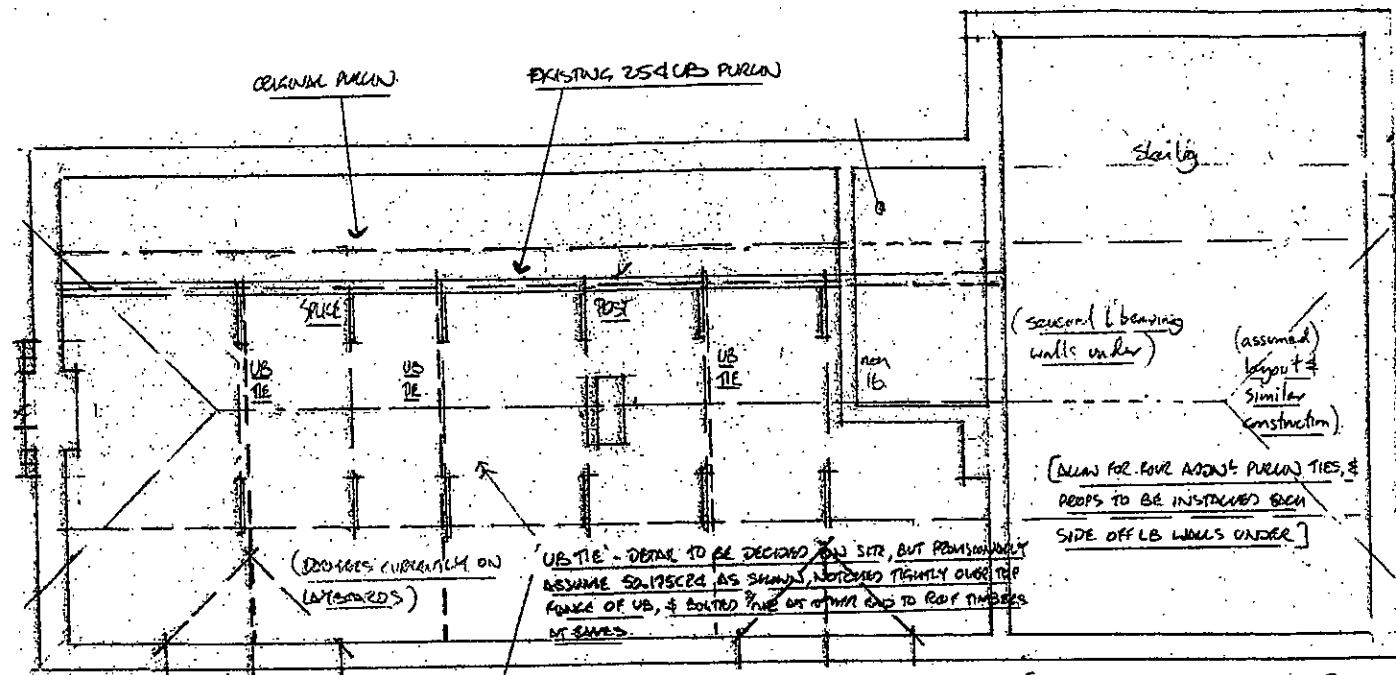

PLAN

FRONT PURLIN PROPPING TO BE IMPROVED WITH DIAGONAL BRACING (SC-75CE2A) AT 1000% APPROX.

SECTION

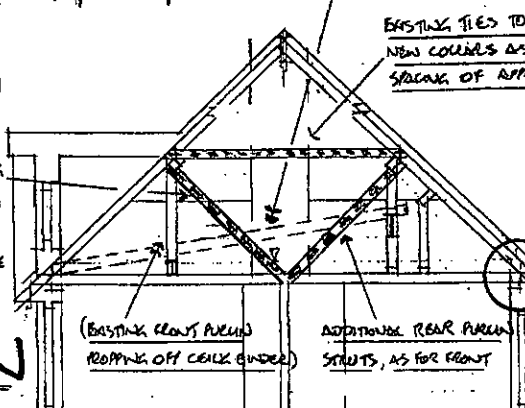

EXISTING ROOF

REAR RAFTER FOOT ALONG WEST WALL MUST BE PROPERLY TIED IN TO CEILING COUPLERS. IF POSSIBLE THE RAFTER LINE IS TO BE STRENGTHENED AND DROPPED BACK ONTO THE RAFTS - BUT THE VERTICAL AND HORIZONTAL SUPPORTS MUST BE SECURED WITH RATCHING AND STRAPS / SPACE JOISTS TO BCO / BAK. APPROX. (USE M10 M12 BOLTS FOR FIXINGS, WITH DOUBLE BOLTS AT SPACE LAPS)

DETAILS ASSUME THAT TILES & BATTENS ARE REMOVED FOR ACCESS

DIXON
HURST
KEMP

Job Title	2-G BEACH RD, CATTLEHAMPTON	Item	REARRANGEMENT
Designed by		Date	
Checked by		Job No.	50606
		Sheet	10
		Rev	