


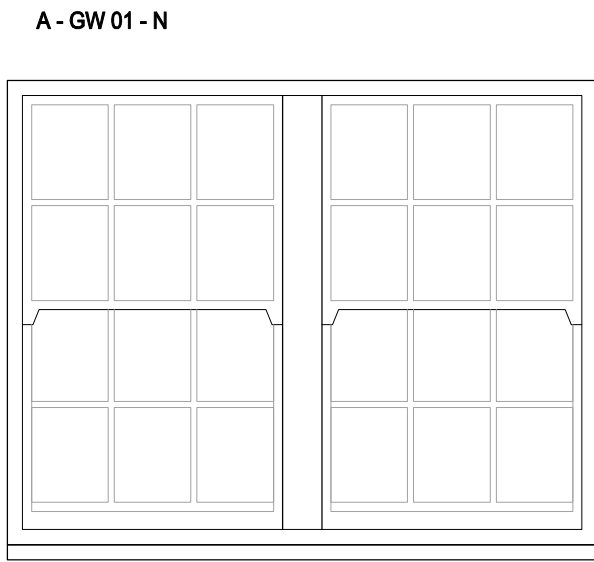
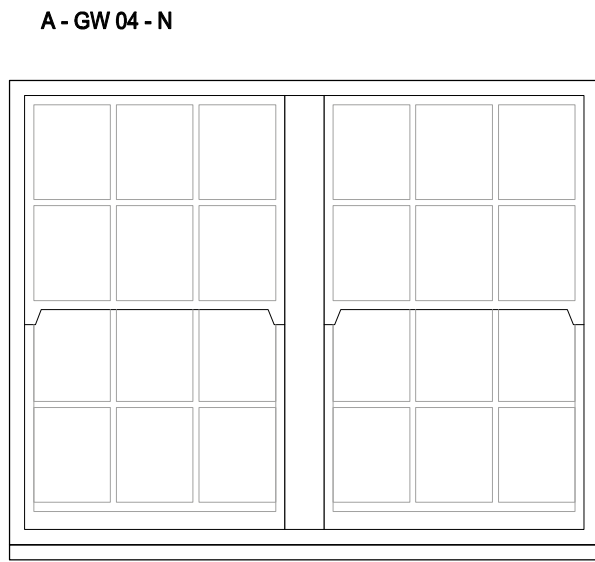
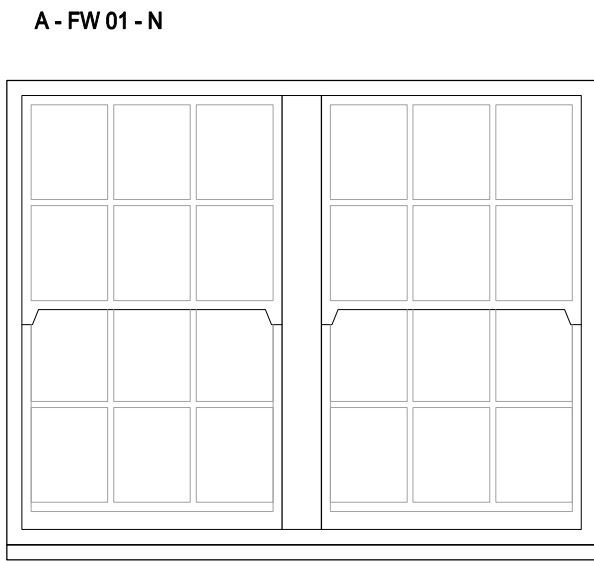
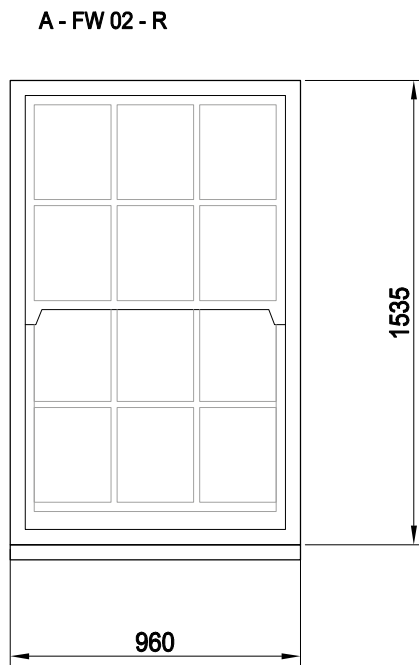
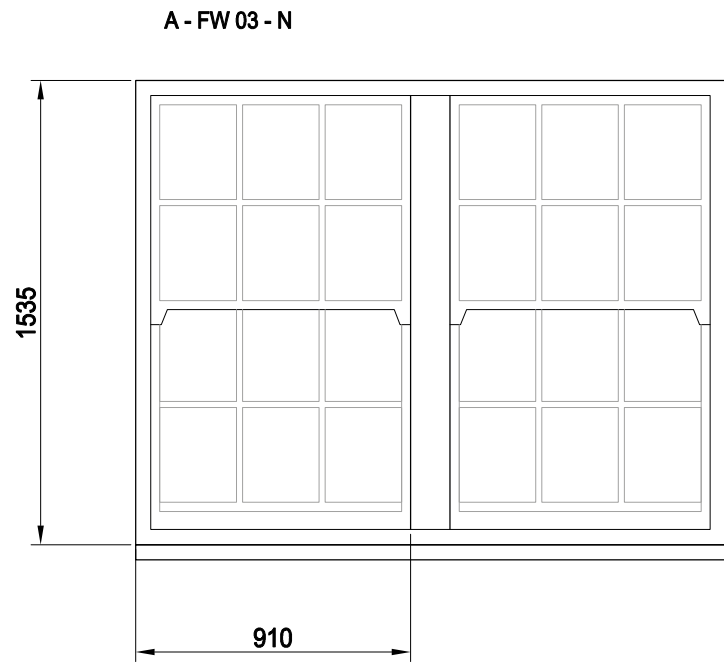
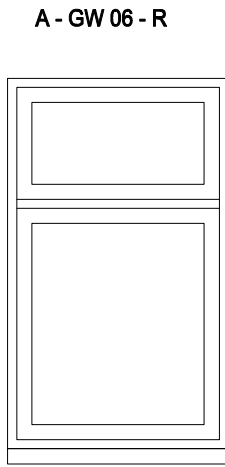
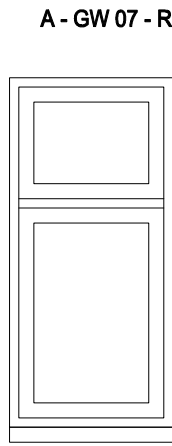
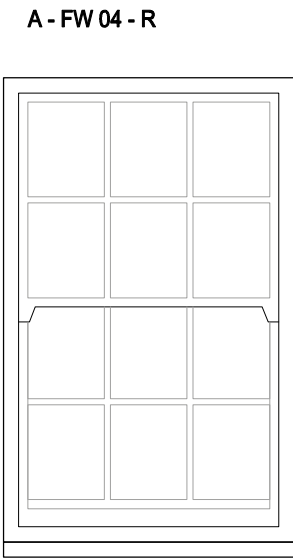
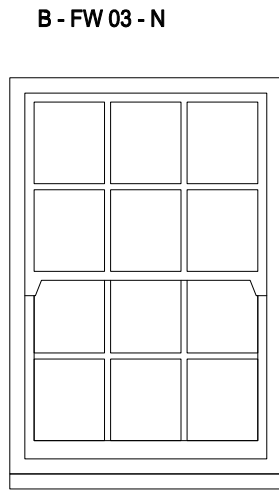
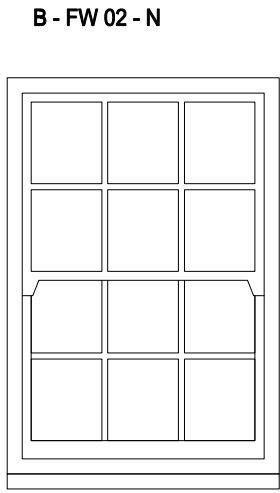
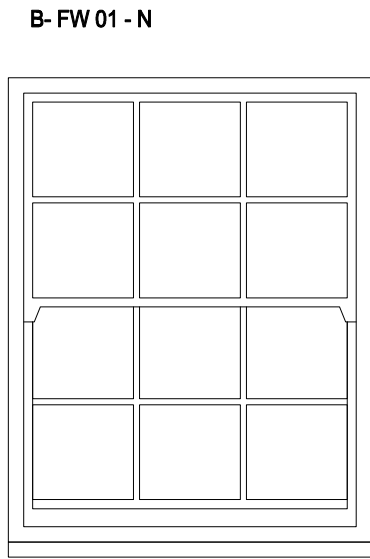
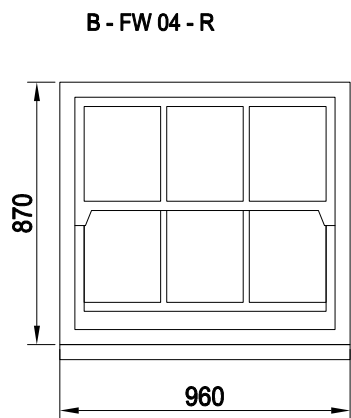
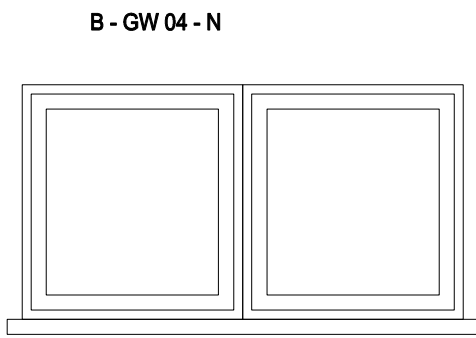


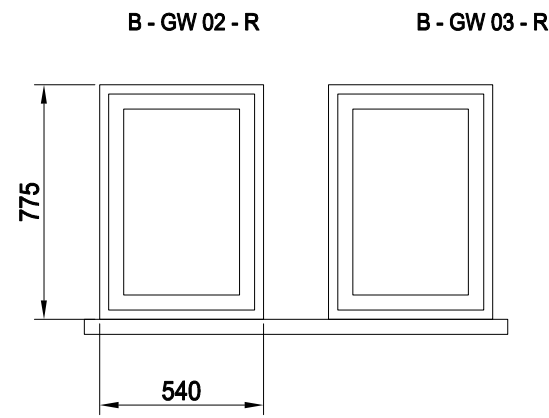


A - FW 06 - R Bottom 1/2 Casement

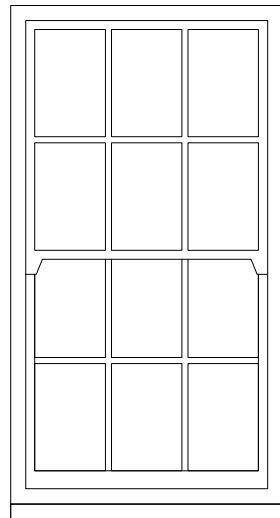




A - FW 05 - R

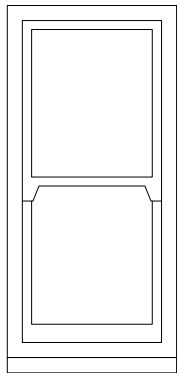


B - GW 01 - R

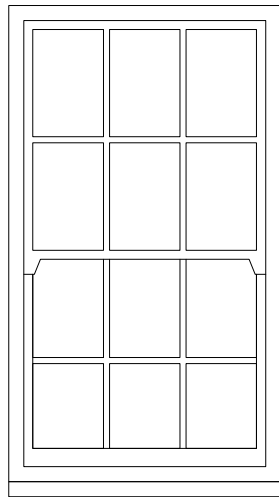

A - GW 09 - N

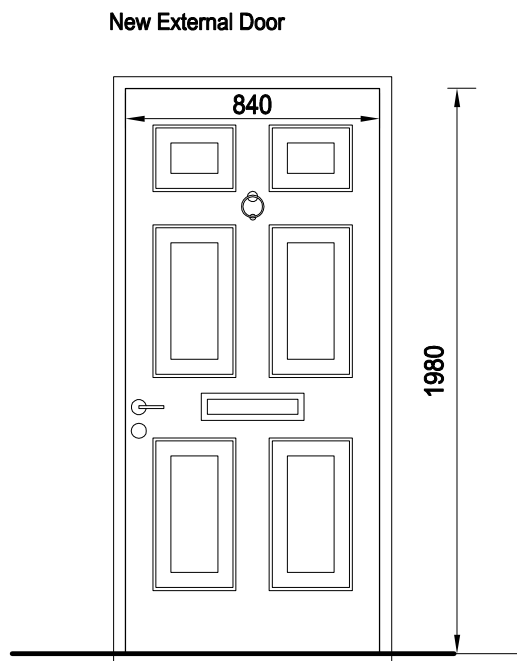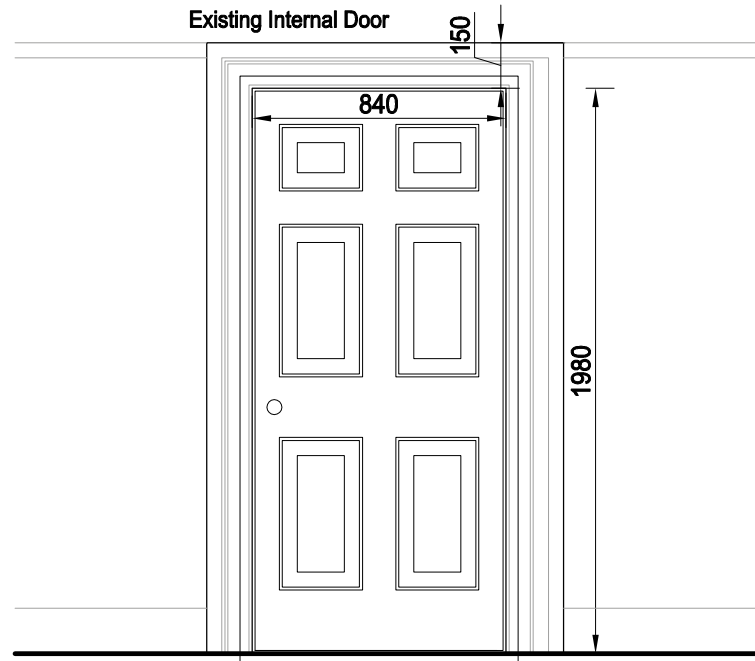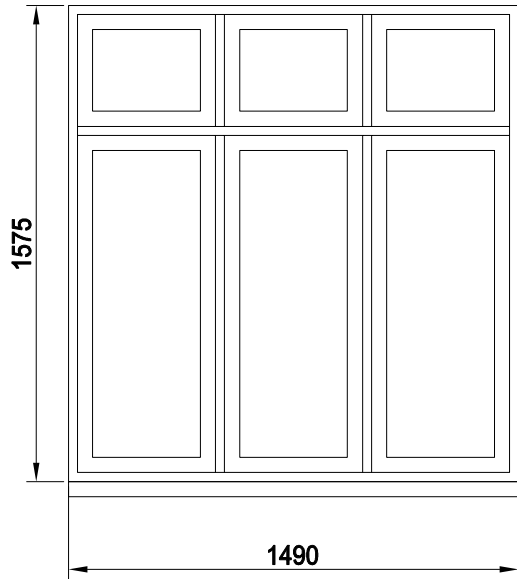

R= REPAIR, N= NEW

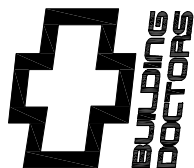

Architect @
Buildingdoctors.co.uk
Office: 137, EN1 1QT
0208 363 5764
RIBA

Disclaimer;
No Reproduction without Consent
Do not Scale from this Drawing
Only use Dimensions Shown
Dims & Areas accurate to 5%
© Copyright 2021 Building Doctors

Date
18.10.21

Amendments
External & Internal door elevation added

Ve.
A

In.
CA

Date

Amendments

Ve.

In.

Project

Pennicotts Farm
PO20 1LN

Title Window Schedule

Client Mr. S.
Cox-Rusbridge

☐ Draft ☐ Planning ☐ B. Control
☒ Tender ☐ Constr. ☐ Other

971 - B950 A
1:25
1:100
0 M 25 M 50 M 75 M 100 M
0 M 1 M 2 M 3 M 4 M

A2
ARUN DISTRICT COUNCIL P15922/L

Pennicotts Window Schedule V3

Windows	Description		Type	Structural Opening	Opening	Material	Colour	Glazing	Glass Type	4- 28-4	4-16-4
Ground Floor											
	A - GW 01	Lounge Window	Sash - NEW	910 x 1540	tbc	Timber	White	Double Glazing	Clear		Yes
	A - GW 02	Front Porch	Casement - NEW	570 x 1050		Timber	White	Single Glazing	Clear		
	A - GW 03	Front Porch	Casement - NEW	570 x 1050		Timber	White	Single Glazing	Clear		
	A - GW 04	Dining	Sash - NEW	910 x 1540		Timber	White	Double Glazing	Clear		Yes
	A - GW 05	WC	Casement - REPAIR	540 x 1020		Timber	White	Single Glazing	Opaque		
	A - GW 06	WC	Casement - REPAIR	540 x 1020		Timber	White	Single Glazing	Opaque		
	A - GW 07	Corridor WC	Casement - REPAIR	540 x 1460		Timber	White	Single Glazing	Opaque		
	A - GW 08	Corridor WC	Casement - REPAIR	540 x1460		Timber	White	Single Glazing	Opaque		
	A - GW 09	Kitchen	Casement - NEW	1490 x 1580		Timber	White	Double Glazing	Clear	Yes	
First Floor											
	A - FW 01	Bed 2A	Sash - NEW	1950 x 1450		Timber	White	Double Glazing			Yes
	A - FW 02	Corridor	Sash - REPAIR	960 x 1540		Timber	White	Double Glazing - 2ndary	upvc int opening	Yes	
	A - FW 03	Bed 1A	Sash - NEW	910 x 1540		Timber	White	Double Glazing			Yes
	A - FW 04	Bed 3A	Sash - REPAIR	960 x 1540		Timber	White	Double Glazing - 2ndary	upvc int opening	Yes	
	A - FW 05	Bath A	Sash - REPAIR	560 x 1170		Timber	White	Single Glazing - 2ndary	Toughened - Single Sheet		
	A - FW 06	Bath A	Sash - REPAIR BOTTOM 1/2 casement	900 x 1650		Timber	White	Single Glazing - 2ndary	upvc int opening		
Ground Floor											
	B - GW 01	Hall B	Sash - REPAIR	900 x 1580		Timber	White	Single Glazing	Opaque		
	B - GW 02	Kitchen	Casement - REPAIR	540 x 780		Timber	White	Single Glazing - 2ndary	Toughened - Single Sheet		
	B - GW 03	Kitchen	Casement - REPAIR	540 x 780		Timber	White	Single Glazing - 2ndary	Toughened - Single Sheet		
	B - GW 04	Kitchen	Casement - NEW	780 x 1460		Timber	White	Double Glazing			
First Floor											
	B - FW 01	Bed 1B	Sash - NEW	1200 x 1540		Timber	White	Double Glazing			Yes
	B - FW 02	Bath B	Sash - NEW	900 x 1310		Timber	White	Double Glazing	Opaque		Yes
	B - FW 03	Bed 2B	Sash - NEW	900 x 1310		Timber	White	Double Glazing			Yes
	B - FW 04	Corridor	Sash - REPAIR	960 x 870		Timber	White	Single Glazing - 2ndary	Toughened - Single Sheet		
REPAIRS:		Glass (G), Repair Glass (RG), Sill (S), Epoxy resin Frame (ER), Reset Weights (W), Latches replacements (L), External Sill (ES), Internal Sill (IS), External Lintel Render (EL)									
Building Doctors											

Pennicotts Door Schedule V3

Doors	Description		Repairs	Ironmongry	Size Structural Opening	Opening	Material Type	
Ground Floor								
A- GD 01	Entrance Front Door	New - see drawing B890		Post door knocker, Hinges (H), Latches (LA), Door Handles (DH), Eschrontions (E) , Door Strikes (DS), Self Closes (SC). Locks (LO), HOOKS (HO), DOOR STOPS (DST)	840 x 1980	Right Opening, Inwards	Timber	PT Glazed
A- GD 02	Main Entrance Door	Existing			810 x 1920	Right Opening, Inwards	Timber	PT Glazed
A- GD 03	New Conservatory Door	New - see drawing B890		Post door knocker	840 x 1980	Left Opening, Inwards	Timber	PT Glazed
A- GD 04	Kitchen Outdoor	New - see drawing B910			900 x 2160 - 2 x equal panels	Double Door, Outwards	Timber	PT Glazed
A- GD 10	Under stairs Store Door	Existing - FD 30min			560 x	Right Opening, Outwards	Timber	
A- GD 11	Dining Area Door	Existing - FD 30 min	INTUMESCENT PAINT		810 x 1920	Right Opening, Outwards	Timber	PT Glazed
A- GD 12	Lounge A	Existing -FD 30 min			810 x 1920	Right Opening, Inwards	Timber	
A- GD 13	Lounge A	Existing - Fix shut			810 x 1920 TBC	Right Opening, Outwards	Timber	
A- GD 14	Corridor Door	Existing - Fix shut			810 x 1920 TBC	Store Door (Under Landing)	Timber	
A- GD 15	Corridor Door	Existing - Repair			800 x	Store Door (Under Landing)	Timber	
A- GD 16	Kitchen A	New - FD 30min - See B890			810 x 1920	Right Opening, Inwards		
A- GD 17	Kitchen Storage Door	Existing			600 x	Right Opening, Outwards		
A- GD 18	Kitchen / Dining	New -see drawing B890			710 x1 920 - x 2 equal panels	Double Door, Outwards		
A- GD 19	WC Door	New -see drawing B890			810 x 1920	Right Opening, Inwards		
First Floor								
A- FD 11	Bed 1A Door	Existing			810 x 1920	Left Opening, Inwards	Timber	
A- FD 12	Bed 2A Door	Existing			810 x 1920	Right Opening, Inwards	Timber	

A- FD 13	Bed 3A Door	Existing	810 x 1920	Left Opening, Inwards	Timber	
A- FD 14	Bath A	Existing	810 x 1920	Left Opening, Inwards	Timber	
A- FD 15	Lobby A	Move to Ensuite 2A	810 x 1920		Timber	
A- FD 16	Hot Water Cylinder Door	Existing	600 x 1925	Right Opening, Outwards	Timber	
A-FD 17	Ensuite Door	Recycle FD15	810 x 1920			
A- FD 18	Wardrobe Bed 2A	2X New - to match FD 15	2X 810 x 1920			
Ground Floor						
B - GD 01	New Porch	New - see drawing B890	840 x 1980	Left Opening, Outwards	Timber	PT Glazed
B - GD 02	Lounge B	Existing	840 x 1980	Left Opening, Inwards	Timber	PT Glazed
B - GD 03	Kitchen B	3x New - see drawing B910	710 x 2100 - x 2 Equal panels	Double Door , Outwards	Timber	PT Glazed
B - GD 05	Kitchen	New External Door with Glass Panel	900 x 2160 - 2 x equal panels	Double Door , Outwards	Timber	
B - GD 11	Lounge B	Existing	900 x 1920	Right Opening, Outwards	Timber	PT Glazed
B - GD 12	Lounge B	New	900 x 1920	Right Opening, Outwards	Timber	PT Glazed
B - GD 13	Lounge B	New - FD 30min	900 x 1920	Right Opening, Inwards	Timber	PT Glazed
B - GD 14	Lounge B	New - FD 30min	900 x 1920	Left Opening, Inwards	Timber	PT Glazed
B - GD 15	Store B	New	900 x 1920	Right Opening, Inwards	Timber	PT Glazed
First Floor						
B - FD 11	Bed 1B Door	Existing	810 x 1920	Left Opening, Inwards	Timber	
B - FD 12	Bath B	Existing	810 x 1920	Left Opening, Inwards	Timber	
B - FD 13	Bed 2B Door	Existing	810 x 1920	Left Opening, Inwards	Timber	
B - FD 14	Hot Water Cylinder Door	New	600 x 1920	Left Opening, Outwards	Timber	

HInges (H), Latches (LA), Door Handles (DH), Eschrontions (E) , Door Strikes (DS), Self Closes (SC). Locks (LO), HOOKS (HO), DOOR STOPS (DST)

Building Doctors