Julian Munn Drainage Services Ltd

10 Drygrounds Lane, Bognor Regis, West Sussex, PO22 8PS
Tel: 01243 825338/07799140639

CCTV Survey

Address: Sainsburys Store, Rustington
Job No.S0477/09/13
Client: Barr Ltd

ARUN DISTRICT COUNCIL R/116/14/DOC

ARUN DISTRICT COUNCIL R/116/14/DOC

SUMMARY OF CCTV SURVEY

Week Ending (Friday):04/10/13

Rig Manager: Iain Solomon **Site:** Sainsbury Rustington

Survey No	Start MH (Full Ref)	Finish MH (Full Ref)	Length Surveyed (m)	Total Sewer (m)	Date	Comments (Reasons for No survey / Collapses / Blockages)
1	MH01	PIPE X	26.80		30/09/2013	PRE JETTING
2	MH01	PIPE X	26.90			POST JETTING
3	MH01	PIPE X	28.10			POST JETTING
		Total	81.80			

No. days Tankering:
No. days Jetting:
Type of Jetter Unit used:
No. days Overpumping:

Signed:

Job No:	SO477/09/13					Date:		30/09/2013
Site:	SAINSBURYS RUSTINGTON					Operative Name:		IS
Survey No:	1	From:	MH01		To:	PIPE X	Depth:	1150mm
Duty:	S/W	Pipe Dia:	150 mm		Material:	VC	Direction:	D/S

Distance m	Code	C/D	Clock Ref At	Clock Ref To	Diameter mm	Percentage/Intrusion %	Percentage/Intrusion mm	Remarks
0.00	ST							
	MH							MH01
	WL					5		
	GO							PRE JETTING
	DES	S1	4	8		5		
1.90	DES	C1	4	8		15		
10.30	WL					25		
	DES	F1	4	8		15		
11.70	CU	S2						
14.20	GO							LOSS OF VISION
26.80	GO							UNABLE TO PUSH FURTHER
	CU	F2						
	SA							UNABLE TO CONTINUE

Break-in	NO	Pre-Survey Jetting	NO	
Water Test Grade		Reason for no test	N/A	Hours Jetting
				Hours Rodding

0 - Unable to fill after 10mins 2 - Medium loss over 2mins 4 - No loss
1 - Heavy Loss 3 - Slow loss over 5mins

Gully Condition (Visual)

Comments

Job No:	SO477/09/13					Date:		30/09/2013
Site:	SAINSBURYS RUSTINGTON					Operative Name:		IS
Survey No:	2	From:	MH01	To:	PIPE X	Depth:	1150mm	
Duty:	S/W	Pipe Dia:	150 mm	Material:	VC	Direction:	D/S	

Distance m	Code	C/D	Clock Ref At	Clock Ref To	Diameter mm	Percentage/Intrusion %	Percentage/Intrusion mm	Remarks
0.00	ST							
	MH							MH01
	WL					20		
	GO							POST JETTING
1.50	CU	S1						
	CU	F1						
26.90	SA							UNABLE TO CONTINUE

Break-in	NO	Pre-Survey Jetting	NO	
Water Test Grade		Reason for no test	N/A	Hours Jetting
				Hours Rodding

0 - Unable to fill after 10mins 2 - Medium loss over 2mins 4 - No loss
1 - Heavy Loss 3 - Slow loss over 5mins

Gully Condition (Visual)

Comments

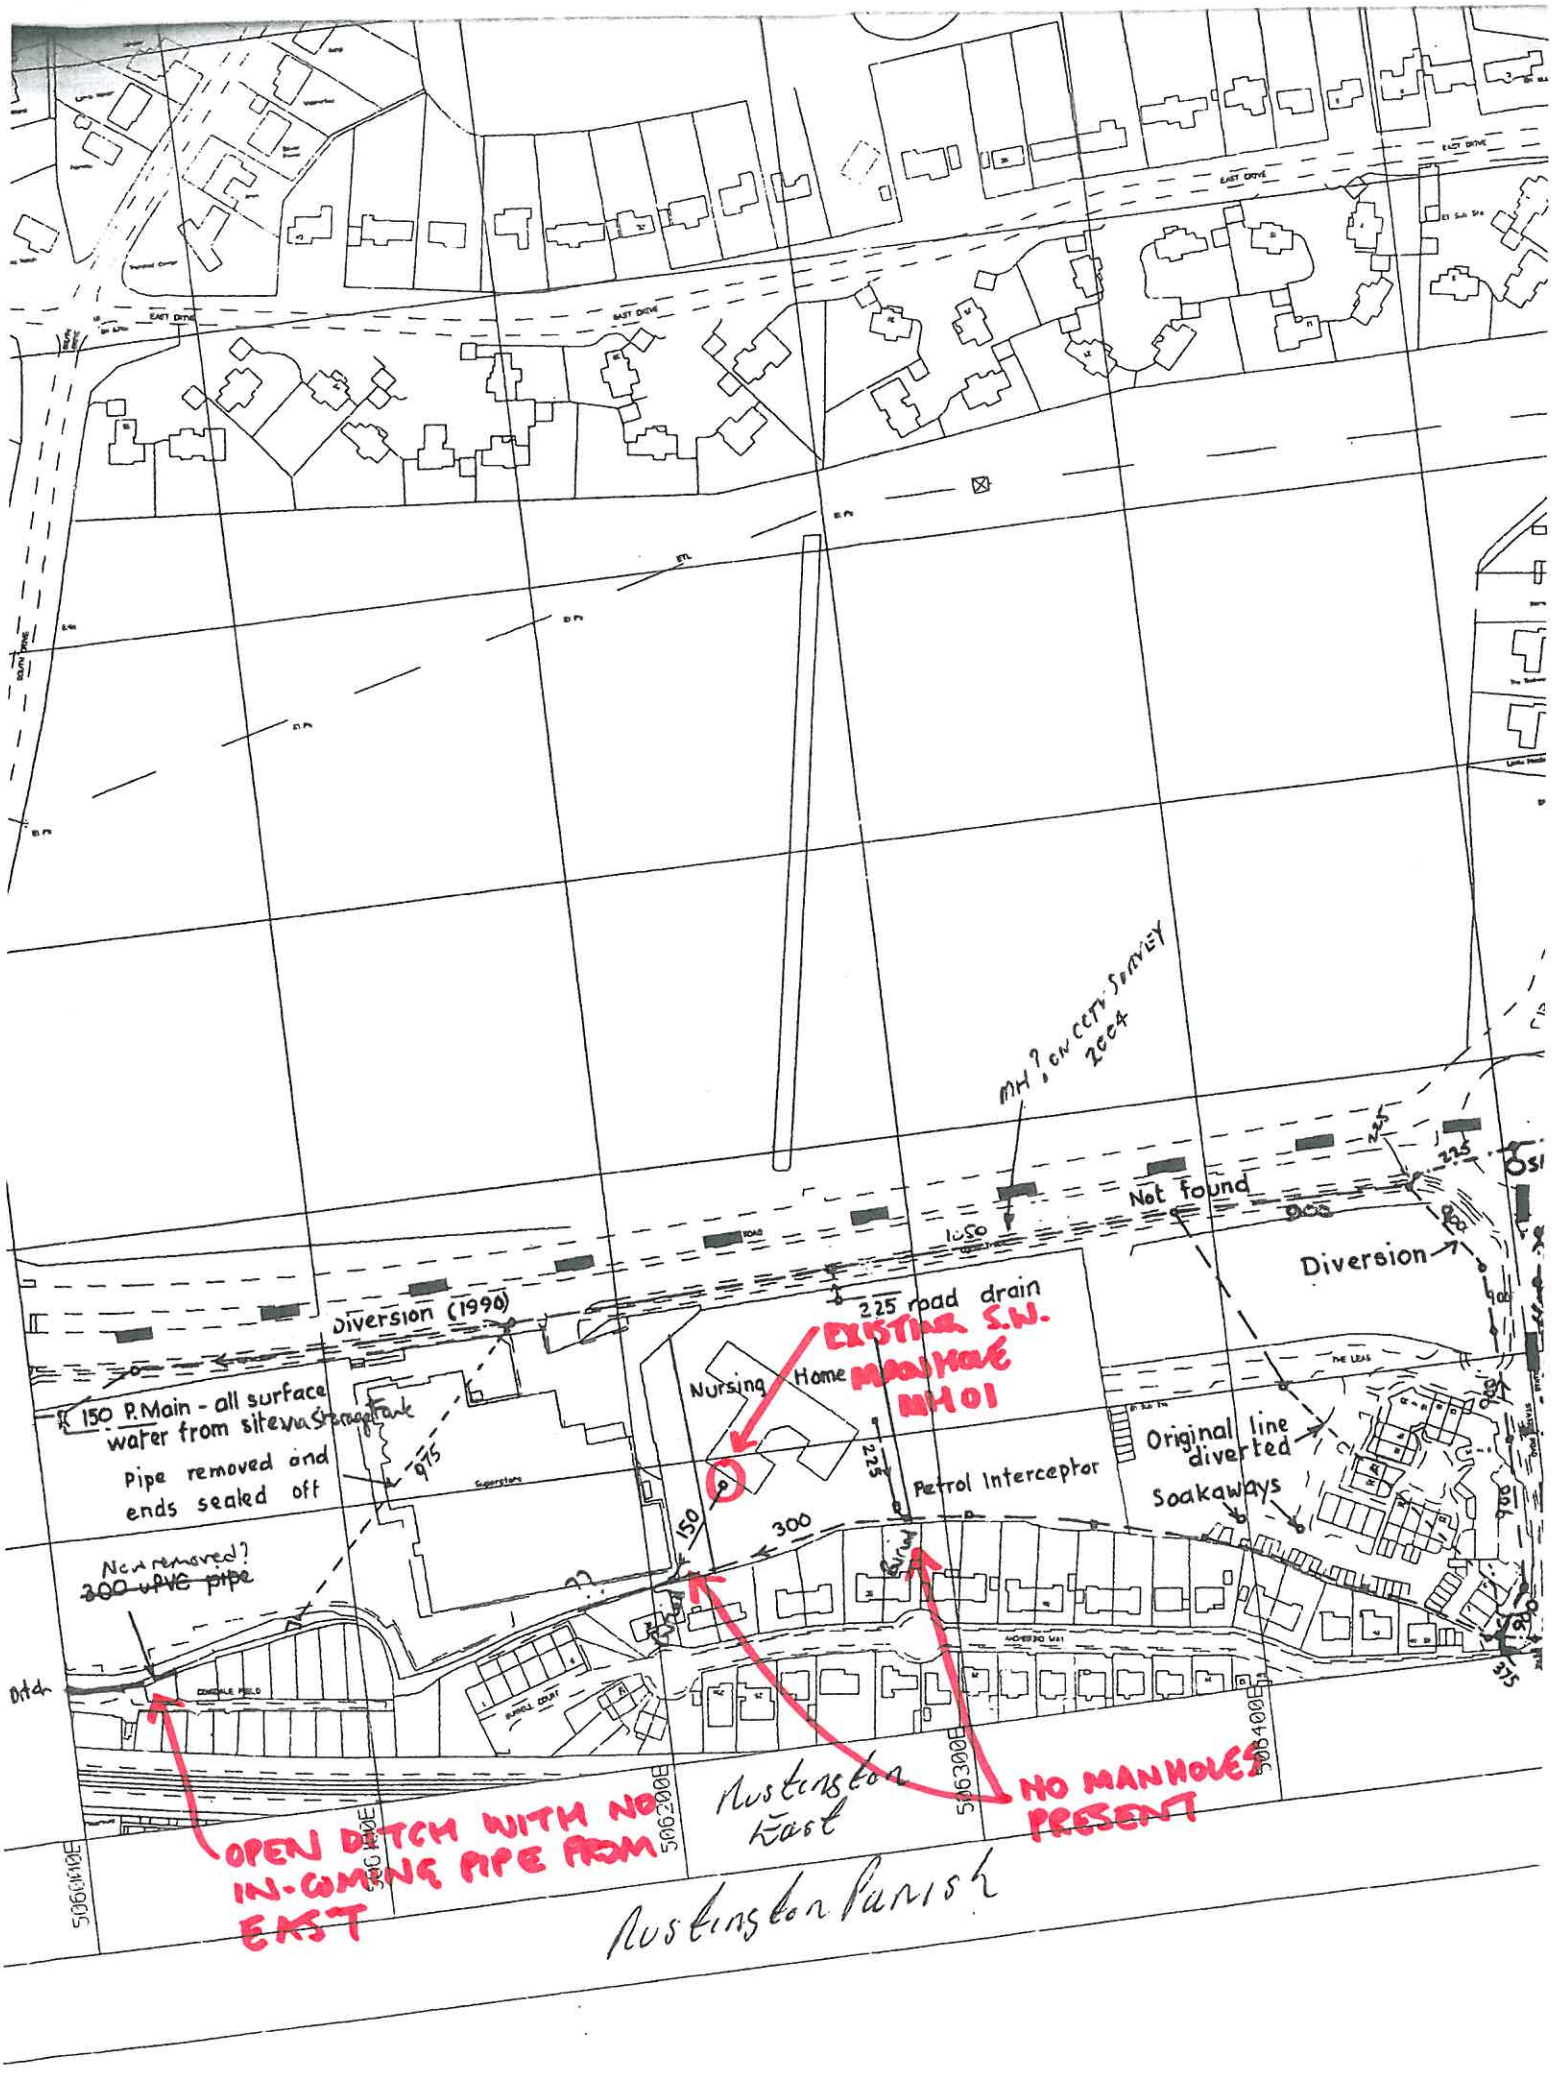
EAST DRIVE
MH ? CONCRETE SURVEY 2004
Not found
Diversion
Diversion (1990)
225 road drain
EXISTING S.W. MANHOLE MH01
150 P.Main - all surface water from site via Storage Tank
Pipe removed and ends sealed off
Nursing Home
Petrol Interceptor
Original line diverted
Soakaways
New removed? 300 uPVC pipe
Ditch
OPEN DITCH WITH NO IN-COMING PIPE FROM EAST
NO MANHOLES PRESENT
Rustington East
Rustington Parish
506200E
506300E
506400E

ARUN DISTRICT COUNCIL R/116/14/DOC

Sainsburys Store, Rustington

S0477/09/13

Drain Trace Layout

30/09/13

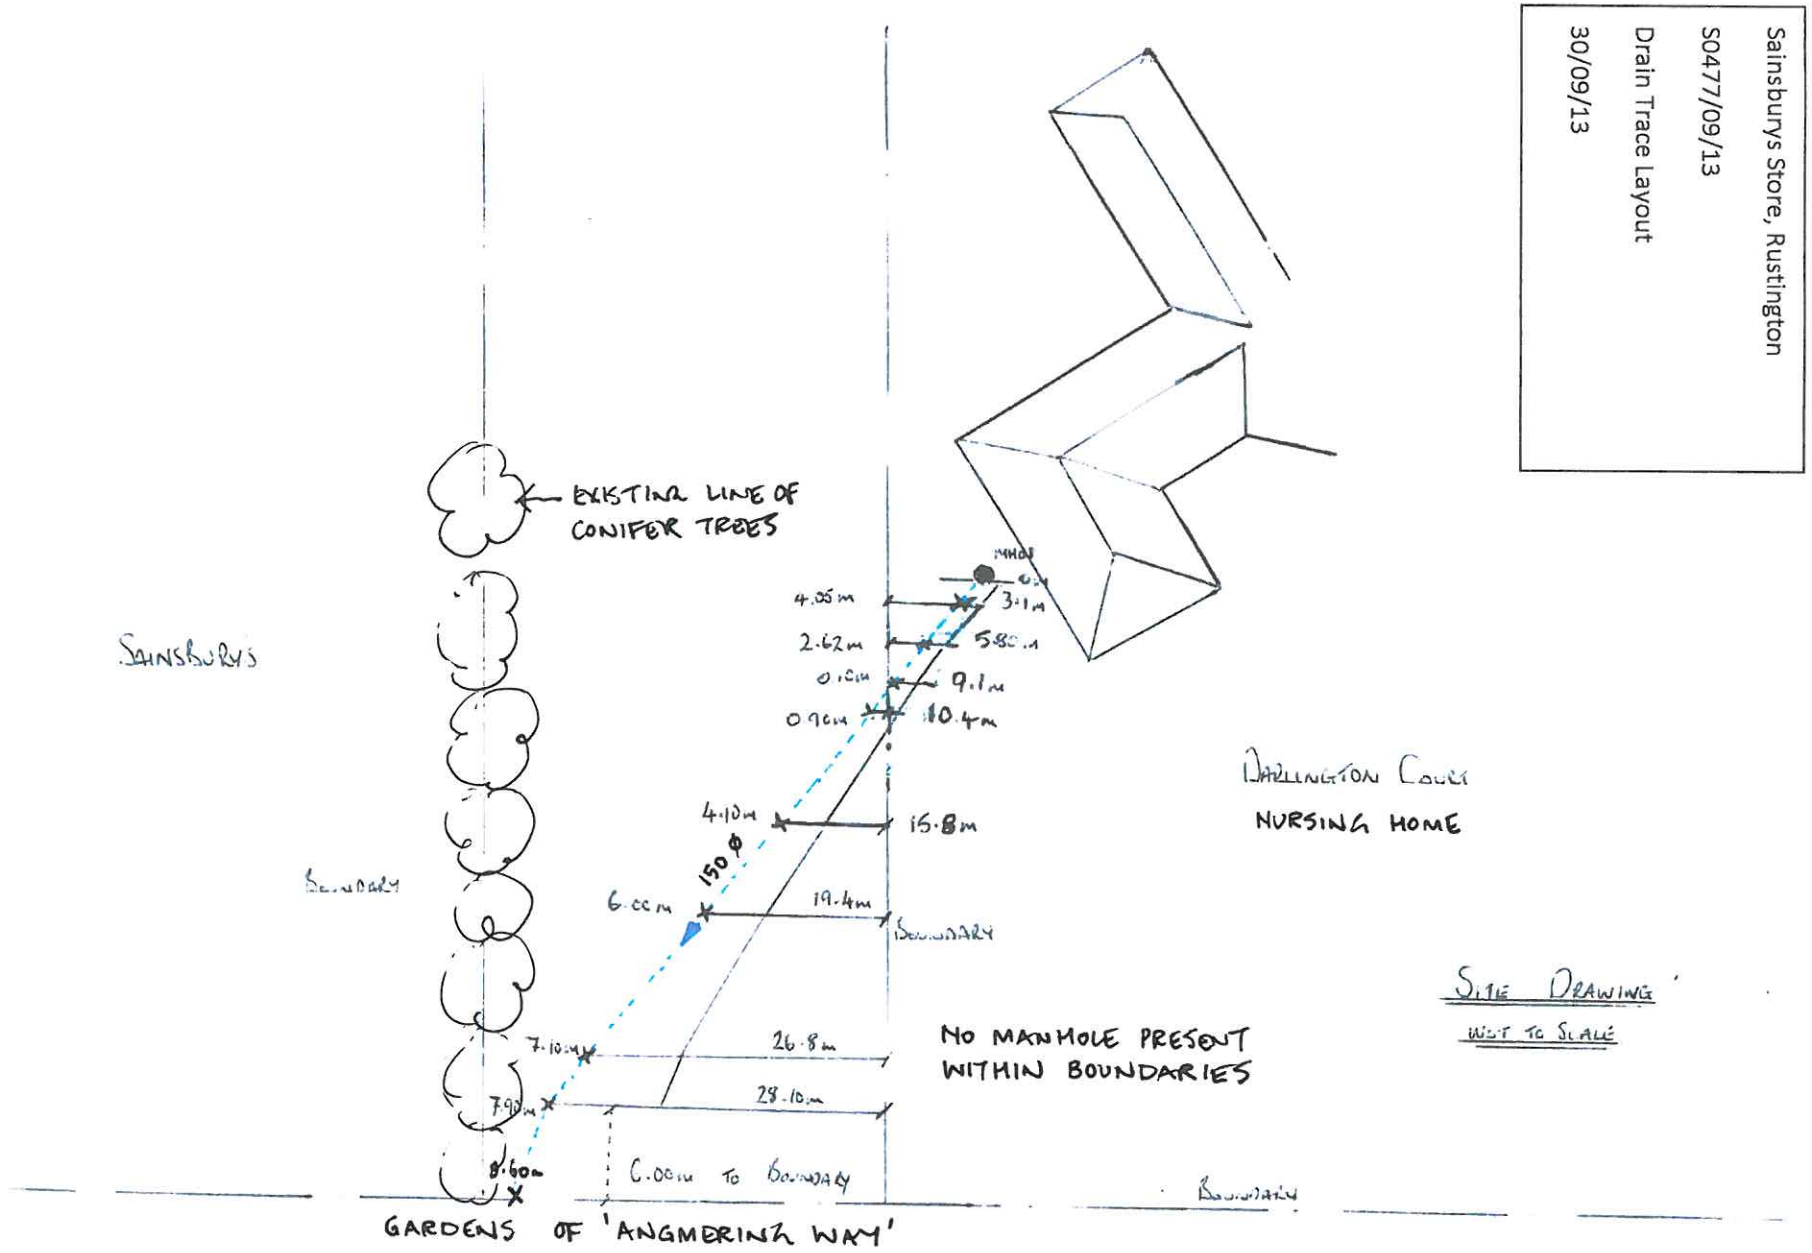



'ATION TOWARDS DARLING



N OF DRAIN FROM BOUNDA

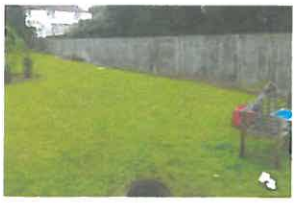

ECTION OF PIPE X FROM MI



FILLED IN DITCH LINE (2)



FILLED IN DITCH LINE (3)



FILLED IN DITCH LINE (4)



FILLED IN DITCH LINE (5)



FILLED IN DITCH LINE



VERT OF FILLED IN DITCH (



VERT OF FILLED IN DITCH (



NVERT OF FILLED IN DITCH



MH 01 (2)

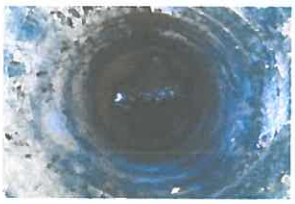

MH 01



SOIL AND CHALK IN PART E



CAVATION OF POINT AT 26.8



PART EXCAVATION TO REAI