

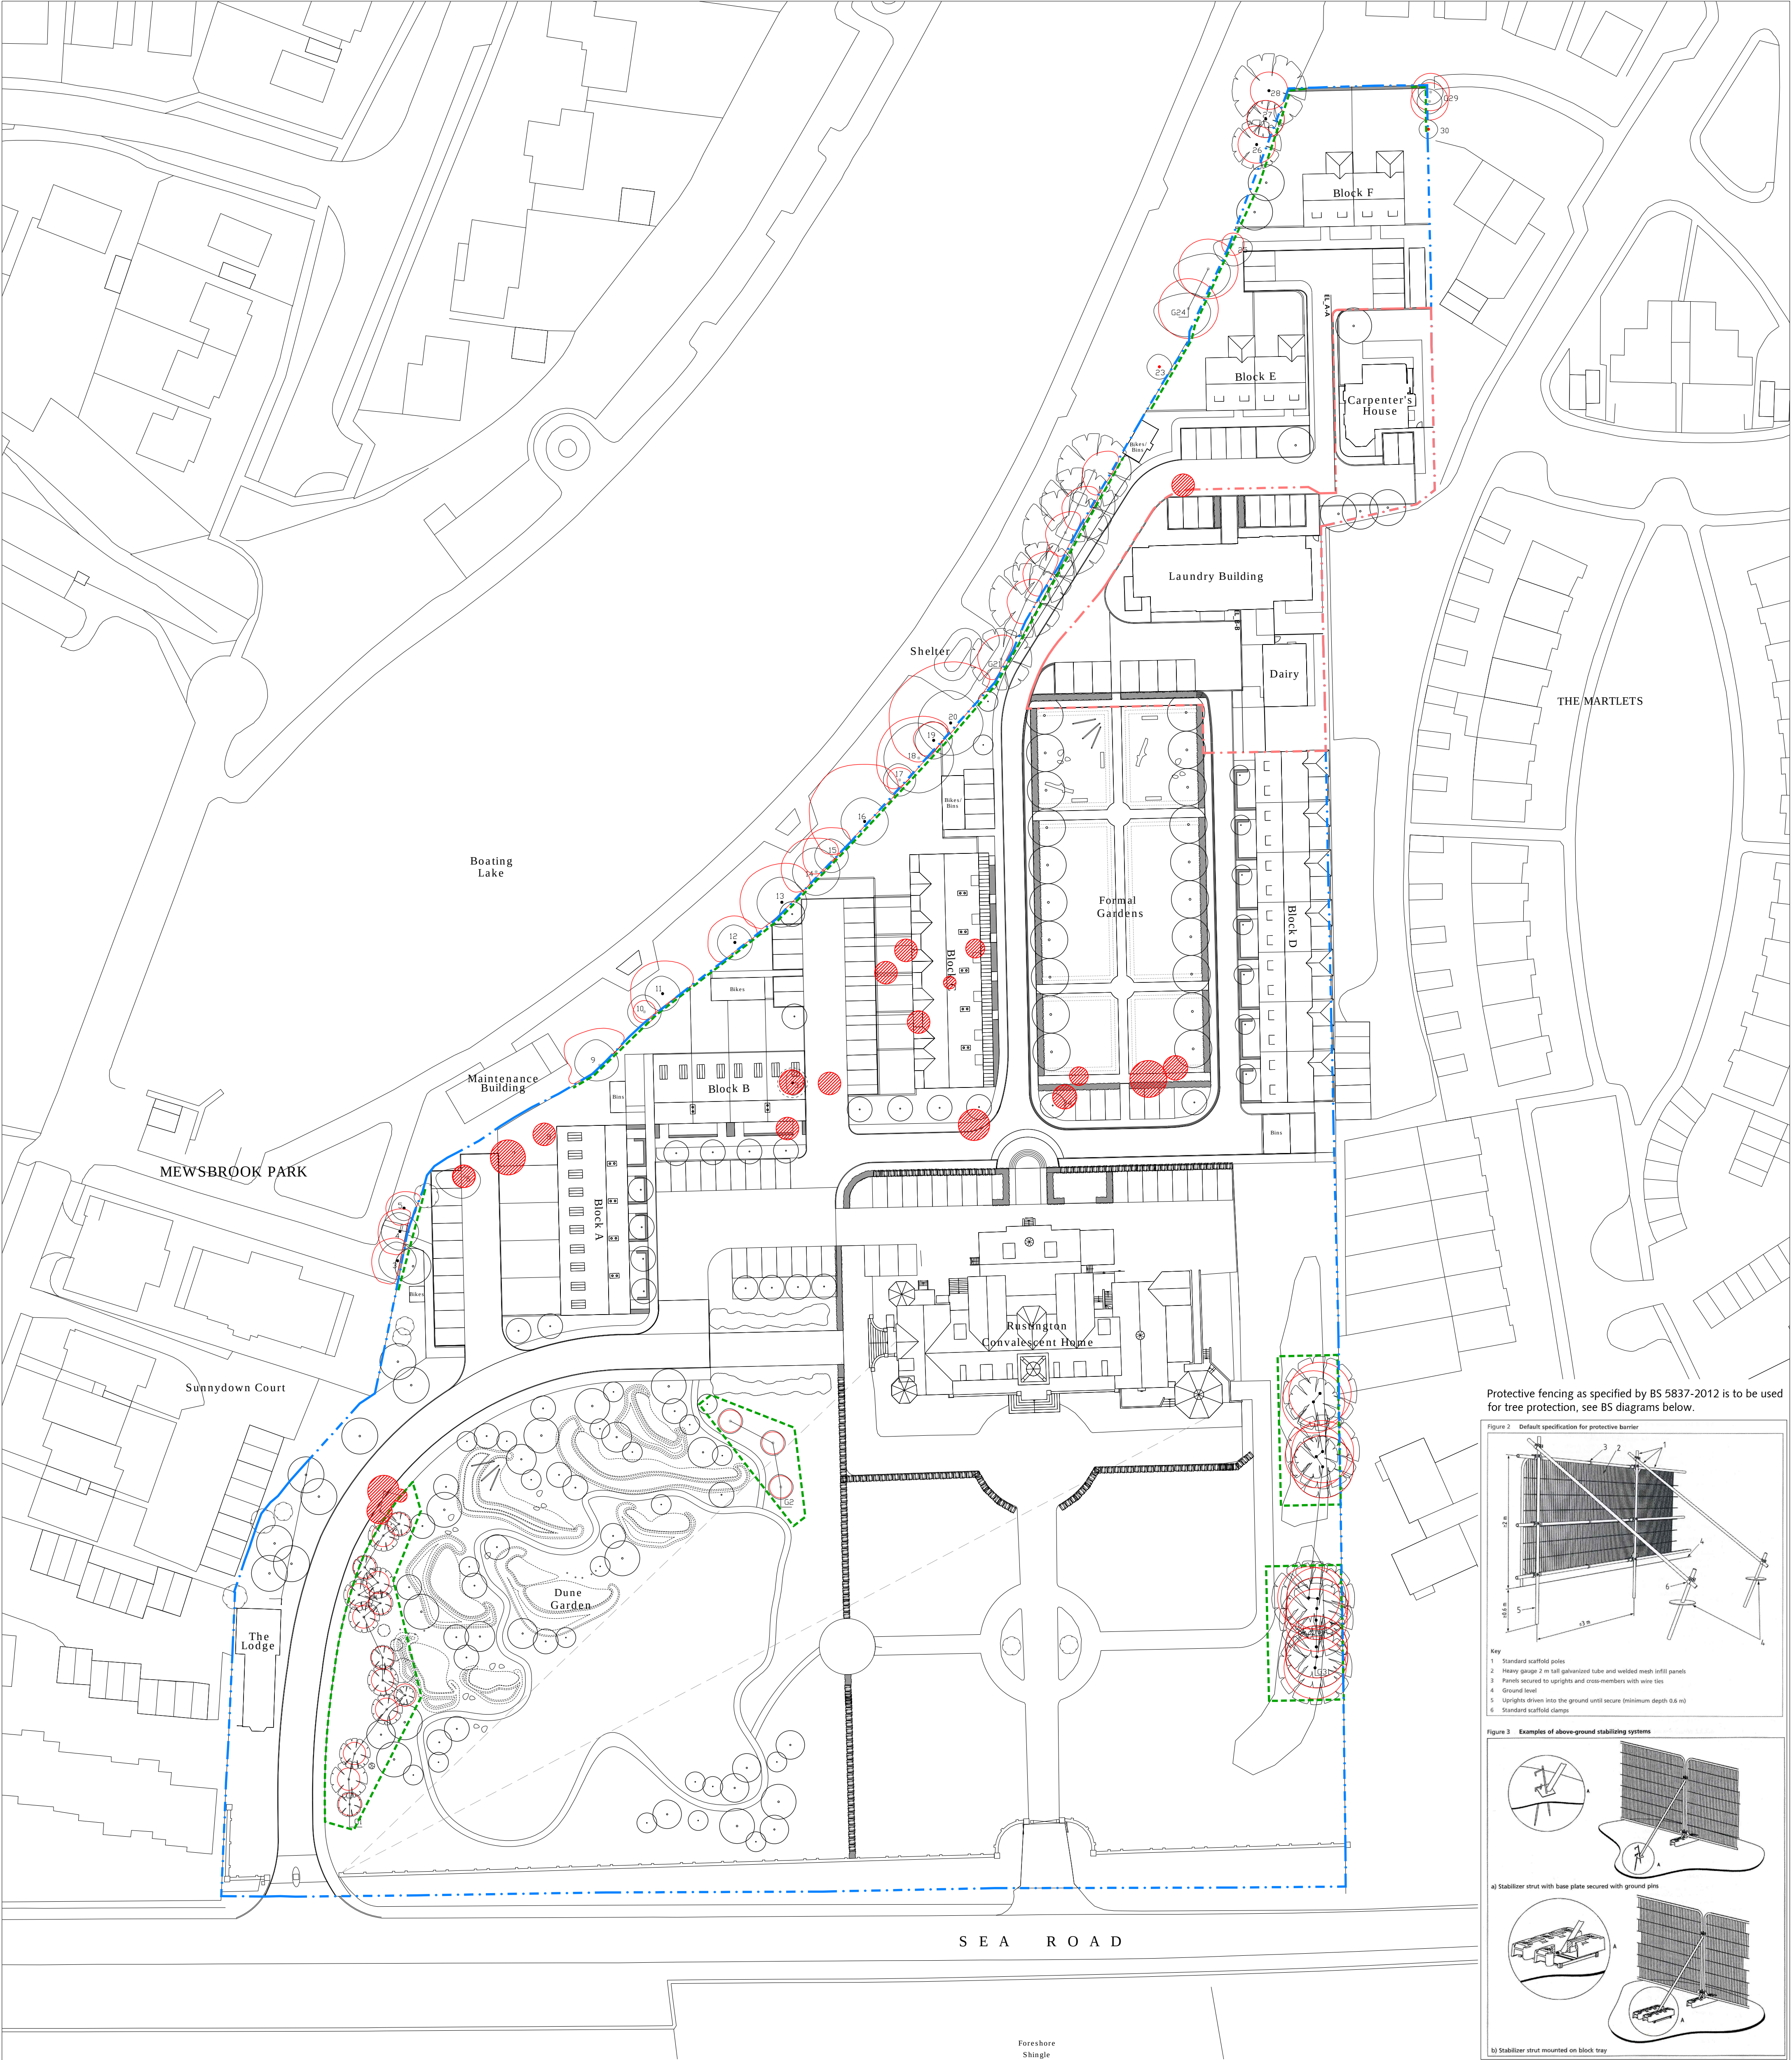


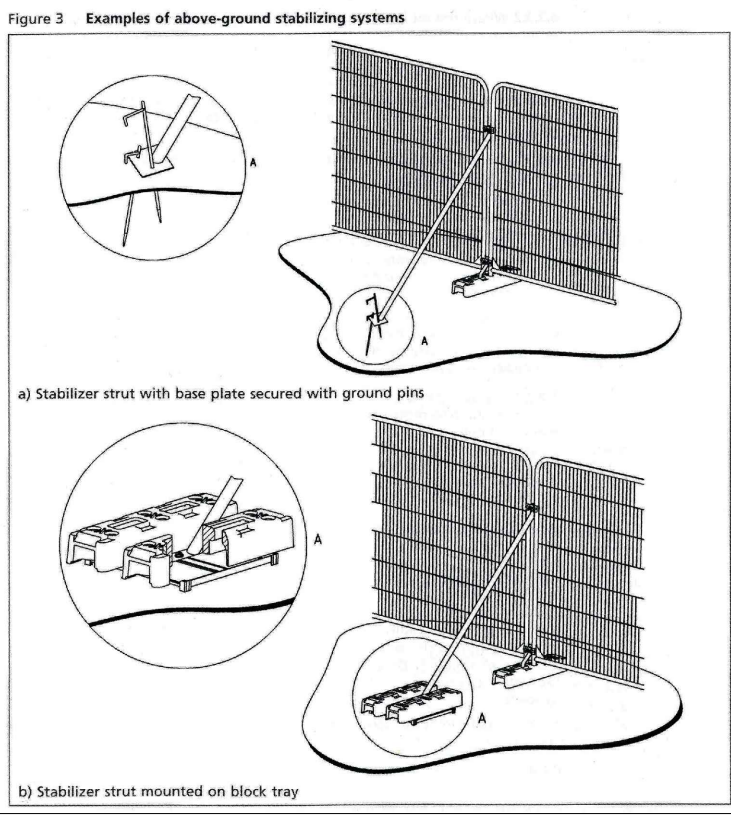

Protective fencing as specified by BS 5837-2012 is to be used for tree protection, see BS diagrams below.

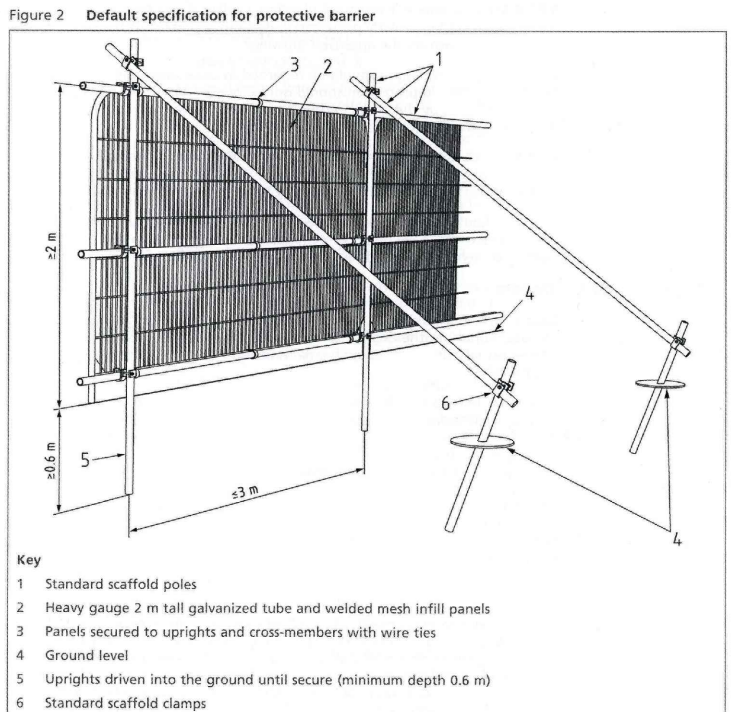

01. Tree Removals Plan Scale 1:500

02. Tree Removals Schedule

No.	Species	Height	Diameter	Age class	Physical condition	Structural condition	Comments	Estimated lifespan	BS Category	Action
G1	Holm Oak/shrubs	3	<150	MA	G	G	Small ornamental, suitable for transplantation	40+	C2	REMOVE 3no.
G2	Pine spp. X3	5	<150	Y	M	M	Fairly low vigour	20-40	C2	
3	Willow	5	250e	M	G	G	Offsite tree. Behind low wall	20-40	B2	
4	Hawthorn	5	250e	M	G	G	See above	20-40	B2	
5	Pear	5	200e	MA	G	G	See above	20-40	B2	
6	Maple	5	<150	Y	G	G	Young tree, dia less than 150mm	40+	C1	REMOVE/RELOCATE
7	Lawson Cypress	4	280	MA	M	M	Very windswept	10-20	C1	REMOVE
8	Blue Atlas Cedar	4	<150	Y	G	M	Young tree, dia less than 150mm, windswept	40+	C1	REMOVE/RELOCATE
9	Poplar	14	350e	M	G	M	Dieback throughout crown, very windswept	10-20	C2	
10	Elder	4	<150	MA	G	G	Offsite	10-20	C2	
11	Pine spp.	4	350e	M	G	M	Recurrent tree	20-40	B1	
12	Holm Oak	8	300e	M	G	G		20-40	B2	
13	Willow	8	400e	M	G	M		20-40	B2	
14	Pine	8	350e	M	G	M	Leaning, sparse crown	10-20	C2	
15	Holm Oak	8	300e	MA	M	M	Sparse crown	10-20	C2	
16	Pine	8	500e	M	G	G	Ivy-clad swept stem	20-40	B1	
17	Holm Oak	6	<150	MA	M	M	Sparse crown	10-20	C2	
18	Monterey Cypress	10	500e	M	G	G	Dieback in upper crown	10-20	C2	
19	Scots Pine	8	250e	MA	M	M	Sparse crown	20-40	B1	

(1/2)

No.	Species	Height	Diameter	Age class	Physical condition	Structural condition	Comments	Estimated lifespan	BS Category	Action
20	Monterey Cypress	16	600	M	G	G		20-40	B1	
G21	Ash/Mixed Conifers	16	250av	M	-	-	Off site behind hedging	10-20	C2	
22	Cherry	4	<150	Y	G	M	Ornamental garden tree	10-20	C1	REMOVE
23	Monterey Cypress	10	250e	M	P	P	Struck by lightning	<10	R	
G24	Monterey Cypress	8-10	400e	M	M	-	Sparse crowns	10-20	C2	
25	Sweet Chestnut	8	<150	Y	G	M	Young tree, dia less than 150mm	40+	C1	
26	Elder	6	250av	-	-	-	Inaccessible	-	B2	
27	Holm Oak	7	250av	MA	-	-	Inaccessible	-	B2	
28	Monterey Cypress	12	250av	M	-	-	Inaccessible	-	B2	
G29	Sycamore	6	250av	MA	M	M	Heavily pollarded	10-20	C2	
30	Silver Birch	5	200e	MA	P	P	Heavily pollarded	<10	R	
G31	Monterey Cypress	15	500	M	G	G	High landscape value group	20-40	B2	
G32	Wild Cherry	5	<150	MA	G	G	Ornamental garden trees	20-40	B2	REMOVE 2no.
33	Eucalyptus	2.5	<150	MA	G	G	Coppice stool	10-20	C1	REMOVE
34	Ulm	6	<150	MA	G	G	Ornamental garden tree	20-40	C1	REMOVE
35	Yew	5	250	M	G	M	Very windswept	40+	B1	REMOVE
36	Mixed new planting	2	<150	Y	G	G	Saplings, useful for translocation if necessary	40+	C1	REMOVE/RELOCATE 6no.
37	Lawson Cypress	4	200	M	M	M	Very windswept	10-20	C1	REMOVE
38	Flowering Cherry	2	<150	Y	G	G	Young tree with dia less than 150mm	20-40	C1	REMOVE/RELOCATE

(2/2)

Do not scale drawings. All dimensions to be checked on site.
Errors to be reported immediately to landscape architect.
To be read in conjunction with all relevant architects, Services and engineers drawings.

Revision Tracker
01 - Planning Issue for Condition 7

06.02.2018

Churchman Landscape Architects

London
3.04 Chester House, Kennington Park,
1-3 Brixton Rd, SW9 6DE


Bristol
S4 Bristol & Exeter House,
Lower Approach Road, BS1 6QS

+44(0)20 3727 6780
mail@churchmanla.co.uk

Date
Scale
Drawn
19.01.2018
1:500/A1
CPI/ADK

Location
Client
Littlehampton, West Sussex
The Carpenters' Company

Rustington Convalescent Home
Tree Protection and Removals Plan
494-CLA-XX-0F-DR-L-0700



REV
01