



## Arboricultural impact appraisal and method statement

Land adjacent to Woodgate Nurseries, Lidsey Road (PHASE 1)

Philip Brophy HND Arb MArborA CEnv MICFor RCarborA

## Site location and report purpose

---

### Site location



This aerial image is supplied courtesy of Urban Design Group Barratt Developments Plc. The red line shows the application site boundary and is for illustrative planning use only and should not be scaled.



## Site location and report purpose

---

### Report purpose

This arboricultural impact appraisal report provides sufficient information for the local planning authority (LPA) to consider the effect of the proposed development on local character from a tree perspective. It is fully compliant with the BS 5837 advice relating to the planning application stage of the process and it meets national standard planning application validation requirements.

More specifically, the development proposal is a reserved matters application for a residential development with 93no. dwellings (Use Class C3), informal and formal public open space, landscaping, drainage, at land adjacent to Woodgate Nurseries, Lidsey Road (Phase 1).

This report includes:

- A **tree protection plan** illustrating tree locations, categories, the location of the proposed development, and the proposed tree protection measures.
- An **arboricultural impact appraisal** (section 1 of the report) providing an analysis of the tree issues to assist the LPA in assessing the impact on local character.
- An **arboricultural method statement** (section 2 of the report) describing how retained trees will be protected and managed during the development activity.
- **Appendices** (**Appendix 1** – Background administrative information and data collection; **Appendix 2** – Tree schedule and explanatory notes; and, **Appendix 3** – QR Codes for Site Guidance Notes (SGNs)).
- A companion document to supplement the main report titled ***Manual for managing trees on development sites (Version 3.0)***, which provides explanations of how retained trees will be managed on site in the form of SGNs covering the relevant issues.



## 1 Arboricultural impact assessment

### 1.1 Table 1: Summary of trees affected and protected by the proposal

From our review of the constraints and the proposed layout, our assessment of the impact on trees, both during and after development, and those that need protection using special precautions, is summarised in Table 1:

	British Standard 5837 Category		
	A (High quality)	B (Moderate quality)	C (Low quality)
Remove	None	None	G63 (part), G65, G68 (part), G74 (part), G75 (part), H79 (part)
Prune	None	None	None
Protect using special precautions <small>See Notes below</small>	None	T64, T66, G76	None
Post development pressure to fell	None	None	None

G = Group H = Hedge

**Note on types of protection:** All retained trees will be protected during development by using temporary barriers and ground protection measures and only those requiring special precautions to limit the impact of encroachment are listed in Table 1.

### 1.2 The impact of tree removals on local character

My assessment of the impact of tree removals on local character is as follows:

#### Group G65 and selected parts of groups G63, G68, G74 and G75

These groups are comprised of low-quality cypress and western red cedar trees that appear to have been planted as screening/shelterbelt elements to the existing site context. They have very low arboricultural value in respect to visual amenity and are incongruous to the established character of the wider landscape. Their proposed removal will have no adverse bearing on the appearance of the site from surrounding public vantages and it is my opinion that it will result in a betterment and more positive alignment to the broader landscape character.

#### Part of hedge H79

A small section of this hedge will be removed to enable the formation of an access point to the south of the site. The removal of this small section will have no adverse impact on visual amenity or landscape character.

### 1.3 Insignificant encroachment into RPAs

There is minor encroachment into the nominal circular RPAs for tree T72 and group G76 due to the positioning of the proposed highway access. Given the existing site conditions, ground levels and presence of a significant drainage ditch and the fact that these encroachments occur at the very outer extents of the radial RPAs, it is my opinion that there will be no significant adverse impact on these trees. Rooting areas accessible to the trees, but beyond the radial RPA extents will remain unchanged, and these will offset any soil volume loss arising from the encroachments. In summary, if the guidance set out in the Site Guidance Manual accompanying this report is observed when preparing the working detail of the highway access then I am confident that the proposed works can be implemented without any unsustainable impact on the trees.



## 1 Arboricultural impact assessment

---

### 1.4 The impact of tree pruning on local character

No trees will need to be pruned because of this development and so there will be no impact on local character for that reason.

### 1.5 The impact of works in precautionary areas

My assessment of the impact of encroachment into RPAs that will be managed by special precautions, is as follows:

#### Trees T64 and T66

There will be minor encroachment into the radially expressed RPA extents of these two trees in the form of new permeable footpaths (and a bin store area in the case of tree T64). I have carefully reviewed and assessed the ground levels along the proposed route of these footpaths, and it is my opinion that it would be feasible to install a custom designed no-dig specification surface without causing any significant disturbance to the RPAs. From my previous involvement in the installation of such surfaces ([www.barrelltreecare.co.uk/case-studies/SurfacingNearTrees.pdf](http://www.barrelltreecare.co.uk/case-studies/SurfacingNearTrees.pdf)), I am confident that this can be implemented without any long term detrimental impact on tree health, with the full working detail to be supplied and agreed as part of a reasonably worded planning condition. This surfacing solution is within the advice set out in BS 5837 (8.6) and would be appropriate in this situation. The same approach will be used for the bin store area extents adjacent to tree T64 and where fencing is required to formally define the extents of this bin store, then all excavation for supporting posts will be undertaken by hand to avoid any impact on roots that may be at the selected locations (if roots are found then an offset alternative position will be found). All excavated post holes within the radially calculated RPA will be lined with an impermeable fabric to prevent contamination of the soil profile from any poured/supporting wet mix aggregate.

In summary, if the guidance set out in SGN 7 *Excavating in RPAs* and SGN 9 *Installing/upgrading surfacing in RPAs* is observed, then I believe that the proposed works can be implemented without any long-term detrimental impact on tree health, and therefore local character. Importantly these works will be undertaken during the soft landscaping phase of the redevelopment and the areas in question will remain annexed within the defined construction exclusion zone until that time.

#### Trees within group G76

There will be encroachment into the western radial RPA extents of this group in the form of a new permeable footpath. I have carefully reviewed and assessed the ground levels along the proposed route of this footpath, and it is my opinion that it would be feasible to install a custom designed no-dig specification surface without causing any significant disturbance to the RPA. From my previous involvement in the installation of such surfaces ([www.barrelltreecare.co.uk/case-studies/SurfacingNearTrees.pdf](http://www.barrelltreecare.co.uk/case-studies/SurfacingNearTrees.pdf)), I am confident that this can be implemented without any long term detrimental impact on tree health, with the full working detail to be supplied and agreed as part of a reasonably worded planning condition. This surfacing solution is within the advice set out in BS 5837 (8.6) and would be appropriate in this situation.

In summary, if the guidance set out in SGN 7 *Excavating in RPAs* and SGN 9 *Installing/upgrading surfacing in RPAs* is observed, then I believe that the proposed works can be implemented without any long-term detrimental impact on tree health, and therefore local character. Importantly this pathway will be constructed during the soft landscaping phase of the redevelopment and the area in question will remain annexed within the defined construction exclusion zone until that time.



## 1 Arboricultural impact assessment

---

### 1.6 Unanticipated upgrading of existing services or installation of new services

Retained trees may be adversely affected by the installation of new services and / or the upgrading of existing services if that work encroaches into their RPAs. However, it is often difficult to know the detail of service locations until the construction is in progress, and sometimes encroachment into RPAs is unavoidable. Where possible, the default approach must be to use any existing service runs and keep all new services outside RPAs. Where existing services within RPAs require upgrading, or new services must be installed in RPAs, great care must be taken to minimise any disturbance. Trenchless installation will be the preferred option, but if that is not feasible, any excavation must be carried out by hand according to the guidelines in SGN 11 *Installing services in RPAs*.

### 1.7 Post development considerations

If trees are retained or planted too close to occupied buildings and/or garden amenity space, it is sometimes claimed that they can cause excessive shade or anxiety, which interferes with the normal use of the property. In extreme cases, this can result in pressure from future owners to fell or severely prune, thus reducing the long-term contribution of the trees to local character. However, in my experience, these problems are extremely rare and there is very little evidence that such pressures ever result in any significant harm to the wider setting. Indeed, there is an increasing body of evidence that the benefits from trees close to occupied areas significantly outweigh any disadvantages caused by shade or anxiety. Furthermore, important trees can be protected using tree preservation orders, which come with an overarching presumption to retain protected trees unless the normal use of the property is harmed to a significant extent. To my knowledge, there is no published evidence to support that trees are being lost to the detriment of local character for these reasons. I have considered these concerns in my analysis for this site and my conclusions take full account of those important issues.

### 1.8 Summary of impact on local character

This proposal will result in the loss of a limited number of trees and a small section of hedgerow that have been established as screening linear features within the site. They are of low quality due to their structural form and levels of observed vitality and their proposed removal to enable the redevelopment will not have a detrimental impact on visual amenity or landscape character. All the sustainable boundary tree cover will remain intact and unchanged, and this will ensure that the appearance of the site continues to align to the character of the wider established landscape. The matter of adverse impacts on retained trees due to post-development pressures to fell or prune has been considered and I concluded that none of the retained trees will be affected. The construction activity may affect retained trees if appropriate protective measures are not taken. However, if adequate precautions to protect these retained trees are specified and implemented through the arboricultural method statement included in this report, then the development proposal will have no detrimental impact on tree health or the contribution of such trees to the character of the wider setting.

For these reasons, I conclude that the proposed development would not cause an unacceptable or adverse impact on the long-term vitality of the retained trees, and therefore the character and appearance of the area. Furthermore, it fully aligns with the broad guidance set out in the National Planning Policy Framework, and requirements of Local Plan Policies.



## 2 Arboricultural method statement

---

### 2.1 Site Guidance Notes (SGNs)

This section of the report identifies which trees on this site will be protected and managed, and by what means. This site-specific summary is supplemented by more detailed explanations and descriptions of specific operations set out in the accompanying *Manual for managing trees on development sites*. That document is a compilation of 12 individual SGNs addressing the following tree protection and management issues that regularly arise in the construction phase of development:

- SGN1 *Monitoring tree protection* ([www.barrelltreecare.co.uk/technical-guidance/sgn01](http://www.barrelltreecare.co.uk/technical-guidance/sgn01))
- SGN2 *Fencing protected trees* ([www.barrelltreecare.co.uk/technical-guidance/sgn02](http://www.barrelltreecare.co.uk/technical-guidance/sgn02))
- SGN3 *Ground protection* ([www.barrelltreecare.co.uk/resources/technical-guidance/sgn03](http://www.barrelltreecare.co.uk/resources/technical-guidance/sgn03))
- SGN4 *Pollution control* ([www.barrelltreecare.co.uk/resources/technical-guidance/sgn04](http://www.barrelltreecare.co.uk/resources/technical-guidance/sgn04))
- SGN5 *Site cranes & piling rigs* ([www.barrelltreecare.co.uk/technical-guidance/sgn05](http://www.barrelltreecare.co.uk/technical-guidance/sgn05))
- SGN6 *Height restrictions* ([www.barrelltreecare.co.uk/resources/technical-guidance/sgn06](http://www.barrelltreecare.co.uk/resources/technical-guidance/sgn06))
- SGN7 *Excavating in RPAs* ([www.barrelltreecare.co.uk/technical-guidance/sgn07](http://www.barrelltreecare.co.uk/technical-guidance/sgn07))
- SGN8 *Removing surfacing and structures in RPAs* ([www.barrelltreecare.co.uk/technical-guidance/sgn08](http://www.barrelltreecare.co.uk/technical-guidance/sgn08))
- SGN9 *Installing/upgrading surfacing in RPAs* ([www.barrelltreecare.co.uk/technical-guidance/sgn09](http://www.barrelltreecare.co.uk/technical-guidance/sgn09))
- SGN10 *Installing structures in RPAs* ([www.barrelltreecare.co.uk/technical-guidance/sgn10](http://www.barrelltreecare.co.uk/technical-guidance/sgn10))
- SGN11 *Installing services in RPAs* ([www.barrelltreecare.co.uk/technical-guidance/sgn11](http://www.barrelltreecare.co.uk/technical-guidance/sgn11))
- SGN12 *Landscaping in RPAs* ([www.barrelltreecare.co.uk/technical-guidance/sgn12](http://www.barrelltreecare.co.uk/technical-guidance/sgn12))

**NOTE:** Each individual SGN can be downloaded by using the links above and the QR Code links in Appendix 3.

### 2.2 Arboricultural supervision

An arboricultural consultant will be appointed to advise on the tree management for the site and to attend:

- a pre-commencement meeting before any work starts;
- regular supervision visits to oversee the agreed tree protection, as agreed at the pre-commencement meeting; and
- further supervision visits, as necessary, to oversee any unexpected works that could affect trees.

The detail of how the arboricultural supervision will be carried out is explained in SGN 1 *Monitoring tree protection* in the accompanying Manual.



## 2 Arboricultural method statement

### 2.3 Table 2: Summary of the site operations requiring arboricultural input

For this site, arboricultural input will be needed for the following operations:

Brief operation summary	Trees affected	Location of detailed explanations
<b>Pre-commencement meeting:</b> Meeting on site with all parties to agree protective measures, as described in SGN 1. <u>Will be carried out before any significant site works begin.</u>	All trees	SGN 1 <i>Monitoring tree protection</i>
<b>Tree works:</b> Contractor will carry out agreed works as described in Appendix 2. <u>Will be completed before any significant site works begin.</u>	Fell trees <b>G63 (part), G65, G68 (part), G74 (part), G75 (part, H79 (part))</b>	Appendix 2
<b>Installing fencing and ground protection:</b> Agreed tree protection measures will be installed and checked, as described in SGN 2 and SGN 3. <u>Will be completed before any significant site works begin.</u>	Fencing all trees Ground protection for trees <b>T66, T67, G80</b>	Tree protection plan, SGN 2 <i>Fencing protected trees</i> , and SGN 3 <i>Ground protection</i>
<b>Pollution control near retained trees:</b> Any pollution control measures identified during risk assessment will be installed as described in SGN 4. <u>Will be completed before any potential pollutants arrive on site.</u>	All trees	SGN 4 <i>Pollution control</i>
<b>Regular arboricultural supervision:</b> Provision will be made to carry out and record agreed arboricultural supervision, as described in SGN 1.	All trees	SGN 1 <i>Monitoring tree protection</i>
<b>Installing/upgrading surfacing in RPAs:</b> These operations will be carried out as described in the SGN 9.	<b>T64, T66, G76</b>	SGN 9 <i>Installing/upgrading surfacing in RPAs</i>
<b>Installing services in RPAs:</b> These operations will be carried out with care, as described in SGN 11.	All trees	SGN 11 <i>Installing services in RPAs</i>
<b>Landscaping in RPAs:</b> These operations will be carried out with care, as described in SGN 12.	All trees	SGN 12 <i>Landscaping in RPAs</i>
<b>Removing tree protection:</b> <u>Protection can only be removed when there is no risk of damage to retained trees, as described in SGN 1.</u>	All trees	SGN 1 <i>Monitoring tree protection</i>

The operations summarised in this table, and supplemented by the more detailed explanations set out in the SGNs and the rest of this document, form the arboricultural method statement for this site. The Site Manager will ensure that its details and any agreed amendments are known and understood by all site personnel. Copies of the agreed documents will be available on site. All personnel who could have an impact on trees will be briefed on the specific tree protection requirements as part of the site induction procedures. This requirement will be written into the site management documentation.

If unanticipated issues arise on site not referenced in the above explanations, further guidance on how to manage them can be found in the accompanying Manual.



## 2 Arboricultural method statement

---

### 2.4 Construction method statement (heads of terms summary)

A construction method statement is a description of how operations that may affect trees will be carried out to minimise any adverse impact on them. The details of how the site will be managed are construction and contractual matters that can only be finalised once the post-consent detailed planning begins. For that reason, at this stage in the planning process, as explained in clause 5.5.6 of BS 5837, it is normally sufficient to list a heads of terms summary of the issues requiring more detailed consideration once consent is issued. On this site, those issues are likely to include:

1. Preparation of a written site management protocol for dealing with tree issues, to be incorporated into formal site management procedures, and to specifically include induction training for all operatives related to tree protection.
2. The order of work on site, including site clearance, the installation of protective measures, the phasing of successive work locations, the installation of new structures/surfacing, the removal of tree protection, and any necessary reinstatement.
3. Erection and maintenance of tree protection measures.
4. Who will be responsible for protecting the trees on site.
5. Detailed proposals for inspecting and supervising the tree protection.
6. How accidents and emergencies involving trees will be managed, including accidental damage to roots and their treatment.
7. Details of facilitation pruning and access into site. What size vehicles will be used under canopies and will large machinery be lifted over trees.
8. The parking arrangements for workers and visitors.
9. A schedule of emergency contact numbers relating to trees.
10. Areas for loading and unloading of materials and storage of materials and plant.
11. Where site facilities will be located and when will they be installed.
12. How machinery and equipment (such as excavators, concrete pumps and piling rigs) will enter, move on, work on, and leave the site.
13. Pollution control to specifically consider chemical storage and wheel washing facilities in relation to trees.
14. Recycling and storage of waste in relation to trees.
15. Details of earthworks, grading and mounding and removal of spoil, including any planned lowering or raising of ground levels.
16. Precise services locations, including the method of excavation when near trees.
17. Details of upgrading/removing/replacing existing surfacing and areas where this will happen, including detailed and precise cross-sections where no-dig surfacing is to be installed.
18. How and when any temporary surfacing will be laid and removed.



## Appendix 1: Background administrative information and data collection

### A1.1 Table 3: Background administrative information

Background administrative information	
<b>Report date &amp; reference</b>	14 <sup>th</sup> March 2025; 24113-AIA5-PB
<b>Tree protection plan reference</b>	24113-5
<b>Instructing client</b>	Barratt David Wilson Homes
<b>Instructions</b>	Visit the site, assess the relevant trees, prepare a schedule of their details, describe the impact of the proposal on those trees and identify the tree protection issues in an arboricultural method statement with a tree protection plan.
<b>Provided documents</b>	<ul style="list-style-type: none"> <li>Topographical survey, drawing number '<b>17681120/TS</b>', received by email on 21st April 2021</li> <li>Drawing number '<b>ST-22-01 Rev G</b>', received by email on 14<sup>th</sup> March 2025</li> </ul>
<b>Report author and credentials</b>	Phillip Brophy is a Chartered Forester ( <a href="http://www.charteredforesters.org">www.charteredforesters.org</a> ), and a Registered Consultant of the Arboricultural Association ( <a href="http://www.trees.org.uk">www.trees.org.uk</a> ), and is fully qualified to undertake the assessments in this report ( <a href="https://www.barrelltreecare.co.uk/who-we-are/">https://www.barrelltreecare.co.uk/who-we-are/</a> )
<b>Report limitations</b>	<ul style="list-style-type: none"> <li>An online check of publicly accessible information has confirmed the presence of a tree preservation order (reference <b>TPO/AL/1/18</b>), on an area of the site. As such no works can be undertaken to trees listed within this order without formal consent of the LPA.</li> <li>This report does not constitute a tree hazard assessment. If concerns for tree health and safety arise then the necessary and appropriate tree inspections should be carried out.</li> <li>This report does not consider ecological or archaeological issues, or any other matter beyond the assessment of the trees.</li> </ul>
<b>Technical references</b>	<p>In preparing the analysis in this report, we considered the guidance and advice in the following technical references:</p> <ul style="list-style-type: none"> <li>Climate Change Act (2008) <a href="http://www.legislation.gov.uk/ukpga/2008/27/contents">www.legislation.gov.uk/ukpga/2008/27/contents</a></li> <li>Town and Country Planning Act 1990 <a href="http://www.legislation.gov.uk/ukpga/1990/8/contents">www.legislation.gov.uk/ukpga/1990/8/contents</a></li> <li>National Planning Policy Framework, published by the MHCLG <a href="http://www.gov.uk/government/publications/national-planning-policy-framework--2">www.gov.uk/government/publications/national-planning-policy-framework--2</a></li> <li>BS 5837 (2012) <i>Trees in relation to design, demolition and construction – Recommendations</i>, <a href="https://shop.bsigroup.com/ProductDetail">https://shop.bsigroup.com/ProductDetail</a></li> <li>BS 8545 (2014) <i>Trees: from nursery to independence in the landscape – Recommendations</i>, <a href="https://shop.bsigroup.com/ProductDetail">https://shop.bsigroup.com/ProductDetail</a></li> <li>BS 3998 (2010) <i>Tree work – Recommendations</i>, BSI <a href="https://shop.bsigroup.com/ProductDetail">https://shop.bsigroup.com/ProductDetail</a></li> <li><i>Trees in the Townscape: A Guide for Decision Makers</i>, published by the Trees &amp; Design Action Group <a href="http://www.tdag.org.uk/">http://www.tdag.org.uk/</a></li> <li><i>Trees in Hard Landscapes: A Guide for Delivery</i>, published by the Trees &amp; Design Action Group <a href="http://www.tdag.org.uk/">www.tdag.org.uk/</a></li> <li>National Joint Utilities Group (2007) Volume 4, Issue 2: <i>Guidelines for the planning, installation and maintenance of utility apparatus in proximity to trees</i> <a href="http://streetworks.org.uk/resources/publications/">http://streetworks.org.uk/resources/publications/</a></li> </ul>
<b>BS 5837 compliance</b>	<p>This report is BS 5837 compliant.</p> <p><i>BS 5837 (2012) Trees in relation to design, demolition and construction – Recommendations</i> is 10 years old. Since its publication, there have been</p>



## Appendix 1: Background administrative information and data collection

<b>Background administrative information</b>	
	<p>significant advancements in technology and thinking, informed by a decade of practical experience of putting principles into practice. In the document Foreword, it states: <i>“Any user claiming compliance with this British Standard is expected to be able to justify any course of action that deviates from its recommendations”</i>. This statement provides the opportunity for practitioners to claim compliance while moving best practice forward in the context of emerging technology, ideas, and experience. Although much of the BS 5837 content remains relevant and useful for managing trees in a planning context, there are now several aspects that are dated, and it is no longer appropriate to rigidly apply them to current planning submissions.</p> <p>Barrell Tree Consultancy (BTC) specialises in managing trees on development sites and retains a complete paper archive of every project it has carried out since starting business in 1980, with a digital data base listing those from 2004. In the decade since BS 5837 was published (April 2012), interrogation of the BTC archive confirms that we have been involved in a total of 3,884 projects, of which we estimate that about 3,845 were development related, and it is that depth of experience that informs the following statements on BS 5837 compliance. All BTC reports are prepared to be BS 5837 compliant and, although explanations are not explicitly required to claim compliance, the justifications for any deviations from its recommendations are set out below, referenced by the BS clause number:</p> <ol style="list-style-type: none"><li><b>1. 4.3 – soil assessment:</b> All BTC consultants have basic training relating to soil assessment and regularly deal with soil issues during their daily work, but none are soil specialists and BTC has no specialist investigation equipment for carrying out the type of soil assessment listed in this BS clause. In a modern development context, it is not for arboricultural consultants to demand or carry out professional soil investigations, and BTC does not do that. However, we will review soil information provided from appropriate specialists, if available, and incorporate that into our assessments.</li><li><b>2. 4.4.2.1 – tagging trees:</b> In some instances, it is not appropriate to tag trees, e.g., sensitive species, trees that are easily identified without a tag, inadequate access, project confidentiality, client instructions to the contrary, etc, and so although there will be a presumption to tag trees where feasible and appropriate, that may not be possible or necessary in every instance.</li><li><b>3. 4.4.2.5 e) – branch spread:</b> BTC only work from provided topographical surveys and where the branch spreads are shown correctly on those surveys, there is not normally any practical need to regurgitate that information in a schedule. Additionally, in closely spaced groups or in treacherous terrain, it is sometimes not safe or realistically possible to collect this data for every tree. For these reasons, BTC normally only collects crown spread data to the four cardinal points where the provided topographical survey is assessed as unreliable, or where a full canopy cover assessment is requested, and it is both safe and practically feasible to do so.</li><li><b>4. 4.4.2.5 f) – branch and canopy height:</b> In the absence of any definition of ‘canopy’ or ‘significant’ relating to branches in the <i>Terms and</i></li></ol>



## Appendix 1: Background administrative information and data collection

<b>Background administrative information</b>	
	<p><i>definitions</i> clause, and the lack of any practical guidance for reliably assessing these characteristics, BTC has adopted the following default position. We will only identify the height and orientation of branches where they have the potential to be damaged by vehicular access, i.e., below a height of 6 m, or where their removal would be beyond what the tree could tolerate during normal maintenance management, i.e., the branch removal would significantly adversely affect the health of the tree and potentially compromise its current safe useful life expectancy.</p> <p>5. <b>4.4.2.5 g) – life stage:</b> BS 5387 offers examples, but no definitions of what those examples mean. In the absence of a specific BS 5837 recommendation, BTC has reviewed the concept of maturity in a planning context, taking maturity to be a simplistic indication of a tree's ability to cope with change and its potential for further growth. For the purposes of development site advice, BTC conceptualises useful life-stage descriptions as; <b>young</b> indicating a potential to significantly increase in size and a high ability to cope with change; <b>maturing</b> indicating some potential to increase in size and a medium ability to cope with change; and, <b>mature</b> indicating little potential to increase in size and low ability to cope with change.</p> <p>6. <b>4.4.2.5 i) – estimated remaining contribution:</b> BTC accepts the category recommendations in Table 1 on the remaining contribution in the context of category, i.e., greater than 40 years for A trees, greater than 20 years for B trees, at least 10 years for C trees, and less than 10 years for U trees, and so this is also not listed separately in the schedule.</p> <p>7. <b>4.5.4 – subcategories:</b> BTC adopts a presumption that all trees are subcategory 1 (Mainly arboricultural qualities) unless noted to the contrary, and so for conciseness and to avoid complication, the subcategory is not listed in the schedule unless it is 2 or 3.</p> <p>8. <b>Table 2 and 4.4.2 – colour coding:</b> The colours included in this table take no account of the inability of some people to distinguish between red and green, which is not helpful to people suffering with this form of colour blindness. To address this discriminatory failing with the BS approach, BTC has adopted a more intuitively obvious regime of green and blue colours, which can be easily distinguished by colour-blind people, with the best category A and B trees (High and moderate quality) being green, and the lower category C and U trees (Low quality and unsuitable for retention) as blue. The differentiation between the two categories in each colour is provided by symbols rather than using different colours. This is clearly shown on the plan key, so there can be no doubt about what category a tree is, which is an intuitive approach to avoiding discrimination of colour-blind people. In any event, the tree category is now included next to each number, so there can be no question about the category and BS 5837 compliance.</p> <p>9. <b>5.2.1 – RPAs:</b> This clause recommends that the RPAs for category A, B, and C trees are shown as the existing constraints on the plans used in the <i>"concept and design"</i>, i.e., the tree constraints plan. However, the BS</p>



## Appendix 1: Background administrative information and data collection

Background administrative information	
	<p>does not explicitly recommend that all those constraints are shown on the tree protection plan, which is logical because only category A (High quality), and category B (Moderate quality) trees can realistically be material constraints, with category C (Low quality) and category U (Unsuitable for retention) trees obviously unsuitable to be determinative of the final design. Although it is not a BS recommendation to include the RPAs of category C trees on the tree protection plan because they cannot be material constraints, it is sometimes helpful as an informative to be able to see them if category C are planned for retention to assess if that is feasible. For that reason, BTC tree protection plans show the RPAs of category C trees as a thin grey line rather than the thicker grey line denoting category A and B RPAs.</p> <p>10. <b>5.2.2 Notes 1 and 2 – shading:</b> These notes offer general information on how shading can be assessed, which is presented in italics. The implications of the convention of using italics within the BS is set out in the Foreword as: <i>“Commentary, explanation and general informative material is presented in smaller italic type, and does not constitute a normative element.”</i> Our interpretation of that statement is that the application of Notes 1 and 2 is not part of the BS recommendations, and is not necessary for BS 5837 compliance. In our experience, the assessment of daylight issues is a specialist discipline and way beyond our expertise as arboriculturists, and so we would defer to an appropriate specialist, where any detailed guidance is required.</p>


A1.2 Table 4: Data collection

Data collection	
<b>Date of site visit</b>	5 <sup>th</sup> October 2024
<b>People present during site visit</b>	Phillip Brophy
<b>Weather and visibility</b>	Dull, windy, and damp, with average visibility
<b>Limitations to observations</b>	<ul style="list-style-type: none"> <li>The inspection of the trees for the purposes of assessing their condition and work requirements was made on the basis that they will be annually inspected in the future to identify any changes in condition and review the original recommendations. For these reasons, the tree assessment advice only remains valid for one year from the date that the trees were last inspected.</li> <li>All observations were of a preliminary nature and did not involve any climbing or detailed investigation beyond what was visible from accessible points at ground level.</li> <li>Observations of trees outside the site boundaries are confined to what was visible from within the site.</li> <li>All dimensions were estimated unless otherwise indicated.</li> </ul>
<b>Statutory protection through tree preservation orders and conservation areas</b>	An online check of publicly accessible information has confirmed the presence of a tree preservation order (reference <b>TPO/AL/1/18</b> ), on an area of the site. As such no works can be undertaken to trees within this area without formal consent of the LPA.
<b>Tree location and numbering</b>	Each arboricultural feature was inspected, and the numbering scheme is shown on the tree protection plan. Where significant trees were found on site



## Appendix 1: Background administrative information and data collection

	<b>Data collection</b>
	that were not included on the provided land survey, their approximate positions are illustrated as a brown dot on the tree protection plan.
<b>Crown spreads</b>	We used the crown spreads shown on the provided land survey.
<b>Recording of tree data</b>	For each identified arboricultural feature, the information collected was recorded on the tree schedule in Appendix 2 and the tree protection plan.
<b>Calculation of RPAs</b>	The RPAs were calculated as recommended in BS 5837, and the nominal RPA radius for each tree is listed in the tree schedule in Appendix 2. Where appropriate, RPAs for trees on the site were adjusted as recommended in BS 5837 and illustrated on the plan.

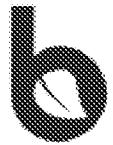

## Appendix 2: Tree schedule and explanatory notes

**NOTE:** Colour annotation is **A** & **B** trees with green background; **C** trees with blue background; trees to be removed in red text.

Tree No	Species	Height (m)	Diameter (cm) @ 1.5m	Maturity	Low Branches	Category	Notes	Tree Works	RPA radius (m)	RPA area (m <sup>2</sup> )
All retained trees & hedges								Carry out safety check and lift over site to 3-4m as necessary.		
T61	Oak	20	67.5	Mature	-	B	-	-	8.1	206
T62	Oak	20	105	Mature	-	A	Triple stem at base, located at edge of existing ditch	-	12.6	499
G63	Cypress	10	40	Maturing	-	C	Poor quality, screen value only	Fell selected part	4.8	72
T64	Oak	16	70	Mature	-	B	-	-	8.4	222
G65	Cypress, Western red cedar	12	40	Mature	-	C	Planted screen feature, areas of decline and poor-quality trees throughout	Fell	4.8	72
T66	Willow	18	115	Mature	-	B	Prominent on roadside, ivy clad which should be cleared to allow close inspection	-	13.8	598
T67	Oak	17	110	Mature	-	A	Prominent on roadside, ivy clad which should be cleared to allow close inspection	-	13.2	547
G68	Cypress	10	30	Maturing	-	C	Poor quality	Fell selected part	3.6	41
T69	Oak	14	60	Mature	-	C	Suppressed	-	7.2	163
T70	Ash	15	45	Maturing	-	C	Leaning	-	5.4	92
T71	Oak	15	22.5	Young	-	C	Draw up, etiolated canopy form	-	2.7	23
T72	Holm oak	15	50	Mature	-	B	-	-	6.0	113
T73	Oak	15	105	Mature	-	A	Recent pruning to lowest lateral limb that extends to the east	-	12.6	499

## Appendix 2: Tree schedule and explanatory notes

Tree No	Species	Height (m)	Diameter (cm) @ 1.5m	Maturity	Low Branches	Category	Notes	Tree Works	RPA radius (m)	RPA area (m <sup>2</sup> )
G74	Cypress	10	30	Maturing	-	C	Poor quality	Fell selected part	3.6	41
G75	Cypress	8	30	Maturing	-	C	Poor quality	Fell	3.6	41
G76	Oak	16	85	Mature	-	B	Slight sparse canopy, combined canopy form	-	10.2	327
G77	Hawthorn, willow, elm	7	30	Maturing	-	C	Hedgerow context group	-	3.6	41
T78	Willow	10	25	Maturing	-	C	Poor quality	-	3.0	28
H79	Hawthorn	5	22.5	Mature	-	C	Some areas of formal management	Fell selected part	2.7	23
G80	Oak, ash	16	80	Mature	-	B	-	-	9.6	290
G81	Oak, ash, willow	16	55	Maturing	-	B	Multi stem at base	-	6.6	137
G82	Oak	17	65	Mature	-	B	-	-	7.8	191

## Appendix 2: Tree schedule and explanatory notes

### Explanatory Notes

- **Abbreviations:**

G: Group  
H: Hedge  
T: Tree

- **Botanical tree names:**

Ash	: <i>Fraxinus excelsior</i>
Cypress	: <i>Cupressus</i> sp
Elm	: <i>Ulmus</i> sp
Hawthorn	: <i>Crataegus monogyna</i>
Holm oak	: <i>Quercus ilex</i>
Oak	: <i>Quercus robur</i>
Western red cedar	: <i>Thuja plicata</i>
Willow	: <i>Salix</i> sp

- **BS 5837 (2012) compliance:** All data has been collected based on the recommendations set out in subsection 4.4 of BS 5837.

- **Tree checks and site limitations:** Each tree was subjected to a quick visual check level of inspection. Where there is restricted access to the base of a tree, its attributes are assessed from the nearest point of access. Climbing inspections are not carried out during this level of inspection and, if heavy ivy is present, tree condition is assessed from what can be seen from the ground. A separate note is recorded if further investigation may be required to clarify its status.

- **Crown spreads:** We used the crown spreads shown on the provided land survey.

- **Dimensions:** All dimensions are estimated unless otherwise indicated with an asterisk (\*) after the figure.

- **Species:** Species identification is based on visual observations. Where there is some doubt over tree identity, sp is noted after the genus name to indicate that the species cannot be reliably identified at the time of the survey. Where there is more than one species in a group, only the most frequent are noted and not all the species present may be listed.

- **Height:** Height is estimated to provide a broad indication of the size of the tree.

- **Trunk diameter:** Trunk diameter is estimated or measured (with a diameter tape), at the discretion of the consultant. Estimates may be made where access is restricted, direct measurement is prevented because of ivy on the trunk, or the tree is assessed as low quality. The point of measurement and the adjustments for stem variations are as advised in Figure C1 of BS 5837. Individual diameters for multiple stems are recorded in the notes, with the calculated cumulative diameter recorded in the diameter column.

- **Maturity:** In planning context, maturity provides a simplistic indication of a tree's ability to cope with change and its potential for further growth. For the purposes of this report, young indicates a potential to significantly increase in size and a high ability to cope with change, maturing indicates some potential to increase in size and a medium ability to cope with change, and mature indicates little potential to increase in size and limited ability to cope with change.

- **Low branches:** Any low branches that would not be feasible for removal during normal management and should be considered as a design constraint are noted here and explained in the notes.

- **Category:** Our assessment automatically considered tree physiological/structural condition (BS 5837, 4.4.2.5h), and so these are not listed separately in the schedule. Additionally, the category accounts for the remaining contribution (BS 5837, 4.4.2.5i) as greater than 40 years for A trees, greater than 20 years for B trees, at least 10 years for C trees and less than 10 years for U trees, so this is also not listed separately in the schedule. Category A, B and C trees are automatically listed as sub-category 1 unless otherwise stated.

- **Notes:** Only relevant features relating to physiological or structural condition and low branches that may help clarify the categorisation are recorded. If there are no notes, then the presumption should be that no relevant features were observed.

- **Tree works:** The recommended tree works are based on the quick visual check level of inspection and only intended to address significant hazards identified during that inspection. The following points should also be considered before carrying out any works:

1. **Reporting during work operations:** In the context of the preliminary nature of the tree inspection, any defects that may affect tree safety discovered by the contractor when carrying out the work recommendations should



## Appendix 2: Tree schedule and explanatory notes

---

be reported to the supervising officer. Modification to the schedule of works may be required because of these reports. The contractor should be specifically instructed on this point.

- 2. **Implementation of works:** All tree works should be carried out to BS 3998 *Recommendations for Tree Work* as modified by more recent research. It is advisable to select a contractor from the local authority list and preferably one approved by the Arboricultural Association. Their Register of Contractors is available free from The Malthouse, Stroud Green, Standish, Stonehouse, Gloucestershire GL10 3DL; phone 01242 522152; website [www.trees.org.uk](http://www.trees.org.uk).
- 3. **Statutory wildlife obligations:** The Wildlife and Countryside Act 1981 as amended by the Countryside and Rights of Way Act 2000 provides statutory protection to birds, bats and other species that inhabit trees. All tree work operations are covered by these provisions and advice from an ecologist must be obtained before undertaking any works that might constitute an offence.
- 4. **Stumps:** Stumps to be removed within the RPAs of retained trees should be ground out with a stump grinder to minimise any disturbance unless otherwise authorised by the supervising officer.
- **RPAs:** The RPAs were calculated as recommended in BS 5837, and the nominal RPA radius for each tree listed, irrespective of any modifying factors. Where appropriate, RPAs for trees on the site may have been adjusted as recommended in BS 5837 and illustrated on the plan.
- **Future tree safety inspections:** Due to the time that may elapse between the original survey and the start of development, all trees should be re-inspected as part of the standard risk management process before any works start on site. Our assessment of the trees was carried out on the basis that a re-inspection would be carried out within a year of the assessment visit and our advice on tree condition must be reviewed annually from the date of that visit.



### Appendix 3: QR Codes for SGNs (Scan with reader to download)

<b>SGN 1 Monitoring tree protection</b>	<b>SGN 2 Fencing protected trees</b>	<b>SGN 3 Ground protection</b>
<b>SGN 4 Pollution control</b>	<b>SGN 5 Site cranes &amp; piling rigs</b>	<b>SGN 6 Height restrictions</b>
<b>SGN 7 Excavating in RPAs</b>	<b>SGN 8 Removing surfacing and structures in RPAs</b>	<b>SGN 9 Installing/upgrading surfacing in RPAs</b>
<b>SGN 10 Installing structures in RPAs</b>	<b>SGN 11 Installing services in RPAs</b>	<b>SGN 12 Landscaping in RPAs</b>

