


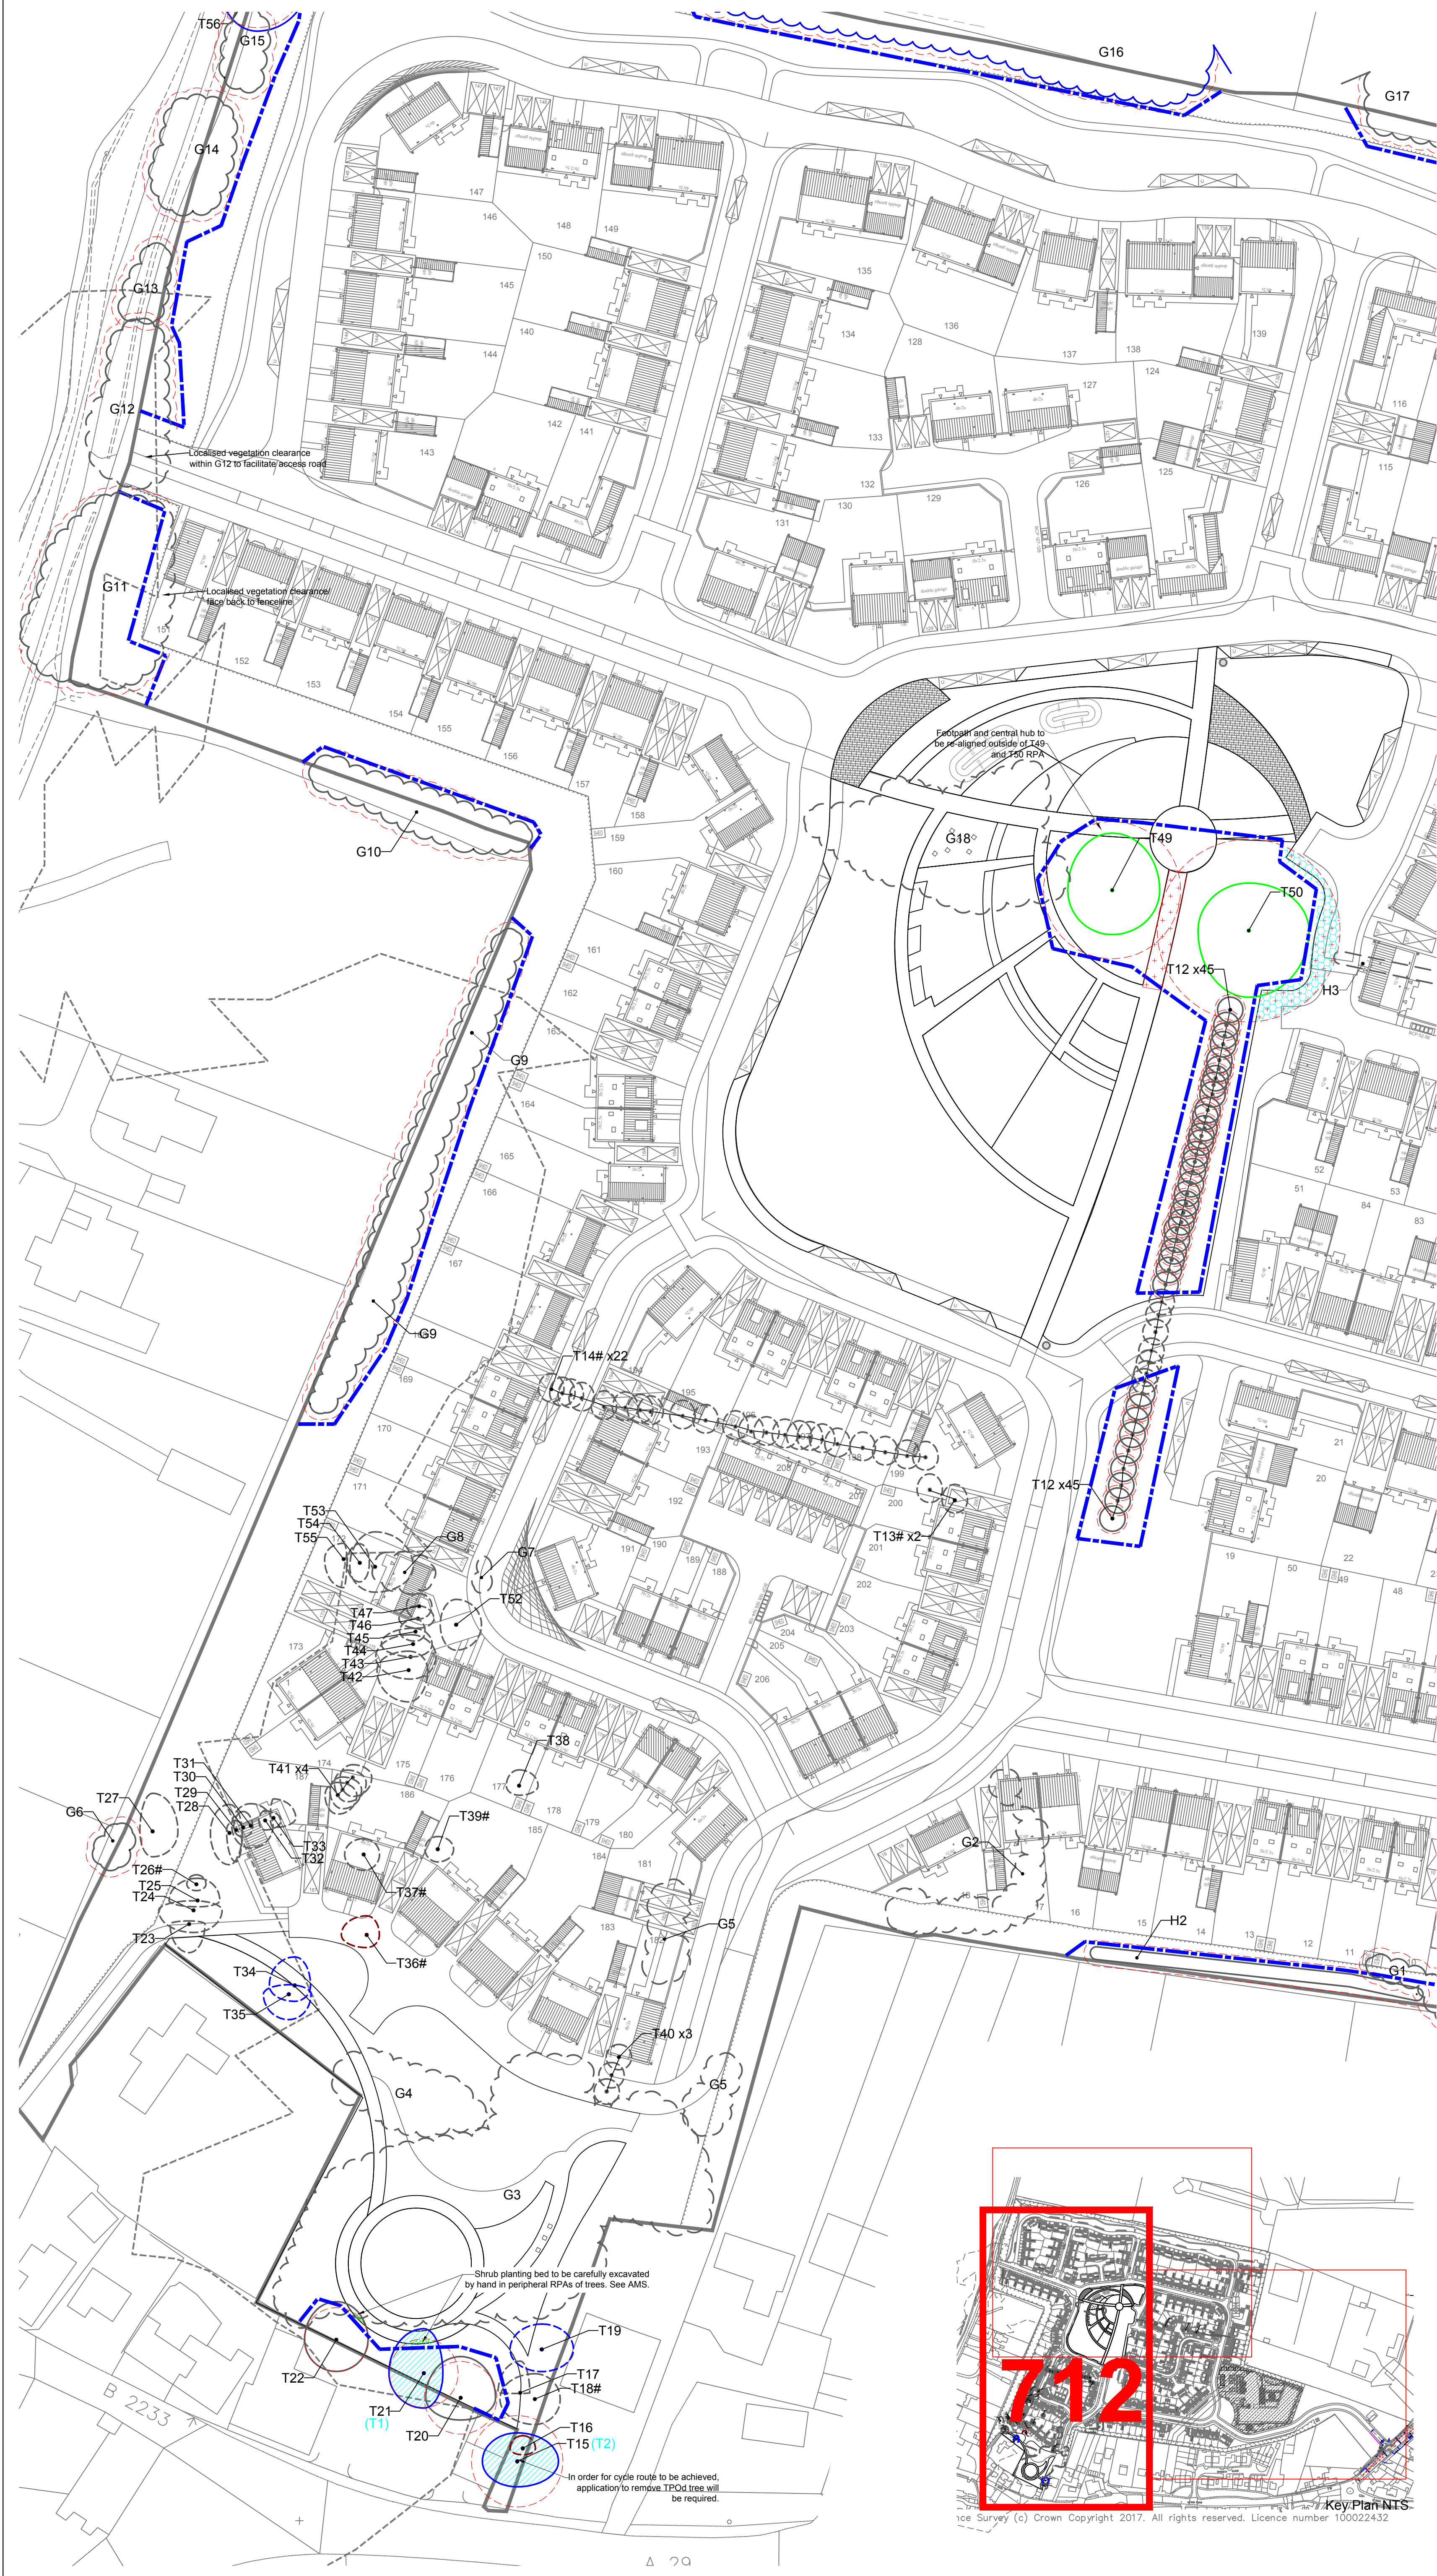

© 2017 RPS Group

Notes

- This drawing has been prepared in accordance with the scope of RPS's appointment with its client and is subject to the terms and conditions of that appointment. RPS accepts no liability for any use of this document other than by its client and only for the purposes for which it was prepared and provided.
- If received electronically it is the recipient's responsibility to print to correct scale. Only written dimensions should be used.
- Where applicable Ordnance Survey (c) Crown Copyright 2017. All rights reserved. Licence number 0100031673

Key

Survey boundary.

Tree with numbered reference. Canopy spread and BS5837:2012 tree quality category as shown below.

Tree (in off-site or estimated location) with numbered reference. Canopy spread and BS5837:2012 tree quality category.

Vegetation group with numbered reference. Canopy extent and BS5837:2012 tree quality category as shown below.

Hedge with numbered reference. Width and BS5837:2012 tree quality category as shown below.

BS 5837:2012 Tree Quality Categories - Table 1

Category	Quality
Category A	High quality
Category B	Moderate quality
Category C	Low quality
Category U	Unsuitable for retention

Tree protected by Tree Preservation Order. No.xxx, xx xxx. Bracketed number relates to the TPO Schedule.

Root protection area (RPA). Calculated in accordance with Section 4.6 - BS5837:2012

Tree to be removed with numbered reference. Canopy spread and BS5837:2012 tree quality category.

Vegetation group or hedge to be removed with numbered reference. Canopy spread and BS5837:2012 tree quality category.

Temporary protective fencing in accordance with Section 6.2 - BS5837:2012. See inset details for example barriers.

Above ground construction requiring "no-dig" design principles in accordance with APN12.

Excavation to be completed by hand, any required root pruning to be in accordance with BS 3998. Pruning of roots over 25mmØ to be monitored by arboriculturalist, with ongoing monitoring of trees condition by an arboriculturalist being recommended.

Surface area to be protected in accordance with Section 6.2.3 BS - 5837:2012. To be removed in sections in a retreating manner away from the retained tree as no-dig surfacing is installed.

NOTES:

- Refer to RPS Tree Survey Report & Schedule for further details.
- Survey based on a visual inspection from the ground and is not intended as a full arboricultural inspection.
- Plan produced in accordance with recommendations set out in BS 5837:2012, "Trees in Relation to design, demolition and construction".
- Due to the legal protection afforded to breeding birds vegetation removal should not take place during the bird nesting period, generally, although not restricted to, March - August inclusive.
- Survey based upon topographic survey produced by Wilmas Geomatics Ltd in Shrewsbury, October 2012.
- Pedestrian/vehicular emergency access routes to be maintained at all times.
- All protective fencing to be completed and approved by LPA / CA prior to commencement of any site works.
- All works to conform with requirements of BS 3998:2010 - Tree Works BS 5837:2012 - Trees in relation to design, demolition and construction

Figure 2 Default specification for protective barrier

DETAIL A Tree protection barrier (Not to scale)

Figure 3 Examples of above-ground stabilizing systems

DETAIL B Tree protection barrier (Not to scale)

Scale Bar

0m 25m 50m

Rev	Description	Date	Initial	Checked
A	Revised to latest layout	Aug 17	JL	CP

Lakesbury House, Hittingbury Road, Chandlers Ford, Hampshire. SO53 5SS
T: 02380 810 440 E: rpsso@rpsgroup.com F: 02380 810 449

Client **Taylor Wimpey Southern Counties**

Project **Land at Nyton Nurseries Westergate**

Title **Tree Protection and Removal Plan Sheet 2 of 3**

Status	Drawn By	PM/Checked by
For Planning	JBI/JMB	CC
Job Ref	Scale @ A1	Date Created
JSL2869	1:500	07/07/2017
Drawing Number	Rev	
712	A	

rpsgroup.com/uk