



## Civil Engineering – Groundworks

|                             |                                                                                              |
|-----------------------------|----------------------------------------------------------------------------------------------|
| <b>Project Name:</b>        | Miller Homes, Level Mare Lane, Eastergate, PO20 3RX. – Phase 2 SUDS verification report ADC. |
| <b>Project Date:</b>        | 01/07/2024                                                                                   |
| <b>Inspection Standard:</b> | MSCC5 Sewers & Drainage GB (SRM5 Scoring)                                                    |

| Table of Contents                                   |                |              |
|-----------------------------------------------------|----------------|--------------|
| Project name                                        | Project number | Project Date |
| Miller Homes, Level Mare Lane, Eastergate, PO20 3RX |                | 01/07/2024   |
| - Project Information.....                          |                | 3            |
| - Section Profile.....                              |                | 4            |
| - Section Item 1: PSCP203>SA64-65 .....             |                | 5            |
| - Section Item 2: PSCP206>SA64-65 .....             |                | 7            |
| - Section Item 3: PSCP213>SA66-67 .....             |                | 9            |
| - Section Item 4: PSCP217>SA50 .....                |                | 11           |
| - Section Item 5: PS216>PSCP217 .....               |                | 13           |
| - Section Item 6: PS221>PSCP220 .....               |                | 15           |
| - Section Item 7: PS202>PSCP203 .....               |                | 17           |
| - Section Item 8: PS251>PSCP206 .....               |                | 19           |
| - Section Item 9: PS212>PSCP213 .....               |                | 21           |
| - Section Item 10: PS209>PSCP210 .....              |                | 23           |
| - Section Item 11: PSCP210>SA66-67 .....            |                | 25           |
| - Section Item 12: PS344>PS342 .....                |                | 27           |
| - Section Item 13: PS5281>PSCP61 .....              |                | 29           |
| - Section Item 14: PS54>PSCP220 .....               |                | 31           |
| - Section Item 15: PS61>SA57-65 .....               |                | 33           |
| - Section Item 16: PS220>SA53-55 .....              |                | 35           |

| Project Information                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                        |                |            |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------------|------------|
| Project Name                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                               | Project Number | Date       |
| Miller Homes, Level Mare Lane, Eastergate, PO20 3RX.                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                                       |                | 01/07/2024 |
| <p><b>Client:</b></p> <p>Miller Homes Southern<br/>Rankine Road<br/>Basingstoke<br/>RG24 8QB</p>  <p><b>Site:</b></p> <p>Level Mare Lane<br/>Eastergate<br/>PO20 3RX</p> <p><b>Contractor:</b></p> <p>Byron Thomas<br/>Hi-Acre Construction Ltd<br/>97 Leigh Road<br/>Eastleigh<br/>Hampshire<br/>SO50 9DR<br/><a href="mailto:accounts@hi-acreconstructionltd.com">accounts@hi-acreconstructionltd.com</a><br/>02381 781 511</p>  |                |            |


| Section Profile                                                                          |               |                 |                   |                 |                            |                  |              |
|------------------------------------------------------------------------------------------|---------------|-----------------|-------------------|-----------------|----------------------------|------------------|--------------|
| Project Name<br>Miller Homes, Level Mare Lane, Eastergate,<br>PO20 3RX                   |               |                 | Project<br>Number |                 | Project Date<br>01/07/2024 |                  |              |
| Circular 100mm                                                                           |               |                 |                   |                 |                            |                  |              |
| Item No.                                                                                 | Upstream Node | Downstream Node | Date              | Road            | Material                   | Inspected Length | Total Length |
| 1                                                                                        | PSCP203       | SA 64-65        | 23/09/2023        | Level Mare Lane | Plastic                    | 4.7m             | 4.7m         |
| 2                                                                                        | PSCP206       | SA 64-65        | 23/09/2023        | Level Mare Lane | Plastic                    | 3.7m             | 3.7m         |
| 3                                                                                        | PSCP213       | SA 66-67        | 23/09/2023        | Level Mare Lane | Plastic                    | 2.97m            | 2.97m        |
| 4                                                                                        | PSCP217       | SA 50           | 23/09/2023        | Level Mare Lane | Plastic                    | 3.55m            | 3.55m        |
| 5                                                                                        | PS216         | PSCP217         | 06/03/2025        | Level Mare Lane | Plastic                    | 3.5m             | 5.5m         |
| 6                                                                                        | PS221         | PSCP220         | 06/03/2025        | Level Mare Lane | Plastic                    | 4.4m             | 8.4m         |
| 7                                                                                        | PS202         | PSCP203         | 06/03/2025        | Level Mare Lane | Plastic                    | 6m               | 6m           |
| 8                                                                                        | PS251         | PSCP206         | 06/03/2025        | Level Mare Lane | Plastic                    | 5m               | 5m           |
| 9                                                                                        | PS212         | PSCP213         | 06/03/2025        | Level Mare Lane | Plastic                    | 5.2m             | 4.7m         |
| 10                                                                                       | PS209         | PSCP210         | 06/03/2025        | Level Mare Lane | Plastic                    | 4.4m             | 4.9m         |
| 11                                                                                       | PSCP210       | SA66-67         | 06/03/2025        | Level Mare Lane | Plastic                    | 1.5m             | 1.5m         |
| 12                                                                                       | PS344         | PS342           | 06/03/2025        | Level Mare Lane | Plastic                    | 14.7m            | 14.7m        |
| 13                                                                                       | PS5281        | PS61            | 24/09/2025        | Level Mare Lane | Plastic                    | 9.9m             | 12.5m        |
| 14                                                                                       | PS54          | PSCP220         | 24/09/2025        | Level Mare Lane | Plastic                    | 8.9m             | 8.9m         |
| 15                                                                                       | PS61          | SA57-65         | 24/09/2025        | Level Mare Lane | Plastic                    | 0.9m             | 1.6m         |
| 16                                                                                       | PS220         | SA53-55         | 24/09/2025        | Level Mare Lane | Plastic                    | 1.4m             | 0.4m         |
|                                                                                          |               |                 |                   |                 |                            |                  |              |
| Total: 16 inspections x circular 100mm = 80.72m inspected length and 89.02m total length |               |                 |                   |                 |                            |                  |              |

**Total: 16 inspections = 80.72m total length and 89.02m inspected length.**

## Section inspection – 12/09/2023 – PSCP203

| Item No.                                                                                                                                                                                                  | Insp No. | Date                                                                                                               | Time                                                                                                                                                      | Weather                                                                                                                                     | PLR     |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|--------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------|---------|
| 1                                                                                                                                                                                                         | 1        | 12/09/2023                                                                                                         | 15:12                                                                                                                                                     | Dry                                                                                                                                         | PSCP203 |
| Operator                                                                                                                                                                                                  | Vehicle  | Camera                                                                                                             | Preset length                                                                                                                                             | Legal Status                                                                                                                                |         |
| Chris Blogg                                                                                                                                                                                               | N/a      | Protues                                                                                                            | Not Specified                                                                                                                                             | Private Drain                                                                                                                               |         |
| <b>Town:</b> Eastergate<br><b>Road:</b> Level Mare Lane<br><b>Location:</b><br><b>Surface type:</b>                                                                                                       |          | <b>Insp Direction:</b> Downstream<br><b>Insp length:</b> 4.7m<br><b>Total length:</b> 4.7m<br><b>Joint length:</b> |                                                                                                                                                           | <b>Upstream node:</b> PSCP203<br><b>Upstream pipe depth:</b> 0.8m<br><b>Downstream node:</b> SA 64-65<br><b>Downstream pipe depth:</b> 0.9m |         |
| <b>Use:</b> Surface water<br><b>Type of pipe:</b> Gravity drain/sewer<br><b>Flow control:</b> No flow control<br><b>Year Constructed:</b> Not specified<br><b>Inspection Purposes:</b> Routine Inspection |          |                                                                                                                    | <b>Pipe Shape:</b> Circular<br><b>Dia/Height:</b> 100mm<br><b>Material:</b> Plastic<br><b>Lining Type:</b> No Lining<br><b>Lining Material:</b> No lining |                                                                                                                                             |         |

**PSCP203**    **Position(M)**    **Code**    **Observation**    **MPEG**    **photo**

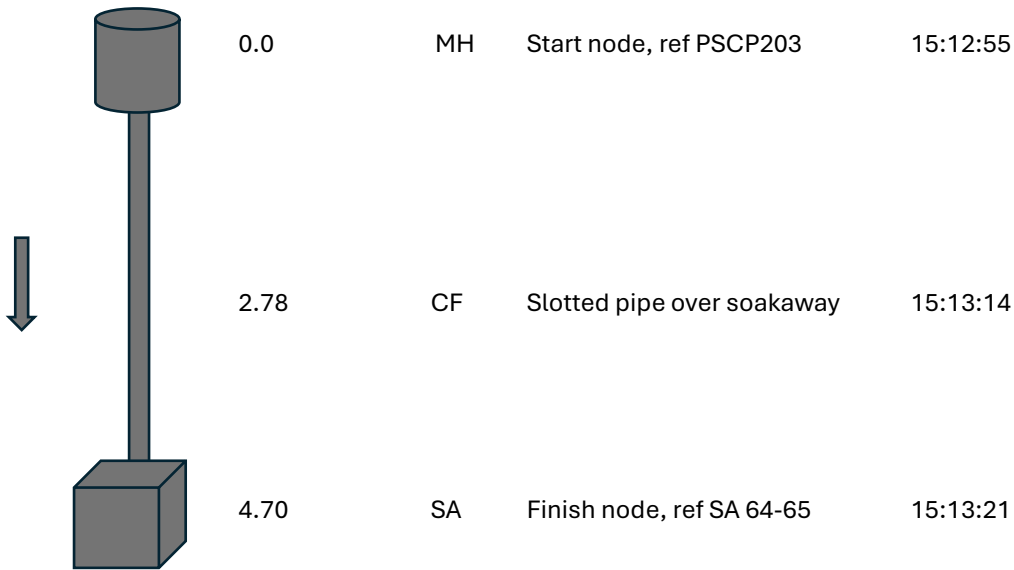


**SA64-65**

| Construction Features |          |          |           |           | Miscellaneous Features             |          |          |           |           |
|-----------------------|----------|----------|-----------|-----------|------------------------------------|----------|----------|-----------|-----------|
| Structural Features   |          |          |           |           | Service & Operational Observations |          |          |           |           |
| STR No. Def           | STR Peak | STR Mean | STR Total | STR Grade | SER No. Def                        | SER Peak | SER Mean | SER Total | SER Grade |
| 1                     | 1        | 1        | 1         | 2         | 0                                  | 0        | 0        | 0         | 1         |

## Section Pictures – 12/09/2023 – PSCP203

| Item No. | Inspection Direction | PLR     | Clients Ref | Contractors Ref |
|----------|----------------------|---------|-------------|-----------------|
| 1        | Downstream           | P5CP203 |             |                 |

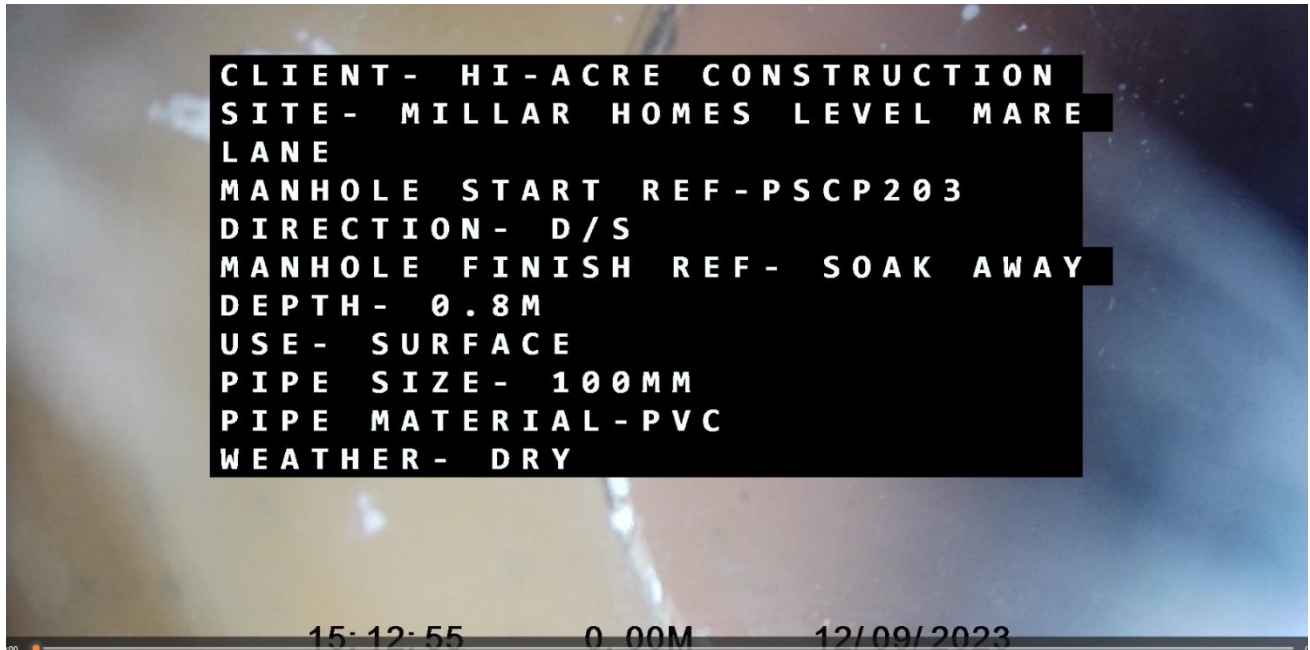

Start node, manhole, reference: PSCP203




Finish node, soakaway, reference: SA64-65

## Section inspection – 12/09/2023 – PSCP206

| Item No.                                                                                                                                                                                                  | Insp No. | Date                                                                                                               | Time                                                                                                                                                      | Weather                                                                                                                                     | PLR     |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|--------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------------------------------------|---------|
| 2                                                                                                                                                                                                         | 1        | 12/09/2023                                                                                                         | 15:15                                                                                                                                                     | Dry                                                                                                                                         | PSCP206 |
| Operator                                                                                                                                                                                                  | Vehicle  | Camera                                                                                                             | Preset length                                                                                                                                             | Legal Status                                                                                                                                |         |
| Chris Blogg                                                                                                                                                                                               | N/a      | Protues                                                                                                            | Not Specified                                                                                                                                             | Private Drain                                                                                                                               |         |
| <b>Town:</b> Eastergate<br><b>Road:</b> Level Mare Lane<br><b>Location:</b><br><b>Surface type:</b>                                                                                                       |          | <b>Insp Direction:</b> Downstream<br><b>Insp length:</b> 3.7m<br><b>Total length:</b> 3.7m<br><b>Joint length:</b> |                                                                                                                                                           | <b>Upstream node:</b> PSCP206<br><b>Upstream pipe depth:</b> 0.8m<br><b>Downstream node:</b> SA 64-65<br><b>Downstream pipe depth:</b> 0.9m |         |
| <b>Use:</b> Surface water<br><b>Type of pipe:</b> Gravity drain/sewer<br><b>Flow control:</b> No flow control<br><b>Year Constructed:</b> Not specified<br><b>Inspection Purposes:</b> Routine Inspection |          |                                                                                                                    | <b>Pipe Shape:</b> Circular<br><b>Dia/Height:</b> 100mm<br><b>Material:</b> Plastic<br><b>Lining Type:</b> No Lining<br><b>Lining Material:</b> No lining |                                                                                                                                             |         |

**PSCP206**    **Position(M)**    **Code**    **Observation**    **MPEG**    **photo**

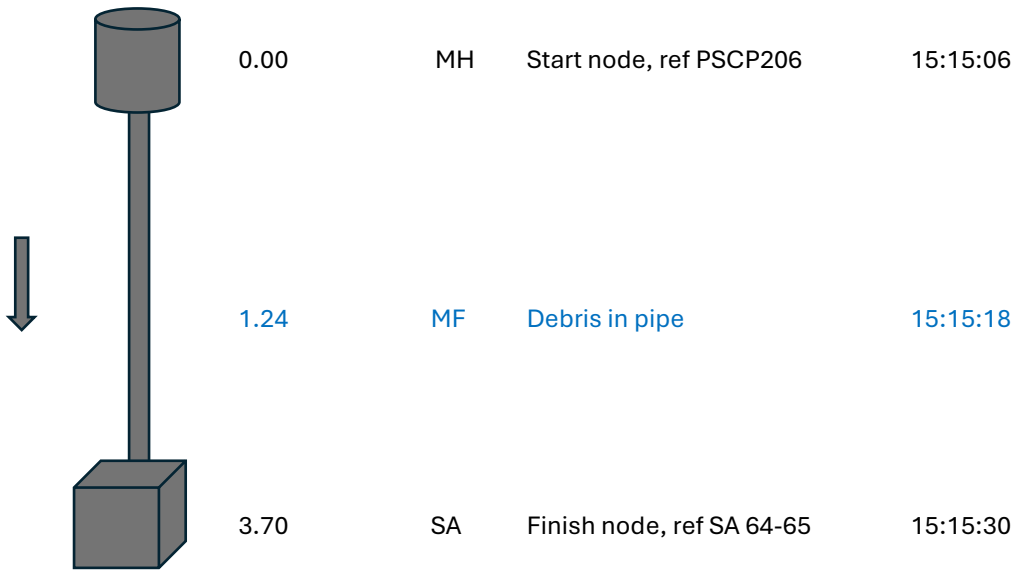


**SA64-65**

| Construction Features |          |          |           |           | Miscellaneous Features             |          |          |           |           |
|-----------------------|----------|----------|-----------|-----------|------------------------------------|----------|----------|-----------|-----------|
| Structural Features   |          |          |           |           | Service & Operational Observations |          |          |           |           |
| STR No. Def           | STR Peak | STR Mean | STR Total | STR Grade | SER No. Def                        | SER Peak | SER Mean | SER Total | SER Grade |
| 0                     | 0        | 0        | 0         | 1         | 1                                  | 1        | 1        | 1         | 2         |

## Section Pictures – 12/09/2023 – PSCP206

| Item No. | Inspection Direction | PLR     | Clients Ref | Contractors Ref |
|----------|----------------------|---------|-------------|-----------------|
| 2        | Downstream           | PSCP206 |             |                 |

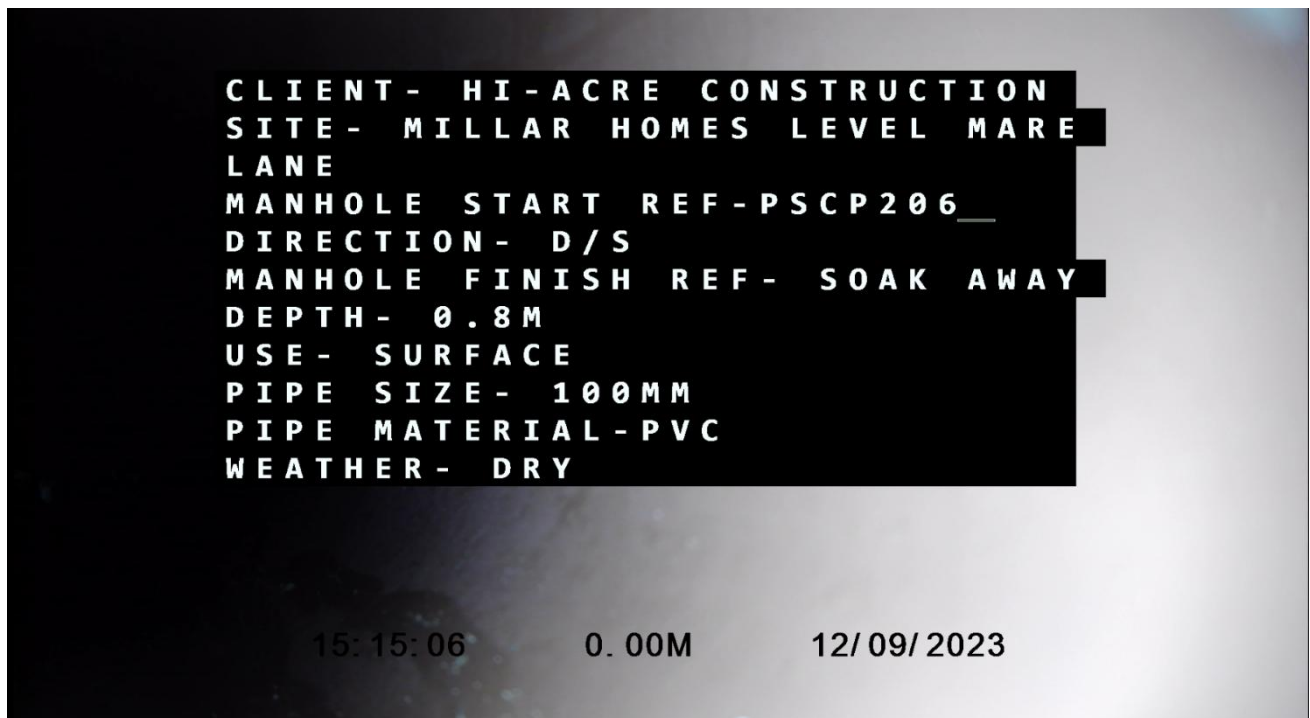

Start node, manhole, reference: PSCP206




Finish node, soakaway, reference: SA64-65

## Section inspection – 12/09/2023 – PSCP213

| Item No.                                                                                                                                                               | Insp No. | Date                                                                                     | Time                                                                                                                   | Weather                                                                                                         | PLR     |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------|---------|
| 3                                                                                                                                                                      | 1        | 12/09/2023                                                                               | 15:18                                                                                                                  | Dry                                                                                                             | PSCP213 |
| Operator                                                                                                                                                               | Vehicle  | Camera                                                                                   | Preset length                                                                                                          | Legal Status                                                                                                    |         |
| Chris Blogg                                                                                                                                                            | N/a      | Protues                                                                                  | Not Specified                                                                                                          | Private Drain                                                                                                   |         |
| Town: Eastergate<br>Road: Level Mare Lane<br>Location:<br>Surface type:                                                                                                |          | Insp Direction: Downstream<br>Insp length: 2.97m<br>Total length: 2.97m<br>Joint length: |                                                                                                                        | Upstream node: PSCP213<br>Upstream pipe depth: 0.8m<br>Downstream node: SA 66-67<br>Downstream pipe depth: 0.9m |         |
| Use: Surface water<br>Type of pipe: Gravity drain/sewer<br>Flow control: No flow control<br>Year Constructed: Not specified<br>Inspection Purposes: Routine Inspection |          |                                                                                          | Pipe Shape: Circular<br>Dia/Height: 100mm<br>Material: Plastic<br>Lining Type: No Lining<br>Lining Material: No lining |                                                                                                                 |         |

**PSCP213**   **Position(M)**   **Code**   **Observation**   **MPEG**   **photo**

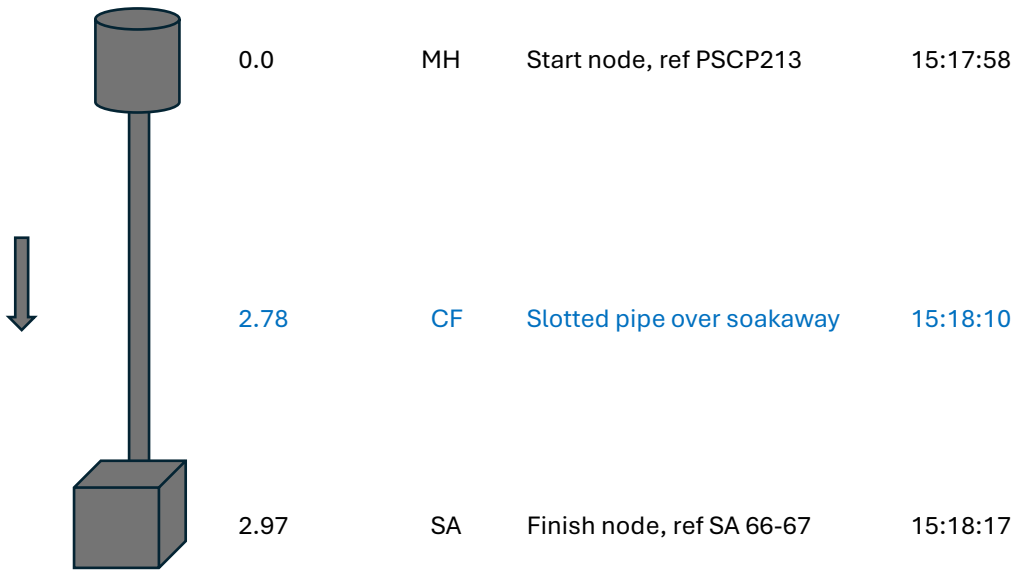


**SA66-67**

| Construction Features |          |          |           |           | Miscellaneous Features             |          |          |           |           |
|-----------------------|----------|----------|-----------|-----------|------------------------------------|----------|----------|-----------|-----------|
| Structural Features   |          |          |           |           | Service & Operational Observations |          |          |           |           |
| STR No. Def           | STR Peak | STR Mean | STR Total | STR Grade | SER No. Def                        | SER Peak | SER Mean | SER Total | SER Grade |
| 0                     | 0        | 0        | 0         | 1         | 0                                  | 0        | 0        | 0         | 1         |

## Section Pictures – 12/09/2023 – PSCP213

| Item No. | Inspection Direction | PLR    | Clients Ref | Contractors Ref |
|----------|----------------------|--------|-------------|-----------------|
| 3        | Downstream           | SCP213 |             |                 |

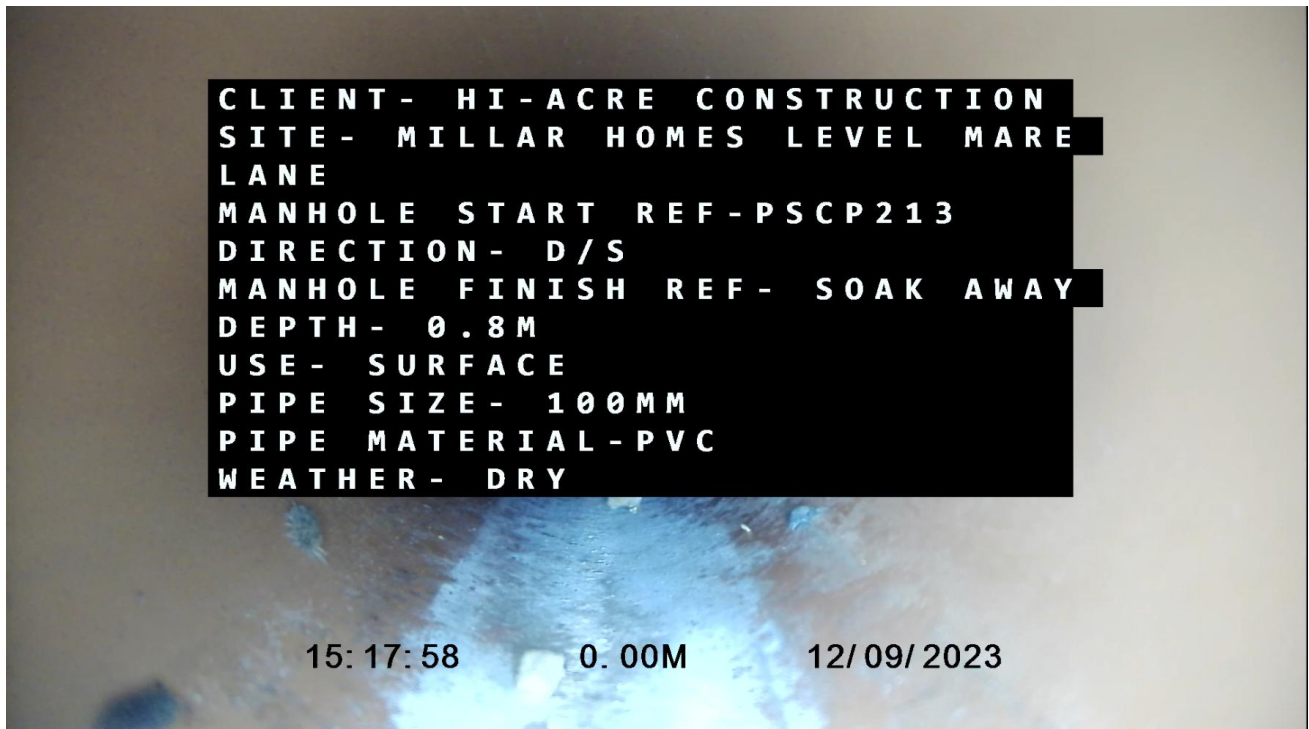

Start node, manhole, reference: PSCP206




Finish node, soakaway, reference: SA66-67

## Section inspection – 12/09/2023 – PSCP217

| Item No.                                                                                                                                                                                                  | Insp No. | Date                                                                                                                 | Time                                                                                                                                                      | Weather                                                                                                                                  | PLR     |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|----------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------|---------|
| 4                                                                                                                                                                                                         | 1        | 12/09/2023                                                                                                           | 15:20                                                                                                                                                     | Dry                                                                                                                                      | PSCP217 |
| Operator                                                                                                                                                                                                  | Vehicle  | Camera                                                                                                               | Preset length                                                                                                                                             | Legal Status                                                                                                                             |         |
| Chris Blogg                                                                                                                                                                                               | N/a      | Protues                                                                                                              | Not Specified                                                                                                                                             | Private Drain                                                                                                                            |         |
| <b>Town:</b> Eastergate<br><b>Road:</b> Level Mare Lane<br><b>Location:</b><br><b>Surface type:</b>                                                                                                       |          | <b>Insp Direction:</b> Downstream<br><b>Insp length:</b> 3.55m<br><b>Total length:</b> 3.55m<br><b>Joint length:</b> |                                                                                                                                                           | <b>Upstream node:</b> PSCP217<br><b>Upstream pipe depth:</b> 0.8m<br><b>Downstream node:</b> SA 50<br><b>Downstream pipe depth:</b> 0.9m |         |
| <b>Use:</b> Surface water<br><b>Type of pipe:</b> Gravity drain/sewer<br><b>Flow control:</b> No flow control<br><b>Year Constructed:</b> Not specified<br><b>Inspection Purposes:</b> Routine Inspection |          |                                                                                                                      | <b>Pipe Shape:</b> Circular<br><b>Dia/Height:</b> 100mm<br><b>Material:</b> Plastic<br><b>Lining Type:</b> No Lining<br><b>Lining Material:</b> No lining |                                                                                                                                          |         |

**PSCP217**    **Position(M)**    **Code**    **Observation**    **MPEG**    **photo**

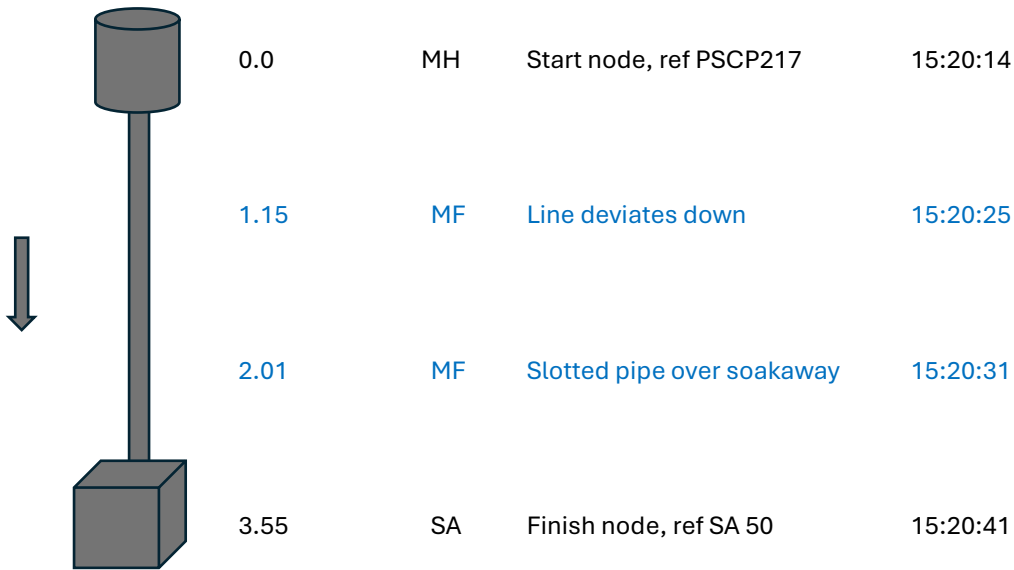


**SA50**

| Construction Features |          |          |           |           | Miscellaneous Features             |          |          |           |           |
|-----------------------|----------|----------|-----------|-----------|------------------------------------|----------|----------|-----------|-----------|
| Structural Features   |          |          |           |           | Service & Operational Observations |          |          |           |           |
| STR No. Def           | STR Peak | STR Mean | STR Total | STR Grade | SER No. Def                        | SER Peak | SER Mean | SER Total | SER Grade |
| 0                     | 0        | 0        | 0         | 1         | 0                                  | 0        | 0        | 0         | 1         |

## Section Pictures – 12/09/2023 – PSCP217

| Item No. | Inspection Direction | PLR     | Clients Ref | Contractors Ref |
|----------|----------------------|---------|-------------|-----------------|
| 4        | Downstream           | PSCP217 |             |                 |

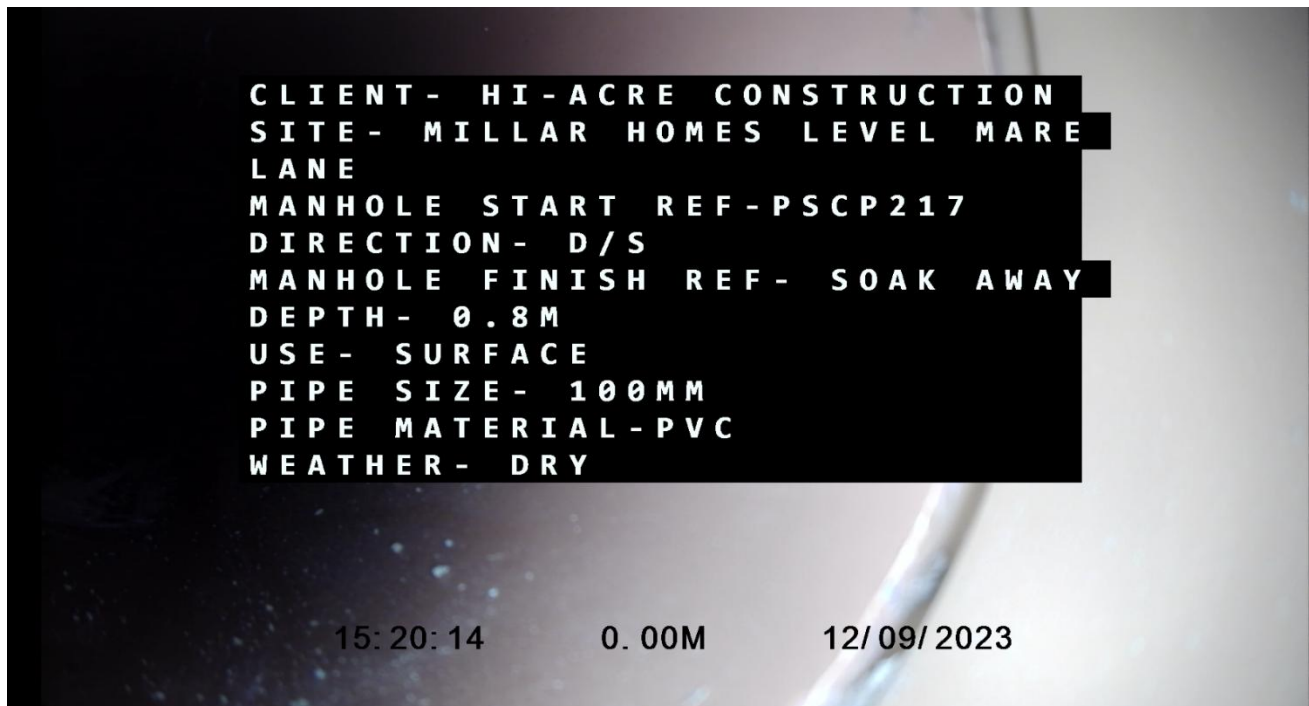

Start node, manhole, reference: PSCP206



Finish node, soakaway, reference: SA50

## Section inspection – 06/03/2025 – PS216

| Item No.                                                                                                                                                                                                  | Insp No. | Date                                                                                                               | Time                                                                                                                                                      | Weather                                                                                                                                  | PLR   |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|--------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------|-------|
| 5                                                                                                                                                                                                         | 1        | 06/03/2025                                                                                                         | 10:45                                                                                                                                                     | Dry                                                                                                                                      | PS216 |
| Operator                                                                                                                                                                                                  | Vehicle  | Camera                                                                                                             | Preset length                                                                                                                                             | Legal Status                                                                                                                             |       |
| Dan Hurrell                                                                                                                                                                                               | N/a      | N/a                                                                                                                | Not Specified                                                                                                                                             | Private Drain                                                                                                                            |       |
| <b>Town:</b> Eastergate<br><b>Road:</b> Level Mare Lane<br><b>Location:</b><br><b>Surface type:</b>                                                                                                       |          | <b>Insp Direction:</b> Downstream<br><b>Insp length:</b> 3.5m<br><b>Total length:</b> 3.5m<br><b>Joint length:</b> |                                                                                                                                                           | <b>Upstream node:</b> PS216<br><b>Upstream pipe depth:</b> 0.5m<br><b>Downstream node:</b> PSCP217<br><b>Downstream pipe depth:</b> 0.7m |       |
| <b>Use:</b> Surface water<br><b>Type of pipe:</b> Gravity drain/sewer<br><b>Flow control:</b> No flow control<br><b>Year Constructed:</b> Not specified<br><b>Inspection Purposes:</b> Routine Inspection |          |                                                                                                                    | <b>Pipe Shape:</b> Circular<br><b>Dia/Height:</b> 100mm<br><b>Material:</b> Plastic<br><b>Lining Type:</b> No Lining<br><b>Lining Material:</b> No lining |                                                                                                                                          |       |

**PS216**


**Position(M)**

**Code**

**Observation**

**MPEG**

**photo**

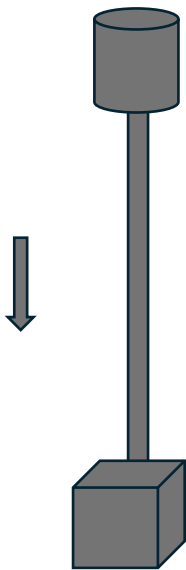

0.0

MH

Start node, ref PS216

10:45:12

3.5

MH

Finish node, ref PSCP217

10:45:39

**PSCP217**

| Construction Features |          |          |           |           | Miscellaneous Features             |          |          |           |           |
|-----------------------|----------|----------|-----------|-----------|------------------------------------|----------|----------|-----------|-----------|
| Structural Features   |          |          |           |           | Service & Operational Observations |          |          |           |           |
| STR No. Def           | STR Peak | STR Mean | STR Total | STR Grade | SER No. Def                        | SER Peak | SER Mean | SER Total | SER Grade |
| 0                     | 0        | 0        | 0         | 1         | 0                                  | 0        | 0        | 0         | 1         |

## Section Pictures – 06/03/2025 – PS216

| Item No. | Inspection Direction | PLR   | Clients Ref | Contractors Ref |
|----------|----------------------|-------|-------------|-----------------|
| 5        | Downstream           | PS216 |             |                 |



Start node, manhole, reference: PS216



Finish node, manhole, reference: PSCP217

## Section inspection – 06/03/2025 – PS221

| Item No.                                                                                                                                                                                                  | Insp No. | Date                                                                                                               | Time                                                                                                                                                      | Weather                                                                                                                                  | PLR   |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|--------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------|-------|
| 6                                                                                                                                                                                                         | 1        | 06/03/2025                                                                                                         | 11:44                                                                                                                                                     | Dry                                                                                                                                      | PS221 |
| Operator                                                                                                                                                                                                  | Vehicle  | Camera                                                                                                             | Preset length                                                                                                                                             | Legal Status                                                                                                                             |       |
| Dan Hurrell                                                                                                                                                                                               | N/a      | N/a                                                                                                                | Not Specified                                                                                                                                             | Private Drain                                                                                                                            |       |
| <b>Town:</b> Eastergate<br><b>Road:</b> Level Mare Lane<br><b>Location:</b><br><b>Surface type:</b>                                                                                                       |          | <b>Insp Direction:</b> Downstream<br><b>Insp length:</b> 4.4m<br><b>Total length:</b> 8.8m<br><b>Joint length:</b> |                                                                                                                                                           | <b>Upstream node:</b> PS221<br><b>Upstream pipe depth:</b> 0.7m<br><b>Downstream node:</b> PSCP220<br><b>Downstream pipe depth:</b> 0.9m |       |
| <b>Use:</b> Surface water<br><b>Type of pipe:</b> Gravity drain/sewer<br><b>Flow control:</b> No flow control<br><b>Year Constructed:</b> Not specified<br><b>Inspection Purposes:</b> Routine Inspection |          |                                                                                                                    | <b>Pipe Shape:</b> Circular<br><b>Dia/Height:</b> 100mm<br><b>Material:</b> Plastic<br><b>Lining Type:</b> No Lining<br><b>Lining Material:</b> No lining |                                                                                                                                          |       |

**PS221**


**Position(M)**

**Code**

**Observation**

**MPEG**

**photo**

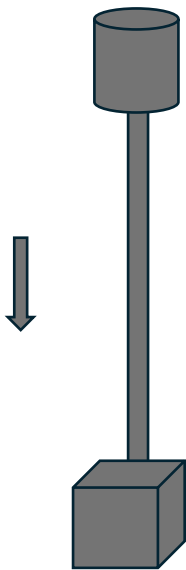

0.0

MH

Start node, ref PS221

11:44:53

4.4

MH

Finish node, ref PSCP220

11:45:18

**PSCP220**

| Construction Features |          |          |           |           | Miscellaneous Features             |          |          |           |           |
|-----------------------|----------|----------|-----------|-----------|------------------------------------|----------|----------|-----------|-----------|
| Structural Features   |          |          |           |           | Service & Operational Observations |          |          |           |           |
| STR No. Def           | STR Peak | STR Mean | STR Total | STR Grade | SER No. Def                        | SER Peak | SER Mean | SER Total | SER Grade |
| 0                     | 0        | 0        | 0         | 1         | 0                                  | 0        | 0        | 0         | 1         |

## Section Pictures – 06/03/2025 – PS221

| Item No. | Inspection Direction | PLR   | Clients Ref | Contractors Ref |
|----------|----------------------|-------|-------------|-----------------|
| 6        | Downstream           | PS221 |             |                 |



Start node, manhole, reference: PS221




Finish node, manhole, reference: PSCP220

## Section inspection – 06/03/2025 – PS202

| Item No.                                                                                                                                                               | Insp No. | Date                                                                             | Time                                                                                                                   | Weather                                                                                                      | PLR   |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|----------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------|-------|
| 7                                                                                                                                                                      | 1        | 06/03/2025                                                                       | 11:22                                                                                                                  | Dry                                                                                                          | PS202 |
| Operator                                                                                                                                                               | Vehicle  | Camera                                                                           | Preset length                                                                                                          | Legal Status                                                                                                 |       |
| Dan Hurrell                                                                                                                                                            | N/a      | N/a                                                                              | Not Specified                                                                                                          | Private Drain                                                                                                |       |
| Town: Eastergate<br>Road: Level Mare Lane<br>Location:<br>Surface type:                                                                                                |          | Insp Direction: Upstream<br>Insp length: 6m<br>Total length: 6m<br>Joint length: |                                                                                                                        | Upstream node: PS202<br>Upstream pipe depth: 0.6m<br>Downstream node: PSCP203<br>Downstream pipe depth: 0.8m |       |
| Use: Surface water<br>Type of pipe: Gravity drain/sewer<br>Flow control: No flow control<br>Year Constructed: Not specified<br>Inspection Purposes: Routine Inspection |          |                                                                                  | Pipe Shape: Circular<br>Dia/Height: 100mm<br>Material: Plastic<br>Lining Type: No Lining<br>Lining Material: No lining |                                                                                                              |       |

**PS202**      **Position(M)**      **Code**      **Observation**      **MPEG**      **photo**

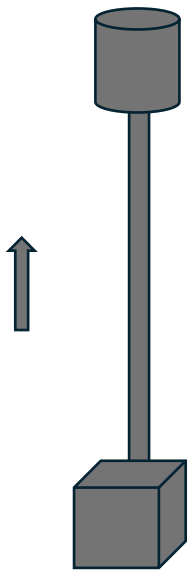

|     |    |                          |          |
|-----|----|--------------------------|----------|
| 4.5 | MH | Start node, ref PS202    | 11:22:12 |
| 4.5 | MF | Debris in pipe           | 11:22:33 |
| 4.5 | MH | Finish node, ref PSCP203 | 11:22:35 |

**PSCP203**

| Construction Features |          |          |           |           | Miscellaneous Features             |          |          |           |           |
|-----------------------|----------|----------|-----------|-----------|------------------------------------|----------|----------|-----------|-----------|
| Structural Features   |          |          |           |           | Service & Operational Observations |          |          |           |           |
| STR No. Def           | STR Peak | STR Mean | STR Total | STR Grade | SER No. Def                        | SER Peak | SER Mean | SER Total | SER Grade |
| 0                     | 0        | 0        | 0         | 1         | 1                                  | 0        | 2        | 0         | 2         |

## Section Pictures – 06/03/2025 – PS221

| Item No. | Inspection Direction | PLR   | Clients Ref | Contractors Ref |
|----------|----------------------|-------|-------------|-----------------|
| 6        | Downstream           | PS221 |             |                 |



Start node, manhole, reference: PS221



Finish node, manhole, reference: PSCP220

## Section inspection – 06/03/2025 – PS251

| Item No.                                                                                                                                                               | Insp No. | Date                                                                               | Time                                                                                                                   | Weather                                                                                                      | PLR   |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------|-------|
| 8                                                                                                                                                                      | 1        | 06/03/2025                                                                         | 11:14                                                                                                                  | Dry                                                                                                          | PS251 |
| Operator                                                                                                                                                               | Vehicle  | Camera                                                                             | Preset length                                                                                                          | Legal Status                                                                                                 |       |
| Dan Hurrell                                                                                                                                                            | N/a      | N/a                                                                                | Not Specified                                                                                                          | Private Drain                                                                                                |       |
| Town: Eastergate<br>Road: Level Mare Lane<br>Location:<br>Surface type:                                                                                                |          | Insp Direction: Downstream<br>Insp length: 5m<br>Total length: 5m<br>Joint length: |                                                                                                                        | Upstream node: PS251<br>Upstream pipe depth: 0.5m<br>Downstream node: PSCP206<br>Downstream pipe depth: 0.7m |       |
| Use: Surface water<br>Type of pipe: Gravity drain/sewer<br>Flow control: No flow control<br>Year Constructed: Not specified<br>Inspection Purposes: Routine Inspection |          |                                                                                    | Pipe Shape: Circular<br>Dia/Height: 100mm<br>Material: Plastic<br>Lining Type: No Lining<br>Lining Material: No lining |                                                                                                              |       |

**PS251**


**Position(M)**

**Code**

**Observation**

**MPEG**

**photo**

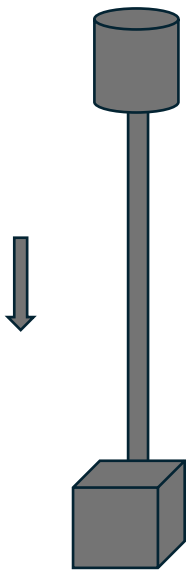

0.3

MH

Start node, ref PS251

11:14:35

5.0

MH

Finish node, ref PSCP206

11:14:53

**PSCP206**

| Construction Features |          |          |           |           | Miscellaneous Features             |          |          |           |           |
|-----------------------|----------|----------|-----------|-----------|------------------------------------|----------|----------|-----------|-----------|
| Structural Features   |          |          |           |           | Service & Operational Observations |          |          |           |           |
| STR No. Def           | STR Peak | STR Mean | STR Total | STR Grade | SER No. Def                        | SER Peak | SER Mean | SER Total | SER Grade |
| 0                     | 0        | 0        | 0         | 1         | 0                                  | 0        | 0        | 0         | 1         |

## Section Pictures – 06/03/2025 – PS251

| Item No. | Inspection Direction | PLR   | Clients Ref | Contractors Ref |
|----------|----------------------|-------|-------------|-----------------|
| 8        | Downstream           | PS251 |             |                 |



Start node, manhole, reference: PS251




Finish node, manhole, reference: PSCP206

## Section inspection – 06/03/2025 – PS212

| Item No.                                                                                                                                                               | Insp No. | Date                                                                                   | Time                                                                                                                   | Weather                                                                                                      | PLR   |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|----------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------|-------|
| 9                                                                                                                                                                      | 1        | 06/03/2025                                                                             | 11:06                                                                                                                  | Dry                                                                                                          | PS212 |
| Operator                                                                                                                                                               | Vehicle  | Camera                                                                                 | Preset length                                                                                                          | Legal Status                                                                                                 |       |
| Dan Hurrell                                                                                                                                                            | N/a      | N/a                                                                                    | Not Specified                                                                                                          | Private Drain                                                                                                |       |
| Town: Eastergate<br>Road: Level Mare Lane<br>Location:<br>Surface type:                                                                                                |          | Insp Direction: Downstream<br>Insp length: 5.2m<br>Total length: 4.7m<br>Joint length: |                                                                                                                        | Upstream node: PS212<br>Upstream pipe depth: 0.5m<br>Downstream node: PSCP213<br>Downstream pipe depth: 0.7m |       |
| Use: Surface water<br>Type of pipe: Gravity drain/sewer<br>Flow control: No flow control<br>Year Constructed: Not specified<br>Inspection Purposes: Routine Inspection |          |                                                                                        | Pipe Shape: Circular<br>Dia/Height: 100mm<br>Material: Plastic<br>Lining Type: No Lining<br>Lining Material: No lining |                                                                                                              |       |

**PS212**      **Position(M)**      **Code**      **Observation**      **MPEG**      **photo**

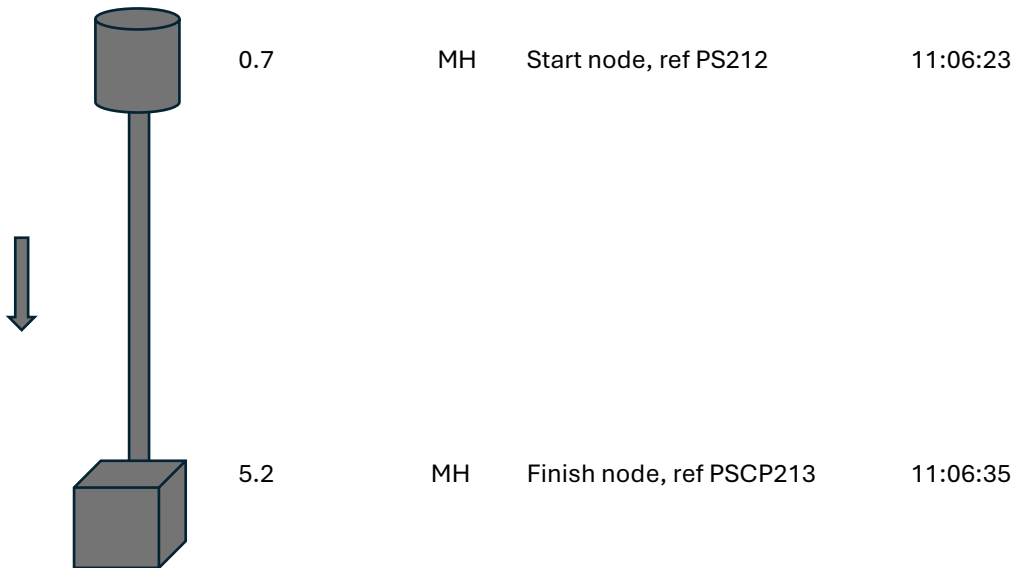

**PSCP213**

| Construction Features |          |          |           |           | Miscellaneous Features             |          |          |           |           |
|-----------------------|----------|----------|-----------|-----------|------------------------------------|----------|----------|-----------|-----------|
| Structural Features   |          |          |           |           | Service & Operational Observations |          |          |           |           |
| STR No. Def           | STR Peak | STR Mean | STR Total | STR Grade | SER No. Def                        | SER Peak | SER Mean | SER Total | SER Grade |
| 0                     | 0        | 0        | 0         | 1         | 0                                  | 0        | 0        | 0         | 1         |

## Section Pictures – 06/03/2025 – PS212

| Item No. | Inspection Direction | PLR  | Clients Ref | Contractors Ref |
|----------|----------------------|------|-------------|-----------------|
| 9        | Downstream           | PS12 |             |                 |



Start node, manhole, reference: PS212



Finish node, manhole, reference: PSCP213

## Section inspection – 06/03/2025 – PS209

| Item No.                                                                                                                                                               | Insp No. | Date                                                                                   | Time                                                                                                                   | Weather                                                                                                      | PLR   |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|----------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------|-------|
| 10                                                                                                                                                                     | 1        | 06/03/2025                                                                             | 10:54:21                                                                                                               | Dry                                                                                                          | PS209 |
| Operator                                                                                                                                                               | Vehicle  | Camera                                                                                 | Preset length                                                                                                          | Legal Status                                                                                                 |       |
| Dan Hurrell                                                                                                                                                            | N/a      | N/a                                                                                    | Not Specified                                                                                                          | Private Drain                                                                                                |       |
| Town: Eastergate<br>Road: Level Mare Lane<br>Location:<br>Surface type:                                                                                                |          | Insp Direction: Downstream<br>Insp length: 4.4m<br>Total length: 4.9m<br>Joint length: |                                                                                                                        | Upstream node: PS209<br>Upstream pipe depth: 0.7m<br>Downstream node: PSCP210<br>Downstream pipe depth: 0.7m |       |
| Use: Surface water<br>Type of pipe: Gravity drain/sewer<br>Flow control: No flow control<br>Year Constructed: Not specified<br>Inspection Purposes: Routine Inspection |          |                                                                                        | Pipe Shape: Circular<br>Dia/Height: 100mm<br>Material: Plastic<br>Lining Type: No Lining<br>Lining Material: No lining |                                                                                                              |       |

**PS209**


**Position(M)**

**Code**

**Observation**

**MPEG**

**photo**

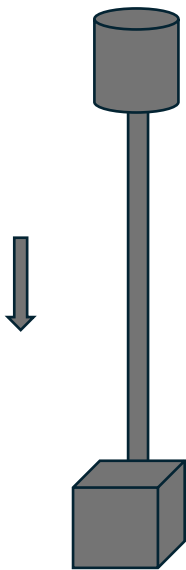

0.0

MH

Start node, ref PS209

10:54:21

4.4

MH

Finish node, ref PSCP210

10:54:35

**PSCP210**

| Construction Features |          |          |           |           | Miscellaneous Features             |          |          |           |           |
|-----------------------|----------|----------|-----------|-----------|------------------------------------|----------|----------|-----------|-----------|
| Structural Features   |          |          |           |           | Service & Operational Observations |          |          |           |           |
| STR No. Def           | STR Peak | STR Mean | STR Total | STR Grade | SER No. Def                        | SER Peak | SER Mean | SER Total | SER Grade |
| 0                     | 0        | 0        | 0         | 1         | 0                                  | 0        | 0        | 0         | 1         |

## Section Pictures – 06/03/2025 – PS209

| Item No. | Inspection Direction | PLR   | Clients Ref | Contractors Ref |
|----------|----------------------|-------|-------------|-----------------|
| 10       | Downstream           | PS209 |             |                 |



Start node, manhole, reference: PS209



Finish node, manhole, reference: PSCP210

## Section inspection – 06/03/2025 – PSCP210

| Item No.                                                                                                                                                                                                  | Insp No. | Date                                                                                                               | Time                                                                                                                                                      | Weather                                                                                                                                    | PLR     |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|--------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------|---------|
| 11                                                                                                                                                                                                        | 1        | 06/03/2025                                                                                                         | 10:58                                                                                                                                                     | Dry                                                                                                                                        | PSCP210 |
| Operator                                                                                                                                                                                                  | Vehicle  | Camera                                                                                                             | Preset length                                                                                                                                             | Legal Status                                                                                                                               |         |
| Dan Hurrell                                                                                                                                                                                               | N/a      | N/a                                                                                                                | Not Specified                                                                                                                                             | Private Drain                                                                                                                              |         |
| <b>Town:</b> Eastergate<br><b>Road:</b> Level Mare Lane<br><b>Location:</b><br><b>Surface type:</b>                                                                                                       |          | <b>Insp Direction:</b> Downstream<br><b>Insp length:</b> 1.5m<br><b>Total length:</b> 1.5m<br><b>Joint length:</b> |                                                                                                                                                           | <b>Upstream node:</b> PSCP210<br><b>Upstream pipe depth:</b> 0.7m<br><b>Downstream node:</b> SA66-67<br><b>Downstream pipe depth:</b> 1.1m |         |
| <b>Use:</b> Surface water<br><b>Type of pipe:</b> Gravity drain/sewer<br><b>Flow control:</b> No flow control<br><b>Year Constructed:</b> Not specified<br><b>Inspection Purposes:</b> Routine Inspection |          |                                                                                                                    | <b>Pipe Shape:</b> Circular<br><b>Dia/Height:</b> 100mm<br><b>Material:</b> Plastic<br><b>Lining Type:</b> No Lining<br><b>Lining Material:</b> No lining |                                                                                                                                            |         |

**PS210**


**Position(M)**

**Code**

**Observation**

**MPEG**

**photo**

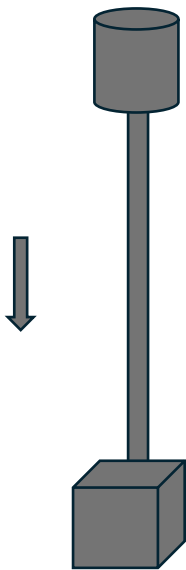

0.1

MH

Start node, ref PSCP210

10:58:48

1.4

SA

Finish node, ref SA66-67

10:58:54

**SA66-67**

| Construction Features |          |          |           |           | Miscellaneous Features             |          |          |           |           |
|-----------------------|----------|----------|-----------|-----------|------------------------------------|----------|----------|-----------|-----------|
| Structural Features   |          |          |           |           | Service & Operational Observations |          |          |           |           |
| STR No. Def           | STR Peak | STR Mean | STR Total | STR Grade | SER No. Def                        | SER Peak | SER Mean | SER Total | SER Grade |
| 0                     | 0        | 0        | 0         | 1         | 0                                  | 0        | 0        | 0         | 1         |

## Section Pictures – 06/03/2025 – PSCP210

| Item No. | Inspection Direction | PLR     | Clients Ref | Contractors Ref |
|----------|----------------------|---------|-------------|-----------------|
| 11       | Downstream           | PSCP210 |             |                 |



Start node, manhole, reference: PSCP210



Finish node, soakaway, reference: SA66-67

## Section inspection – 06/03/2025 – PS344

| Item No.                                                                                                                                                                                                  | Insp No. | Date                                                                                                                 | Time                                                                                                                                                      | Weather                                                                                                                                 | PLR   |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|----------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------|-------|
| 12                                                                                                                                                                                                        | 1        | 06/03/2025                                                                                                           | 14:49                                                                                                                                                     | Dry                                                                                                                                     | PS344 |
| Operator                                                                                                                                                                                                  | Vehicle  | Camera                                                                                                               | Preset length                                                                                                                                             | Legal Status                                                                                                                            |       |
| Dan Hurrell                                                                                                                                                                                               | N/a      | N/a                                                                                                                  | Not Specified                                                                                                                                             | Private Drain                                                                                                                           |       |
| <b>Town:</b> Eastergate<br><b>Road:</b> Level Mare Lane<br><b>Location:</b><br><b>Surface type:</b>                                                                                                       |          | <b>Insp Direction:</b> Downstream<br><b>Insp length:</b> 14.7m<br><b>Total length:</b> 14.7m<br><b>Joint length:</b> |                                                                                                                                                           | <b>Upstream node:</b> PS344<br><b>Upstream pipe depth:</b> 0.5m<br><b>Downstream node:</b> PS342<br><b>Downstream pipe depth:</b> 0.65m |       |
| <b>Use:</b> Surface water<br><b>Type of pipe:</b> Gravity drain/sewer<br><b>Flow control:</b> No flow control<br><b>Year Constructed:</b> Not specified<br><b>Inspection Purposes:</b> Routine Inspection |          |                                                                                                                      | <b>Pipe Shape:</b> Circular<br><b>Dia/Height:</b> 100mm<br><b>Material:</b> Plastic<br><b>Lining Type:</b> No Lining<br><b>Lining Material:</b> No lining |                                                                                                                                         |       |

**PS344**


**Position(M)**

**Code**

**Observation**

**MPEG**

**photo**

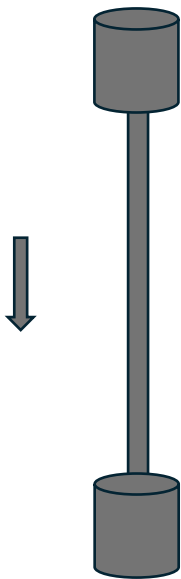

-10.0

MH

Start node, ref PS344

14:49:27

4.7

MH

Finish node, ref PS342

14:50:26

**PS342**

| Construction Features |          |          |           |           | Miscellaneous Features             |          |          |           |           |
|-----------------------|----------|----------|-----------|-----------|------------------------------------|----------|----------|-----------|-----------|
| Structural Features   |          |          |           |           | Service & Operational Observations |          |          |           |           |
| STR No. Def           | STR Peak | STR Mean | STR Total | STR Grade | SER No. Def                        | SER Peak | SER Mean | SER Total | SER Grade |
| 0                     | 0        | 0        | 0         | 1         | 0                                  | 0        | 0        | 0         | 1         |

## Section Pictures – 06/03/2025 – PS344

| Item No. | Inspection Direction | PLR   | Clients Ref | Contractors Ref |
|----------|----------------------|-------|-------------|-----------------|
| 12       | Downstream           | PS344 |             |                 |



Start node, manhole, reference: PS344




Finish node, manhole, reference: PS342

## Section inspection – 24/09/2025 – PS5281

| Item No.                                                                                                                                                               | Insp No. | Date                                                                                    | Time                                                                                                                   | Weather                                                                                                     | PLR    |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|-----------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------|--------|
| 13                                                                                                                                                                     | 1        | 24/09/2025                                                                              | 11:55                                                                                                                  | Dry                                                                                                         | PS5281 |
| Operator                                                                                                                                                               | Vehicle  | Camera                                                                                  | Preset length                                                                                                          | Legal Status                                                                                                |        |
| Dan Hurrell                                                                                                                                                            | N/a      | N/a                                                                                     | Not Specified                                                                                                          | Private Drain                                                                                               |        |
| Town: Eastergate<br>Road: Level Mare Lane<br>Location:<br>Surface type:                                                                                                |          | Insp Direction: Upstream<br>Insp length: 9.90m<br>Total length: 12.49m<br>Joint length: |                                                                                                                        | Upstream node: PS5281<br>Upstream pipe depth: 0.6m<br>Downstream node: PS61<br>Downstream pipe depth: 0.95m |        |
| Use: Surface water<br>Type of pipe: Gravity drain/sewer<br>Flow control: No flow control<br>Year Constructed: Not specified<br>Inspection Purposes: Routine Inspection |          |                                                                                         | Pipe Shape: Circular<br>Dia/Height: 100mm<br>Material: Plastic<br>Lining Type: No Lining<br>Lining Material: No lining |                                                                                                             |        |

**PS5281**    **Position(M)**    **Code**    **Observation**    **MPEG**    **photo**

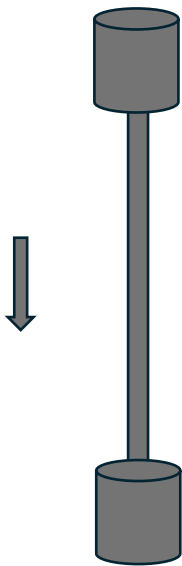

|      |    |                        |          |
|------|----|------------------------|----------|
| 0.20 | MH | Start node, ref PS5281 | 11:55:53 |
| 9.90 | MH | Finish node, ref PS61  | 11:56:57 |

**PS61**


| Construction Features |          |          |           |           | Miscellaneous Features             |          |          |           |           |
|-----------------------|----------|----------|-----------|-----------|------------------------------------|----------|----------|-----------|-----------|
| Structural Features   |          |          |           |           | Service & Operational Observations |          |          |           |           |
| STR No. Def           | STR Peak | STR Mean | STR Total | STR Grade | SER No. Def                        | SER Peak | SER Mean | SER Total | SER Grade |
| 0                     | 0        | 0        | 0         | 1         | 1                                  | 0        | 0        | 0         | 2         |

## Section Pictures – 06/03/2025 – PS5281

| Item No. | Inspection Direction | PLR    | Clients Ref | Contractors Ref |
|----------|----------------------|--------|-------------|-----------------|
| 13       | Downstream           | PS5281 |             |                 |




Start node, manhole, reference: PS5281

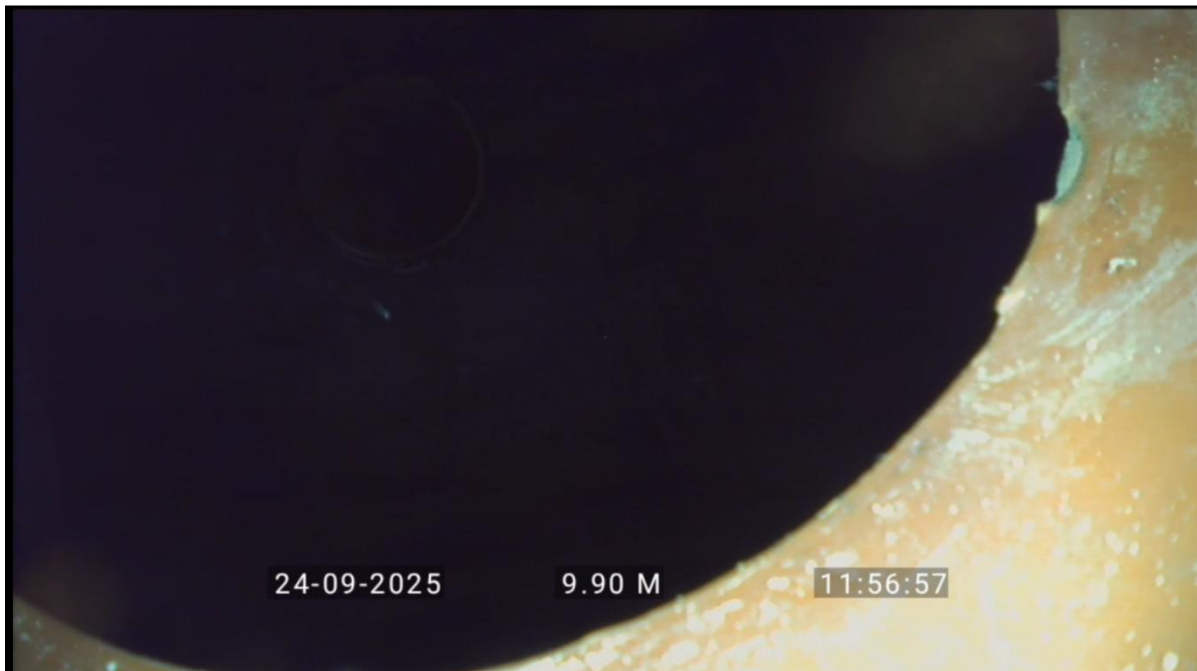

Finish node, manhole, reference: PS61

## Section inspection – 24/09/2025 – PS54

| Item No.                                                                                                                                                                                                  | Insp No. | Date                                                                                                                 | Time                                                                                                                                                      | Weather                                                                                                                                  | PLR  |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|----------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------------------------|------|
| 14                                                                                                                                                                                                        | 1        | 24/09/2025                                                                                                           | 14:10                                                                                                                                                     | Dry                                                                                                                                      | PS54 |
| Operator                                                                                                                                                                                                  | Vehicle  | Camera                                                                                                               | Preset length                                                                                                                                             | Legal Status                                                                                                                             |      |
| Dan Hurrell                                                                                                                                                                                               | N/a      | N/a                                                                                                                  | Not Specified                                                                                                                                             | Private Drain                                                                                                                            |      |
| <b>Town:</b> Eastergate<br><b>Road:</b> Level Mare Lane<br><b>Location:</b><br><b>Surface type:</b>                                                                                                       |          | <b>Insp Direction:</b> Downstream<br><b>Insp length:</b> 8.90m<br><b>Total length:</b> 8.90m<br><b>Joint length:</b> |                                                                                                                                                           | <b>Upstream node:</b> PS54<br><b>Upstream pipe depth:</b> 0.6m<br><b>Downstream node:</b> PSCP220<br><b>Downstream pipe depth:</b> 0.85m |      |
| <b>Use:</b> Surface water<br><b>Type of pipe:</b> Gravity drain/sewer<br><b>Flow control:</b> No flow control<br><b>Year Constructed:</b> Not specified<br><b>Inspection Purposes:</b> Routine Inspection |          |                                                                                                                      | <b>Pipe Shape:</b> Circular<br><b>Dia/Height:</b> 100mm<br><b>Material:</b> Plastic<br><b>Lining Type:</b> No Lining<br><b>Lining Material:</b> No lining |                                                                                                                                          |      |
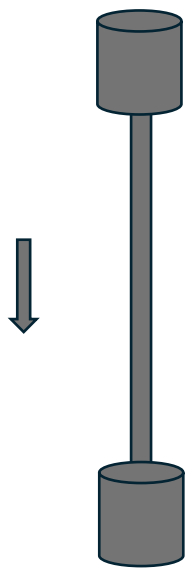
| PS54                                                                               | Position(M) | Code | Observation              | MPEG     | photo |
|------------------------------------------------------------------------------------|-------------|------|--------------------------|----------|-------|
|  | 0.00        | MH   | Start node, ref PS54     | 14:10:58 |       |
|                                                                                    | 8.90        | MH   | Finish node, ref PSCP220 | 14:11:50 |       |

**PSCP220**

| Construction Features |          |          |           |           | Miscellaneous Features             |          |          |           |           |
|-----------------------|----------|----------|-----------|-----------|------------------------------------|----------|----------|-----------|-----------|
| Structural Features   |          |          |           |           | Service & Operational Observations |          |          |           |           |
| STR No. Def           | STR Peak | STR Mean | STR Total | STR Grade | SER No. Def                        | SER Peak | SER Mean | SER Total | SER Grade |
| 0                     | 0        | 0        | 0         | 1         | 0                                  | 0        | 0        | 0         | 1         |

## Section Pictures – 24/09/2025 – PS54

| Item No. | Inspection Direction | PLR  | Clients Ref | Contractors Ref |
|----------|----------------------|------|-------------|-----------------|
| 14       | Downstream           | PS54 |             |                 |




Start node, manhole, reference: PS54



Finish node, manhole, reference: PSCP220

## Section inspection – 24/09/2025 – PS61

| Item No.                                                                                                                                                               | Insp No. | Date                                                                                     | Time                                                                                                                   | Weather                                                                                                       | PLR  |
|------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|------------------------------------------------------------------------------------------|------------------------------------------------------------------------------------------------------------------------|---------------------------------------------------------------------------------------------------------------|------|
| 15                                                                                                                                                                     | 1        | 24/09/2025                                                                               | 15:06                                                                                                                  | Dry                                                                                                           | PS61 |
| Operator                                                                                                                                                               | Vehicle  | Camera                                                                                   | Preset length                                                                                                          | Legal Status                                                                                                  |      |
| Dan Hurrell                                                                                                                                                            | N/a      | N/a                                                                                      | Not Specified                                                                                                          | Private Drain                                                                                                 |      |
| Town: Eastergate<br>Road: Level Mare Lane<br>Location:<br>Surface type:                                                                                                |          | Insp Direction: Downstream<br>Insp length: 0.90m<br>Total length: 1.60m<br>Joint length: |                                                                                                                        | Upstream node: PS61<br>Upstream pipe depth: 1.00m<br>Downstream node: SA57-65<br>Downstream pipe depth: 1.20m |      |
| Use: Surface water<br>Type of pipe: Gravity drain/sewer<br>Flow control: No flow control<br>Year Constructed: Not specified<br>Inspection Purposes: Routine Inspection |          |                                                                                          | Pipe Shape: Circular<br>Dia/Height: 100mm<br>Material: Plastic<br>Lining Type: No Lining<br>Lining Material: No lining |                                                                                                               |      |
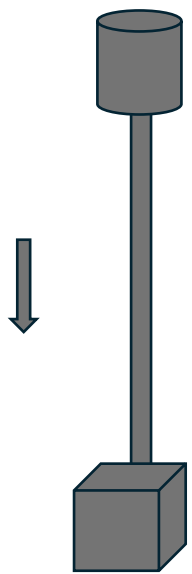
| PS61                                                                               | Position(M) | Code | Observation              | MPEG     | photo |
|------------------------------------------------------------------------------------|-------------|------|--------------------------|----------|-------|
|  | 0.00        | MH   | Start node, ref PS61     | 15:06:22 |       |
|                                                                                    | 0.90        | SA   | Finish node, ref SA57-65 | 15:06:33 |       |

**SA57-65**


| Construction Features |          |          |           |           | Miscellaneous Features             |          |          |           |           |
|-----------------------|----------|----------|-----------|-----------|------------------------------------|----------|----------|-----------|-----------|
| Structural Features   |          |          |           |           | Service & Operational Observations |          |          |           |           |
| STR No. Def           | STR Peak | STR Mean | STR Total | STR Grade | SER No. Def                        | SER Peak | SER Mean | SER Total | SER Grade |
| 0                     | 0        | 0        | 0         | 1         | 0                                  | 0        | 0        | 0         | 1         |

## Section Pictures – 24/09/2025 – PS61

| Item No. | Inspection Direction | PLR  | Clients Ref | Contractors Ref |
|----------|----------------------|------|-------------|-----------------|
| 15       | Downstream           | PS61 |             |                 |




Start node, manhole, reference: PS54

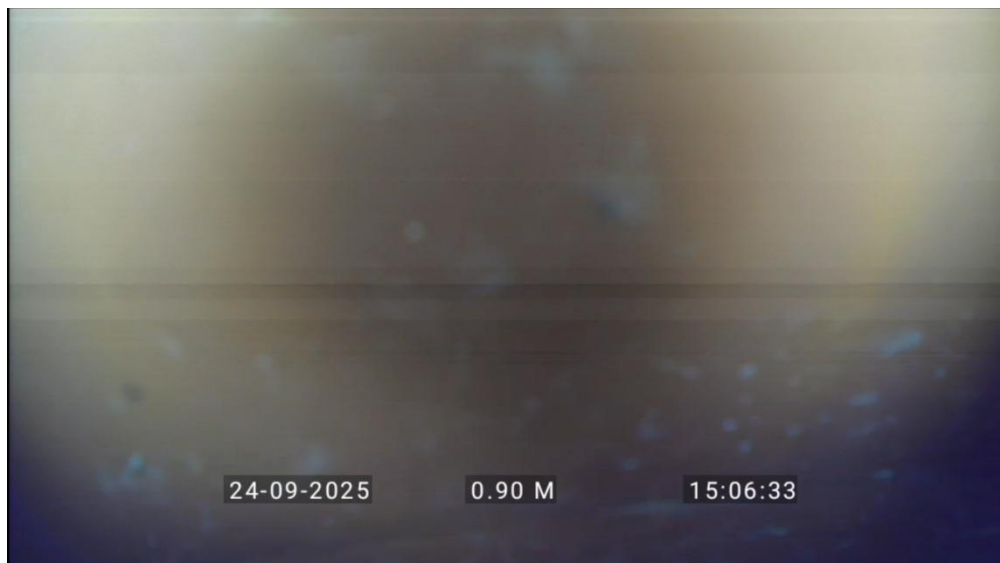

Finish node, soakaway, reference: SA57-65

## Section inspection – 24/09/2025 – PS220

| Item No.                                                                                                                                                                                                  | Insp No. | Date                                                                                                                 | Time                                                                                                                                                      | Weather                                                                                                                                    | PLR   |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|----------|----------------------------------------------------------------------------------------------------------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------|-------|
| 16                                                                                                                                                                                                        | 1        | 24/09/2025                                                                                                           | 15:03                                                                                                                                                     | Dry                                                                                                                                        | PS220 |
| Operator                                                                                                                                                                                                  | Vehicle  | Camera                                                                                                               | Preset length                                                                                                                                             | Legal Status                                                                                                                               |       |
| Dan Hurrell                                                                                                                                                                                               | N/a      | N/a                                                                                                                  | Not Specified                                                                                                                                             | Private Drain                                                                                                                              |       |
| <b>Town:</b> Eastergate<br><b>Road:</b> Level Mare Lane<br><b>Location:</b><br><b>Surface type:</b>                                                                                                       |          | <b>Insp Direction:</b> Downstream<br><b>Insp length:</b> 1.40m<br><b>Total length:</b> 0.39m<br><b>Joint length:</b> |                                                                                                                                                           | <b>Upstream node:</b> PS220<br><b>Upstream pipe depth:</b> 0.74m<br><b>Downstream node:</b> SA53-55<br><b>Downstream pipe depth:</b> 0.90m |       |
| <b>Use:</b> Surface water<br><b>Type of pipe:</b> Gravity drain/sewer<br><b>Flow control:</b> No flow control<br><b>Year Constructed:</b> Not specified<br><b>Inspection Purposes:</b> Routine Inspection |          |                                                                                                                      | <b>Pipe Shape:</b> Circular<br><b>Dia/Height:</b> 100mm<br><b>Material:</b> Plastic<br><b>Lining Type:</b> No Lining<br><b>Lining Material:</b> No lining |                                                                                                                                            |       |
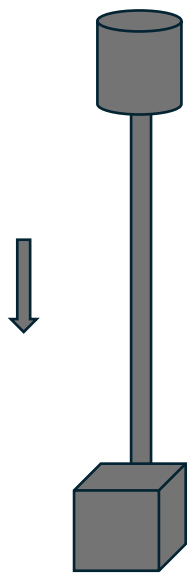
| PS220                                                                              | Position(M) | Code | Observation              | MPEG     | photo |
|------------------------------------------------------------------------------------|-------------|------|--------------------------|----------|-------|
|  | 0.00        | MH   | Start node, ref PS220    | 15:03:46 |       |
|                                                                                    | 1.40        | SA   | Finish node, ref SA53-55 | 15:03:53 |       |

**SA53-55**


| Construction Features |          |          |           |           | Miscellaneous Features             |          |          |           |           |
|-----------------------|----------|----------|-----------|-----------|------------------------------------|----------|----------|-----------|-----------|
| Structural Features   |          |          |           |           | Service & Operational Observations |          |          |           |           |
| STR No. Def           | STR Peak | STR Mean | STR Total | STR Grade | SER No. Def                        | SER Peak | SER Mean | SER Total | SER Grade |
| 0                     | 0        | 0        | 0         | 1         | 0                                  | 0        | 0        | 0         | 1         |

## Section Pictures – 24/09/2025 – PS220

| Item No. | Inspection Direction | PLR   | Clients Ref | Contractors Ref |
|----------|----------------------|-------|-------------|-----------------|
| 16       | Downstream           | PS220 |             |                 |



Start node, manhole, reference: PS220

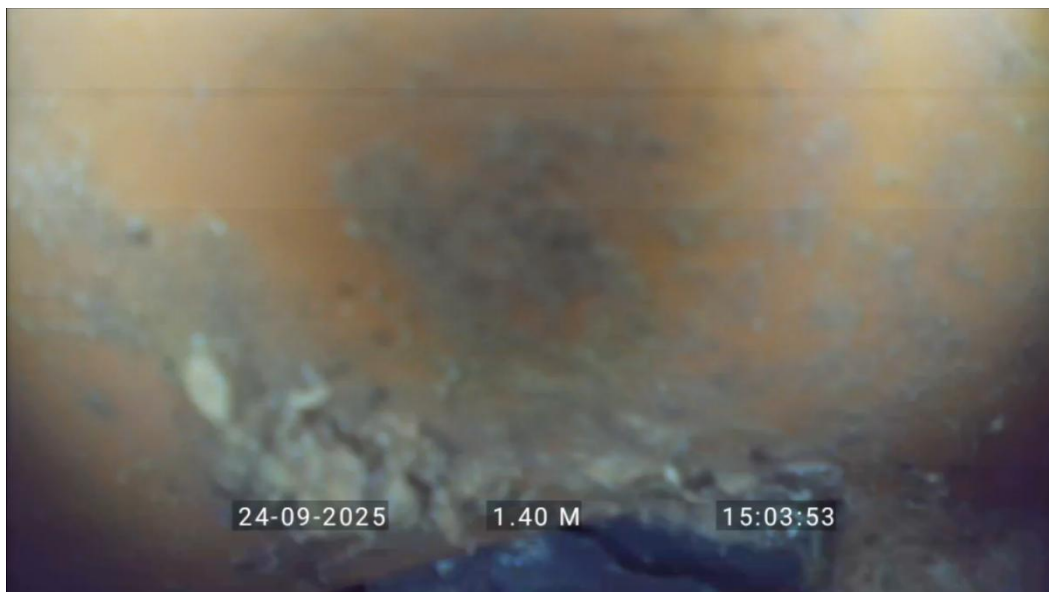

Finish node, soakaway, reference: SA53-55