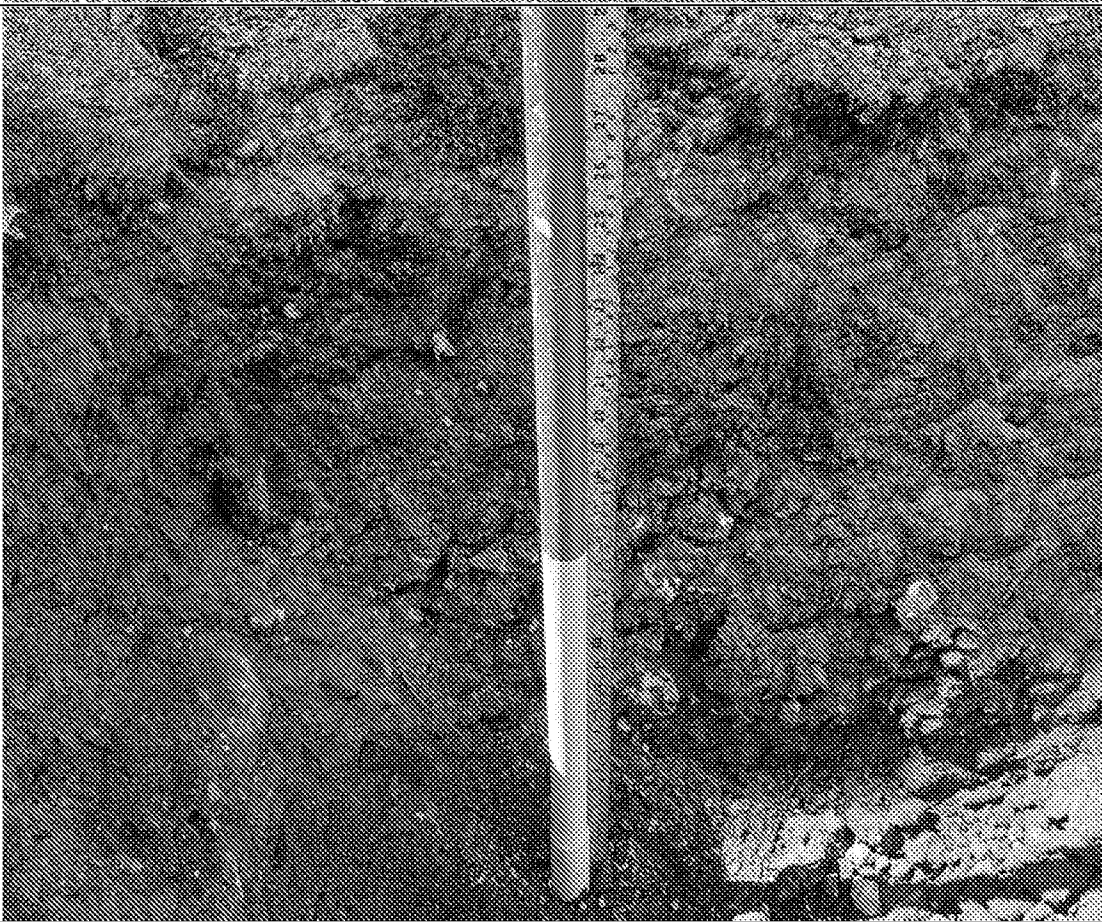
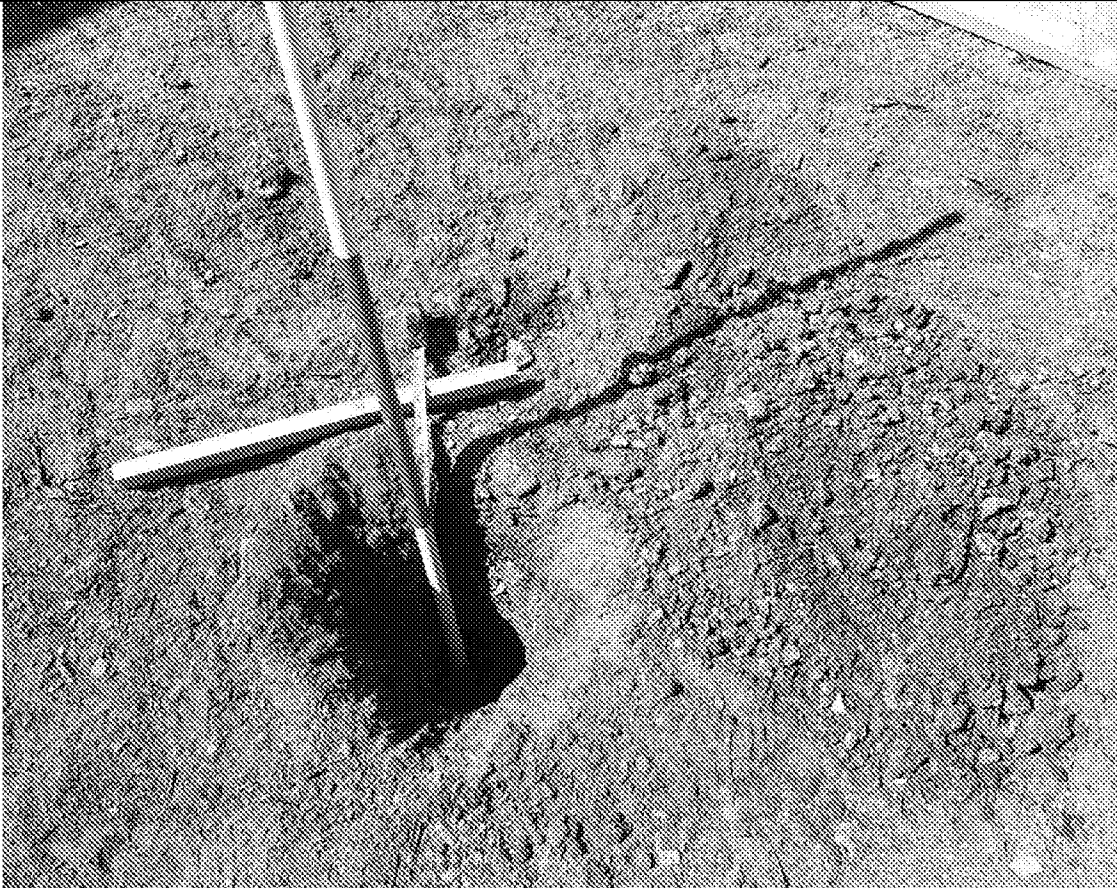


PHOTOGRAPHIC LOG	
Site Location: Land at West End Nursery, Angmering	
Photo No. 19 Date: 21/07/2020	 Overview of Plot 224 front garden
Photo No. 20 Date: 21/07/2020	 View of the capping in Plot 224 front garden – at least 600 mm thick

PHOTOGRAPHIC LOG

Site Location: Land at West End Nursery, Angmering

Photo No. 21 Date: 21/07/2020 View of hand dug pit in the front garden of Plot 224	
Photo No. 22 Date: 21/07/2020 Overview of Plot 224 rear garden	

PHOTOGRAPHIC LOG	
Site Location: Land at West End Nursery, Angmering	
Photo No. 23 Date: 21/07/2020	 View of the capping in Plot 224 rear garden – at least 600 mm thick
Photo No. 24 Date: 21/07/2020	 View of hand dug pit in the rear garden of Plot 224

PHOTOGRAPHIC LOG

Site Location: Land at West End Nursery, Angmering

Photo No. 25 Date: 21/07/2020 Overview of Plot 225 front garden	
Photo No. 26 Date: 21/07/2020 View of the capping in Plot 225 front garden – at least 600 mm thick	

PHOTOGRAPHIC LOG

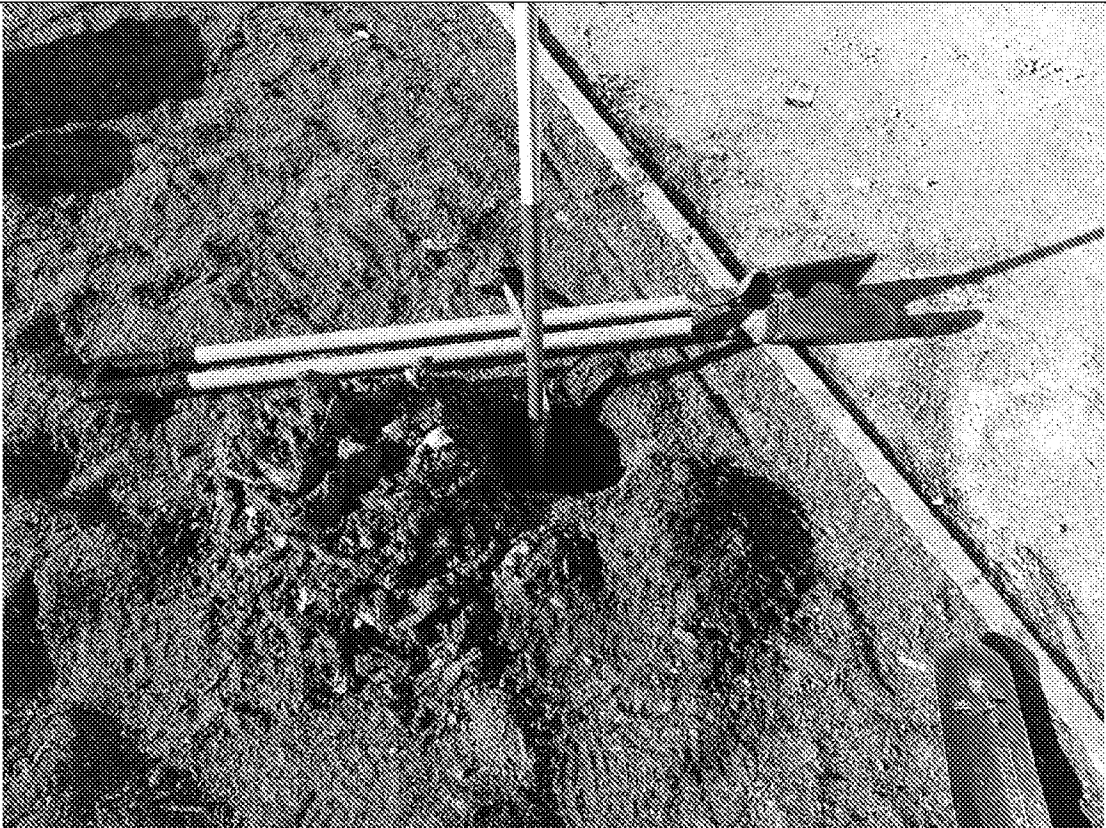
Site Location: Land at West End Nursery, Angmering

Photo No. 27 Date: 21/07/2020 View of hand dug pit in the front garden of Plot 225 with membrane marker.	
Photo No. 28 Date: 21/07/2020 Overview of Plot 225 rear garden	

PHOTOGRAPHIC LOG

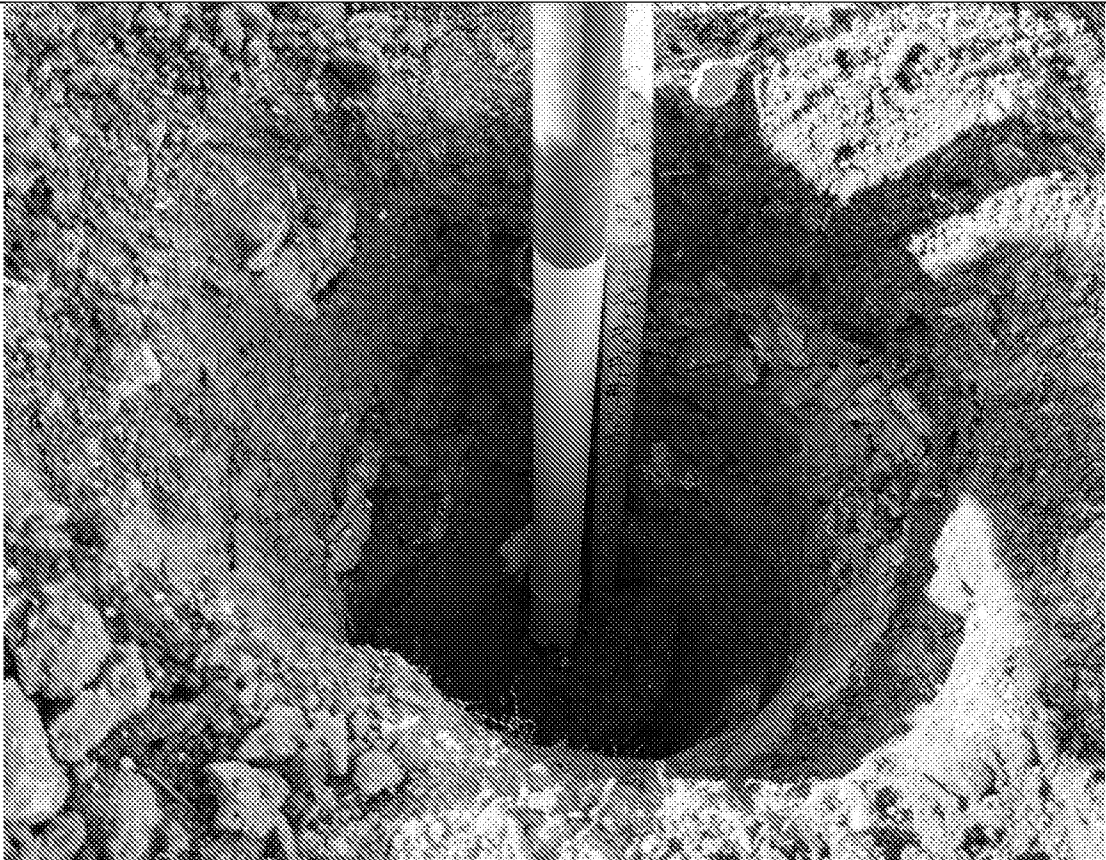
Site Location: Land at West End Nursery, Angmering

Photo No. 29 Date: 21/07/2020 View of the capping in Plot 225 rear garden – at least 600 mm thick.	
Photo No. 30 Date: 21/07/2020 View of hand dug pit in the rear garden of Plot 225	

PHOTOGRAPHIC LOG	
Site Location: Land at West End Nursery, Angmering	
Photo No. 31	
Date: 21/07/2020	
Overview of Plot 228 front garden	
Photo No. 32	
Date: 21/07/2020	
View of the capping in Plot 228 front garden – at least 450 mm thick	

PHOTOGRAPHIC LOG

Site Location: Land at West End Nursery, Angmering

Photo No. 33 Date: 21/07/2020	
View of hand dug pit in the front garden of Plot 228	
Photo No. 34 Date: 21/07/2020	
Overview of Plot 228 rear garden	

PHOTOGRAPHIC LOG

Site Location: Land at West End Nursery, Angmering

Photo No. 35 Date: 21/07/2020 View of the capping in Plot 228 rear garden – at least 450 mm thick.	
Photo No. 36 Date: 21/07/2020 View of hand dug pit in the rear garden of Plot 228	

PHOTOGRAPHIC LOG

Site Location: Land at West End Nursery, Angmering

Photo No. 37 Date: 21/07/2020 Overview of Plot 229 front garden	
Photo No. 38 Date: 21/07/2020 View of the capping in Plot 229 front garden – at least 450 mm thick	


PHOTOGRAPHIC LOG

Site Location: Land at West End Nursery, Angmering

Photo No. 39	
Date: 21/07/2020	
View of hand dug pit in the front garden of Plot 229	
Photo No. 40	
Date: 21/07/2020	
Overview of Plot 229 rear garden	

PHOTOGRAPHIC LOG

Site Location: Land at West End Nursery, Angmering

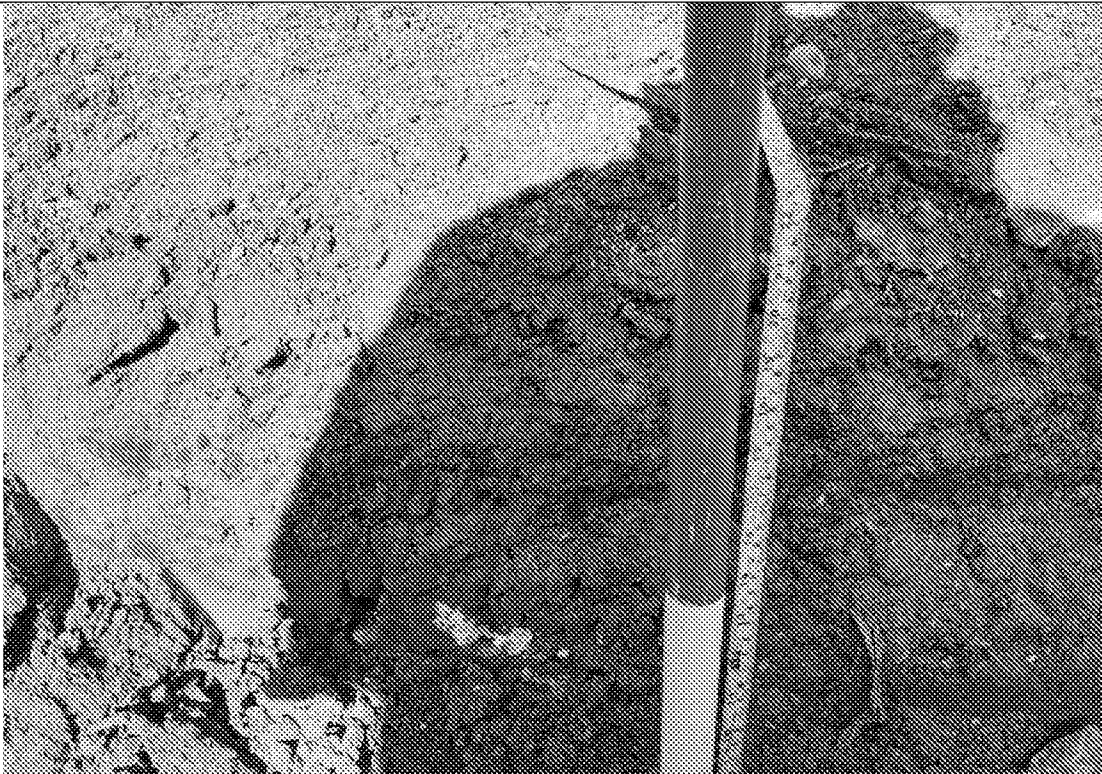Photo No. 41	
Date: 21/07/2020	
View of the capping in Plot 229 rear garden – at least 450 mm thick.	
Photo No. 42	
Date: 21/07/2020	
View of hand dug pit in the rear garden of Plot 229	

APPENDIX C

HAND PIT LOGS



Samples and In-situ Tests				Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
Depth	No	Type	Results					
0.30	1	ES	Tub+VL+J			Dark brown slightly gravelly slightly clayey SAND. Sand is fine to coarse. Gravel is angular to subrounded fine to coarse flint.	0.25	
						Brown slightly gravelly CLAY. Gravel is angular to subrounded fine to coarse flint.	0.45	
						Hand pit terminated at 0.45mbgl.		

1. Hand pit remained stable during excavation.
2. No groundwater encountered.
3. Backfilled with arisings.

Scale: 1:25





Contract:		Client:		Trial Pit:
Land at West End Nursery, Angmering		CALA Homes (South Home Counties) Ltd		HDP221F
Contract Ref:	Start: 21.07.20	Ground Level:	Co-ordinates:	Sheet:
27621	End: 21.07.20	---	---	1 of 1

Samples and In-situ Tests				Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
Depth	No	Type	Results					
						Dark brown slightly gravelly slightly clayey SAND. Sand is fine to coarse. Gravel is angular to subrounded fine to coarse flint.	0.25	
						Brown slightly gravelly CLAY. Gravel is angular to subrounded fine to coarse flint.	0.45	
						Hand pit terminated at 0.45mbgl.		

General Remarks

1. Hand pit remained stable during excavation.
2. No groundwater encountered.
3. Backfilled with arisings.

All dimensions in metres

Scale:

1:25

Method Used: Hand dug	Plant Used: Hand tools	Logged By: EChissell	Checked By:	
---------------------------------	----------------------------------	--------------------------------	----------------	---

[illegible]

1. Hand pit remained stable during excavation.
2. No groundwater encountered.
3. Backfilled with arisings.

Scale: 1:25



Contract:		Client:		Trial Pit:
Land at West End Nursery, Angmering		CALA Homes (South Home Counties) Ltd		HDP222F
Contract Ref:	Start: 21.07.20	Ground Level:	Co-ordinates:	Sheet:
27621	End: 21.07.20	---	---	1 of 1

Samples and In-situ Tests				Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
Depth	No	Type	Results					
						Dark brown slightly gravelly slightly clayey SAND. Sand is fine to coarse. Gravel is angular to subrounded fine to coarse flint.	(0.30)	
						Brown slightly gravelly CLAY. Gravel is angular to subrounded fine to coarse flint.	0.30	
						Hand pit terminated at 0.45mbgl.	0.45	

General Remarks

1. Hand pit remained stable during excavation.
2. No groundwater encountered.
3. Backfilled with arisings.

All dimensions in metres

Scale:

1:25

Method Used: Hand dug	Plant Used: Hand tools	Logged By: EChissell	Checked By:	
---------------------------------	----------------------------------	--------------------------------	----------------	---



Samples and In-situ Tests				Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
Depth	No	Type	Results					
0.30	1	ES	Tub+VL+J			Dark brown slightly gravelly slightly clayey SAND. Sand is fine to coarse. Gravel is angular to subrounded fine to coarse flint.	0.25	
						Brown slightly gravelly CLAY. Gravel is angular to subrounded fine to coarse flint.	0.45	
						Hand pit terminated at 0.45mbgl.		

1. Hand pit remained stable during excavation.
2. No groundwater encountered.
3. Backfilled with arisings.

Scale: 1:25



[illegible]

1. Hand pit remained stable during excavation.
2. No groundwater encountered.
3. Backfilled with arisings.

Scale: 1:25

Hand dug

Hand tools

EChissell





FINAL TRIAL PIT LOG

Contract: Land at West End Nursery, Angmering		Client: CALA Homes (South Home Counties) Ltd		Trial Pit: HDP224 (1)
Contract Ref: 27621	Start: 21.07.20 End: 21.07.20	Ground Level: ---	Co-ordinates: ---	Sheet: 1 of 1

Samples and In-situ Tests				Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
Depth	No	Type	Results					
0.30	1	ES	Tub+VL+J			Dark brown slightly gravelly slightly clayey SAND. Sand is fine to coarse. Gravel is angular to subrounded fine to coarse flint.	0.20	
						Brown slightly gravelly CLAY. Gravel is angular to subrounded fine to coarse flint.	(0.40)	
0.50	2	ES	Tub+VL+J				0.60	
Trial pit terminated at 0.60mbgl upon encountering geomembrane.								



Samples and In-situ Tests				Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
Depth	No	Type	Results					
0.30	1	ES	Tub+VL+J			Dark brown slightly gravelly slightly clayey SAND. Sand is fine to coarse. Gravel is angular to subrounded fine to coarse flint.	0.25	
						Brown slightly gravelly CLAY. Gravel is angular to subrounded fine to coarse flint.	(0.35)	
						Trial pit terminated at 0.60mbgl upon encountering geomembrane.	0.60	

1. Hand pit remained stable during excavation.
2. No groundwater encountered.
3. Backfilled with arisings.

Scale: 1:25





Samples and In-situ Tests				Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
Depth	No	Type	Results					
0.30	1	ES	Tub+VL+J			Dark brown slightly gravelly slightly clayey SAND. Sand is fine to coarse. Gravel is angular to subrounded fine to coarse flint.	0.25	
						Brown slightly gravelly CLAY. Gravel is angular to subrounded fine to coarse flint.	(0.35)	
						Trial pit terminated at 0.60mbgl upon encountering geomembrane.	0.60	

1. Hand pit remained stable during excavation.
2. No groundwater encountered.
3. Backfilled with arisings.

Scale: 1:25





Contract:		Client:		Trial Pit:
Land at West End Nursery, Angmering		CALA Homes (South Home Counties) Ltd		HDP224F
Contract Ref:	Start: 21.07.20	Ground Level:	Co-ordinates:	Sheet:
27621	End: 21.07.20	---	---	1 of 1

Samples and In-situ Tests				Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
Depth	No	Type	Results					
						Dark brown slightly gravelly slightly clayey SAND. Sand is fine to coarse. Gravel is angular to subrounded fine to coarse flint.	(0.30)	
							0.30	
						Brown slightly gravelly CLAY. Gravel is angular to subrounded fine to coarse flint.	(0.30)	
							0.60	

General Remarks

1. Hand pit remained stable during excavation.
2. No groundwater encountered.
3. Backfilled with arisings.

All dimensions in metres

Scale: 1:25

Method

Plant

Logged

Checked

Used: **Hand dug**


Hand tools

By: **EChissell**

By:





Samples and In-situ Tests				Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
Depth	No	Type	Results					
0.30	1	ES	Tub+VL+J			Dark brown slightly gravelly slightly clayey SAND. Sand is fine to coarse. Gravel is angular to subrounded fine to coarse flint.	(0.40)	
						Brown slightly gravelly CLAY. Gravel is angular to subrounded fine to coarse flint.	0.40	
0.60	2	ES	Tub+VL+J			Trial pit terminated at 0.60mbgl upon encountering geomembrane.	0.60	

1. Hand pit remained stable during excavation.
2. No groundwater encountered.
3. Backfilled with arisings.

Scale: 1:25





Samples and In-situ Tests				Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
Depth	No	Type	Results					
0.30	1	ES	Tub+VL+J			Dark brown slightly gravelly slightly clayey SAND. Sand is fine to coarse. Gravel is angular to subrounded fine to coarse flint.	(0.30)	
						Brown slightly gravelly CLAY. Gravel is angular to subrounded fine to coarse flint.	(0.30)	
						Trial pit terminated at 0.60mbgl upon encountering geomembrane.	(0.60)	

1. Hand pit remained stable during excavation.
2. No groundwater encountered.
3. Backfilled with arisings.

Scale: 1:25





Samples and In-situ Tests				Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
Depth	No	Type	Results					
						Dark brown slightly gravelly slightly clayey SAND. Sand is fine to coarse. Gravel is angular to subrounded fine to coarse flint.	(0.60)	
						Trial pit terminated at 0.60mbgl upon encountering geomembrane.	0.60	

1. Hand pit remained stable during excavation.
2. No groundwater encountered.
3. Backfilled with arisings.

Scale: 1:25





Contract: Land at West End Nursery, Angmering		Client: CALA Homes (South Home Counties) Ltd		Trial Pit: HDP228
Contract Ref: 27621	Start: 21.07.20 End: 21.07.20	Ground Level: ---	Co-ordinates: ---	Sheet: 1 of 1

Samples and In-situ Tests				Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
Depth	No	Type	Results					
						Dark brown slightly gravelly slightly clayey SAND. Sand is fine to coarse. Gravel is angular to subrounded fine to coarse flint.	(0.30)	
						Brown slightly gravelly CLAY. Gravel is angular to subrounded fine to coarse flint.	0.30	
						Hand pit terminated at 0.45mbgl.	0.45	

General Remarks

1. Hand pit remained stable during excavation.
2. No groundwater encountered.
3. Backfilled with arisings.

All dimensions in metres

Scale:

1:25

Method Used:	Plant Used:	Logged By:	Scale:	Checked By:	
COLEMAN/155/21/DOC Hand dug	Hand tools		EChissell		



Contract: Land at West End Nursery, Angmering			Client: CALA Homes (South Home Counties) Ltd		Trial Pit: HDP228F
Contract Ref: 27621		Start: 21.07.20 End: 21.07.20	Ground Level: ---	Co-ordinates: ---	Sheet: 1 of 1

[illegible]

General Remarks

1. Hand pit remained stable during excavation.
2. No groundwater encountered.
3. Backfilled with arisings.

All dimensions in metres

Scale: 1:25

Method

Plant
Used:

Logged By:

Checked
By:

Hand dug

Hand tools

EChissell





Samples and In-situ Tests				Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
Depth	No	Type	Results					
0.30 0.40	1	ES	Tub+VL+J			Dark brown slightly gravelly slightly clayey SAND. Sand is fine to coarse. Gravel is angular to subrounded fine to coarse flint.	0.20	
	2	ES	Tub+VL+J			Brown slightly gravelly CLAY. Gravel is angular to subrounded fine to coarse flint.	0.45	
	Hand pit terminated at 0.45mbgl.							

1. Hand pit remained stable during excavation.
2. No groundwater encountered.
3. Backfilled with arisings.

Scale: 1:25





Contract:		Client:		Trial Pit:
Land at West End Nursery, Angmering		CALA Homes (South Home Counties) Ltd		HDP229F
Contract Ref:	Start: 21.07.20	Ground Level:	Co-ordinates:	Sheet:
27621	End: 21.07.20	---	---	1 of 1

Samples and In-situ Tests				Water	Backfill	Description of Strata	Depth (Thickness)	Material Graphic Legend
Depth	No	Type	Results					
						Dark brown slightly gravelly slightly clayey SAND. Sand is fine to coarse. Gravel is angular to subrounded fine to coarse flint.	0.25	
						Brown slightly gravelly CLAY. Gravel is angular to subrounded fine to coarse flint.	0.45	
						Hand pit terminated at 0.45mbgl.		

General Remarks

1. Hand pit remained stable during excavation.
2. No groundwater encountered.
3. Backfilled with arisings.

All dimensions in metres

Scale: 1:25

Method

Plant

Logged

Checked

Used: **Hand dug**

Hand tools

By: **EChissell**

By: _____



APPENDIX D

TOPSOIL VALIDATION CERTIFICATES

WEIGHBRIDGE TICKET

Ticket No. DO653625
CONVEYANCE NOTE

WOODHORN GROUP Ltd

E WOODHORN GROUP

Date: 9/8/2019

Page: 1

Dispatch Note

Tangmere Composting Facility
City Fields Industrial Estate
Tangmere
West Sussex
PO20 2FP
EA Permit No: EPR/DE3703HG
Company Reg No: 3629015
VAT No: 816160744
SIC Code: 38210
Waste Carrier Licence no: CBDU162145

Time In 16:01

Date In 12/8/2019

Time Out 16:14

Date Out 12/8/2019

Vehicle E11TJT

Carrier T J Transport Ltd

License No.

Client Blaze Construction Ltd

Address CRESSWELL PARK,
ROUNDSTONE LANE,
ANGMERING, , SIC Code:

Permit

Zone

Product Topsoil BS3882 (20MM)

EWC Code

1st Weight: 12,940.00 Kg NONE

2nd Weight: 31,100.00 Kg NONE

Net Weight: 18,160.00 Kg

Job Site/Ship To:

Blaze Construction Ltd
CALA HOMES SITE
CRESSWELL PARK
ROUNDSTONE LANE
ANGMERING

No.	Salesperson	Manager	Ref
511	-No Sales Employee-		609/15042
QTY / UNIT		UNIT PRICE	EXTENDED PRICE

1.00 /

19.00 / Tonnes

By Signing this document I confirm that I have
fulfilled my duty to apply the waste hierarchy as
required by Regulation 12 of the waste (England
Wales) Regulations 2011

Signature waste depositer

Sign

WOODHORN GROUP

Date: 9/8/2019

Page: 1

WEIGHBRIDGE TICKET

Ticket No. DO653700

Dispatch Note

WOODHORN GROUP Ltd

Tangmere Composting Facility
 City Fields Industrial Estate
 Tangmere
 West Sussex
 PO20 2FP
 EA Permit No EPR/D83703HG
 Company Reg No 3629016
 VAT No 816160744
 SIC Code 38210
 Waste Carrier Licence no: CBDU162145

Time In 13:22
 Date In 13/8/2019
 Time Out 13:33
 Date Out 13/8/2019
 Vehicle E11TJT
 Carrier TJ Transport Ltd
 License No.

Client Blaze Construction Ltd
 Address CRESSWELL PARK
 ROUNDSTONE LANE
 ANGMERING, SIC Code:

Permit
 Zone
 Product Topsoil BS3882 (20MM)
 EWC Code
 1st Weight: 13,080.00 Kg NONE
 2nd Weight: 31,360.00 Kg NONE
 Net Weight: 18,280.00 Kg

Job Site/Ship To:

Blaze Construction Ltd
 CALA HOMES SITE
 CRESSWELL PARK
 ROUNDSTONE LANE
 ANGMERING

Salesperson	Manager	Ref
-No Sales Employee-		609/15042
QTY / UNIT	UNIT PRICE	EXTENDED PRICE

1.00 /

19.00 / Tonnes

Signature waste depositer