



Arboricultural Survey to BS5837-2012

Eastmere Paddocks Ltd

**Eastmere Stables
Eastergate Lane
Eastergate
PO20 3SJ**

15 August 2024

Chris Poplett Dip Arb L4 MArbora

Table of Contents

This report has been released electronically and the appendices have been included at the end of this report. Plans are included as A0, A1, A2 or A3 as appropriate.

1. Introduction	2
2. Survey	2
3. BS5837:2012 Scope.....	5
4. Methodology	5
5. Definitions.....	7
6. Recommendations.....	8
7. Limitations	8
8. Appendices	9
Appendix 1: Table 1 Cascade chart for tree quality assessment.....	10
Appendix 2: Schedule of Trees.....	12
Appendix 3: Tree Constraints Plan	17
9. Document Production Record	19

1. Introduction

Arbtech Consulting Limited (Arbtech) received written instruction on 07 August 2024 from Eastmere Paddocks Ltd to attend Eastmere Stables, Eastergate Lane, Eastergate, PO203SJ; grid reference, SU 95204 06062 (site) to undertake an arboricultural survey to BS5837:2012 guidance to assess trees, hedges and major shrub groups growing on and within influencing distance of the site and to produce a Schedule of Trees and a Tree Constraints Plan.

I am Chris Poplett, an arboricultural consultant at Arbtech Consulting Ltd. I undertook the tree survey on 14 August 2024 and subsequently have produced this summary of my findings.

Chris Poplett has accumulated experience within the arboricultural industry since 1996. Qualified to Level 4 Diploma and has Lantra professional tree inspector certification. Chris Poplett has been awarded professional membership of the Arboricultural association and is a certified soil food web laboratory technician.

The advice below and appended is underwritten by our Professional Indemnity insurance for the business practice of Arboricultural Consultancy in the sum of one million Pounds Sterling in each and every claim.

Table 1: Documents referred to.

Document	Reference No.
Survey base drawing	EX01
LPA pre-app comments	N/A
British Standard 5837:2012	“BS5837”
Tree Survey Schedule	Arbtech TS 01
Tree Constraints Plan	Arbtech TCP 01

2. Survey

Survey: An arboricultural survey to BS5837 of all trees within impacting distance of the site was undertaken by Chris Poplett on 14 August 2024.

During the survey I categorised the trees using “Table 1 – Cascade chart for tree quality assessment” of the BS5837:2012 (see Appendix 1).

A total of eight (08) individual trees, six (06) groups of trees, four (04) hedges were surveyed. Details for each of the trees surveyed are provided in the Schedule of Trees (see Appendix 2).

Table 2: Documents upon which this tree survey has been based.

Document	Originator	Reference Number	Title
Survey Base Drawing	Medlams Surveys Ltd	EX01	Topo Survey

Limitations: The survey was made at ground level using visual observation only. Detailed examinations, such as climbing inspections and advanced decay detection equipment were not employed, though may form part of the survey's management recommendations. Measurements were taken using specialist tapes, laser, and GPS devices. Where this was not possible, measurements are estimated.

Scope: Pre-development tree surveys make arboricultural management recommendations based exclusively upon the individual tree or group of trees condition relative to their present context (*i.e. not in relation to the proposed development*).

Legal Status: No statutory protection check has been performed. BS5837 does not draw any distinction between trees subject to statutory protection, such as a Tree Preservation Order ("TPO"), and those trees without. This is principally because a detailed planning consent overrides any TPO protection. Consequently, we do not seek to offer any comparison between or infer any difference in the quality or importance of TPO trees and other trees.

* For more information on the surveyed trees please see Arbtech Consulting Ltd, Tree Survey Schedule (Appendix 1), Tree Survey Report and Tree Constraints Plan.

Site description

Ex livery yard and field gallops.



Figure 1: OS Map showing the site location (Bing Maps)



Figure 2: Aerial Image of site with approximate red line boundary (Google Earth)

3. BS5837:2012 Scope

This standard recognises that there can be problems for development close to existing trees which are to be retained, and of planting trees close to existing structures. This standard sets out to assist those concerned with trees, in relation to construction, to form balanced judgements. It does not set out to put arguments for or against development, or for the removal or retention of trees. Where development, including demolition, is to occur, the standard provides guidance on how to decide which trees are appropriate for retention, on the means of protecting these trees during development, including demolition and construction work, and on the means of incorporating trees into the developed landscape.

4. Methodology

The methodology used to assess the trees was the British Standard 5837:2012 'Trees in Relation to Construction' tree survey method. The aim of the survey is to establish which trees are moderate and good quality; suitable for retention and justifying protection. And which trees are low or poor quality; either undesirable or unsuitable to retain and protect.

The tree survey includes all trees included in the land survey red line boundary plan, as well as any that may have been missed, and it should categorize trees or groups of trees, including woodlands for their quality and value within the existing context, in a transparent, understandable, and systematic way. Where the arboriculturist has deemed it appropriate, the trees have been tagged with small metal or plastic tags, placed as high as is convenient on the stem of each tree.

Whilst master plan proposals for the development of the site might be available, the trees have been surveyed without taking these into consideration. All detailed design work on site layout should take into consideration the results of the tree survey (and the TCP).

Trees forming groups and areas of woodland (including orchards, wood pasture and historic parkland) are identified and considered as groups where the arboriculturist has determined that this is appropriate, particularly where they contain a variety of species and age classes that could aid long-term management. It is often expedient to assess the quality and value of such groups of trees as a whole, rather than as individuals. However, an assessment of individuals within any group has been undertaken if they are open-grown or if there is a need to differentiate between them.

The quality and value of each tree or group of trees has been recorded by allocating it to one of the four categories: A, B, C, or U (highest to lowest quality respectively). The categories are differentiated on the tree survey plan by colour, or by suffixing the category adjacent to the tree identification number on the TCP.

The survey schedule lists all the trees or groups of trees. The following information is also provided:

- a) reference number (to be recorded on the tree survey plan);
- b) species (common or scientific names);
- c) height in meters (m);
- d) stem diameter in millimetres (mm) at 1.5m above adjacent ground level or immediately above the root flare for multi-stemmed trees;
- e) branch spread in meters taken at the four cardinal compass points;
- f) height of crown clearance above adjacent ground level in meters (m);
- g) age class (newly planted, young, semi-mature, early mature, mature, over mature);
- h) physiological condition (e.g. good, fair, poor, decline and dead);
- i) structural condition (e.g. good, fair, poor or not visible);
- j) comment about the tree, its location and preliminary management recommendations, including further investigation of suspected defects that require more detailed assessment and potential for wildlife habitat;
- k) The retention category referring to the quality and useful contribution in years;  = <10yrs;  = >40yrs;  = >20yrs;  = >10yrs. The retention subcategory referring to the type of amenity; 1 = Arboricultural; 2 = Landscape; 3 = Cultural including conservation (see Appendix 1 Cascade chart for tree quality assessment).

5. Definitions

Arboriculturist

An arboriculturist (or arboricultural consultant) is a person who has, through relevant education, training, and experience, gained recognized qualifications and expertise in the field of trees in relation to construction.

Tree Survey

A tree survey should be undertaken by an arboriculturist and should record information about the trees on a site independently of and prior to any specific design for development. As a subsequent task, and with reference to a design or potential design, the results of the survey should be included in the preparation of a tree constraints plan, which should be used to assist with site layout design.

Tree Constraints Plan

A TCP is plan, typically delivered as an AutoCAD drawing (.DWG file format), prepared by an arboriculturist for the purposes of layout design showing the root protection area and representing the effect that the mature height and spread of retained trees will have on layouts through shade, dominance, etc.

Root Protection Area

An RPA is a layout design tool indicating the area surrounding a tree that contains sufficient rooting volume to ensure the survival of the tree, shown in plan form in m².

Construction Exclusion Zone (also termed Tree Protection Zone)

A construction exclusion or tree protection zone is an area based on the RPA (in m²), identified by an arboriculturist, to be protected during development, including demolition and construction work, by the use of barriers and/or ground protection fit for purpose to ensure the successful long-term retention of a tree.

Arboricultural Impact Assessment (AIA)

This is a study, undertaken by an arboriculturist, to identify, evaluate and possibly mitigate the extent of direct and indirect impacts on existing trees that may arise as a result of the implementation of any site layout proposal.

Tree Protection Plan (TPP)

A TPP is plan, typically delivered as an AutoCAD drawing (.DWG file format), prepared by an arboriculturist showing the finalized layout proposals, tree retention and tree and landscape protection measures detailed within the arboricultural method statement, which can be shown graphically.

Arboricultural Method Statement (AMS)

This is a methodology for the implementation of any aspect of development that has the potential to result in loss of or damage to a tree. The AMS is likely to include details of an on-site tree protection monitoring regime.

6. Recommendations

With the benefit of making an assessment of your planning proposals, I make the following recommendation to ensure that there are no irrevocable issues to the proposed retained trees and so that no conditions relating to arboriculture are attached to any planning consent secured; obtain an arboricultural report to include:

- a) An arboricultural impact assessment (AIA).
- b) An arboricultural method statement (AMS).
- c) A tree protection plan drawing (TPP).

7. Limitations

Trees were inspected from using visual observation from ground level only. Trees were not climbed or inspected below ground level. Inaccessible trees will have best estimates made about the location, physical dimensions, and characteristics. Trees have been grouped where BS5837 guides us that it is expedient to do so. Trees have been excluded from the survey if they are found by us to be sufficiently far away from the proposed developable area or if they are outside of the red line boundary plan showing the expectations of our client for the extent of the survey. BS5837 does not draw any distinction between trees subject to statutory protection, such as a Tree Preservation Order (“TPO”), and those trees without. This is principally because a detailed planning consent overrides any TPO protection. Consequently, we do not seek to offer any comparison between or infer any difference in the quality or importance of TPO trees and other trees.

This report does not constitute a tree safety survey, nor does it fulfil the stewards/landowners Duty of Care in relation to tree risk.


8. Appendices

The following documents were released to the Client as appendices to this report:

- Survey Schedule (.PDF)
- Tree Constraints Plan drawing (.DWG & .PDF)


If you require clarification of information contained herein, please do not hesitate to contact us via 01244 661170.

Yours Sincerely,



Chris Poplett Dip Arb L4 MARborA

Arboricultural Consultant



Appendix 1: Table 1 Cascade chart for tree quality assessment

BS5837:2012 Trees in relation to design, demolition and construction – Recommendations


Table 1

Cascade chart for tree quality assessment

Category and definition	Criteria (including subcategories when appropriate)	Identification on plan
Trees unsuitable for retention (see Note)		
Category U Those in such a condition that they cannot realistically be retained as living trees in the context of the current land use for longer than 10 years.	<ul style="list-style-type: none"> Trees that have serious, irretrievable structural defect, such that their early loss is expected due to collapse, including those that will become unviable after removal of other category U trees (e.g. where, for whatever reason, the loss of companion shelter cannot be mitigated by pruning). Trees that are dead or are showing signs of significant, immediate, and irreversible overall decline. Trees infected with pathogens of significance to the health and/or safety of other trees nearby, or very low quality trees suppressing adjacent trees of better quality. <p>NOTE Category U trees can have existing or potential conservation value which might be desirable to preserve: see 4.5.7</p>	Dark red
Trees to be considered for retention		
Category A Trees of high quality with an estimated remaining life expectancy of at least 40 years	Trees that are particularly good examples of their species, especially if rare or unusual; or those that are essential components of groups or formal or semi-formal arboricultural features (e.g. the dominate and/or principal trees within an avenue).	<p>Trees, groups, or woodlands of particular visual importance as arboricultural and/or landscape features.</p> <p>Trees, groups or woodlands of significant conservation, historical, commemorative or other value (e.g. veteran trees or woodland pasture).</p>
Category B Trees of moderate quality with an estimated remaining life expectancy of at least 20 years	Trees that might be included in category A, but are downgraded because of impaired condition (e.g. presence of significant though remedial defects, including unsympathetic management and storm damage), such that they are unlikely to be suitable for retention of beyond 40 years, or trees lacking the special quality necessary to merit the category A designation.	<p>Trees present in numbers, usually growing as groups or woodlands, such that they attract a higher collective rating than they might as individuals, or trees occurring as collectives but situated so as to make little visual contribution to the wider locality.</p> <p>Trees with material conservation or other cultural value.</p>
Category C Trees of low quality with an estimated remaining life expectancy of at least 10 years or young trees with a stem diameter below 150mm	Unremarkable trees of very limited merit or such impaired condition that they do not qualify in higher categories.	<p>Trees present in groups or woodlands, but without this conferring on them significantly greater collective landscape value, and/or trees offering low or only temporary/transient landscape value.</p> <p>Trees with no material conservation or other cultural value.</p>



Appendix 2: Schedule of Trees



BS5837:2012 Tree Survey

Client: Eastmere Paddocks Ltd
Project: Eastmere Stables, Eastergate Lane, Eastergate, PO20 3S
Survey Date: 14/08/2024
Surveyor: Chris Poplett



Arbtech consulting ltd

Unit 3 Well House Barns
Chester Road
Chester
Cheshire
CH4 0DH
Phone: 01244661170

Tree and Tag No Species	Hght (m)	Stems		Crown		Age	RP A (m ²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations		Cat ERC
		No	Ø (mm)	Spread (m)	Clear (m)					Survey Comment		
G01											Estimated Measurements	
Cherry Laurel <i>Prunus laurocerasus</i>	5	1	80	N E S W	1.5 1.5 1.5 1.5	0 0 0 0	M R: 0.96	Good	C: Good S: Not visible B: Not visible	Vegetation obscuring observations of stems and base. Dimensions recorded are the largest represented within the group. Historically pruned to maintain shape and form.	C.2	20+ yrs
G02											Estimated Measurements	
Cherry Laurel <i>Prunus laurocerasus</i>	4	1	80	N E S W	1.5 1.5 1.5 1.5	0 0 0 0	M R: 0.96	Good	C: Good S: Not visible B: Not visible	Formally maintained to current dimensions. Vegetation obscuring observations of stems and base. Dimensions recorded are the largest represented within the group.	C.2	20+ yrs
G03											Estimated Measurements	
Cherry Laurel <i>Prunus laurocerasus</i>	4	1	80	N E S W	1.5 1.5 1.5 1.5	0 0 0 0	M R: 0.96	Good	C: Good S: Not visible B: Not visible	Formally maintained to current dimensions. Vegetation obscuring observations of stems and base. Dimensions recorded are the largest represented within the group.	C.2	20+ yrs
G04											Estimated Measurements	
Various <i>see comments for details</i>	6	1	280	N E S W	4 4 4 4	0 0 0 0	M R: 3.36	Good	C: Good S: Not visible B: Not visible	One individual greengage dominates the group. One individual field maple on the southern aspect of the group. Vegetation obscuring observations of stems and base. Dimensions recorded are the largest represented within the group.	B.2	20+ yrs

Age Classifications:	N	Newly planted	EM	Early Mature	Condition:	C	Crown	Stems:	Ø	Diameter
	Y	Young	M	Mature		S	Stem		(Eq)	Equivalent stem diameter using BS5837:2012 definition
	SM	Semi-mature	OM	Over Mature		B	Basal area	ERC:		Estimated Remaining Contributio


Tree and Tag No	Species	Hght (m)	Stems		Crown		Age	RP A (m ²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations		Cat ERC
			No	Ø (mm)	Spread (m)	Clear (m)					Survey Comment		
G05													Estimated Measurements
Unknown		7	1	300	N 3 0 M A: 40.7	E 3 0 R: 3.59	Dead	C: Poor	S: Poor	B: Poor			U
--					S 3 0								n/a
					W 3 0								
G06													Estimated Measurements
Field Maple		13	1	340	N 5 3 M A: 52.3	E 5 3 R: 4.08	Good	C: Good	S: Not visible	B: Not visible			B.2
<i>Acer campestre</i>					S 5 3								20+ yrs
					W 5 3								
H01													Estimated Measurements
Various		4	1	80	N 1 0 M A: 2.9	E 1 0 R: 0.96	Good	C: Good	S: Not visible	B: Not visible			C.2
<i>See comments for details</i>					S 1 0								20+ yrs
					W 1 0								
H02													Estimated Measurements
Various		4	1	80	N 1 0 M A: 2.9	E 1 0 R: 0.96	Good	C: Good	S: Not visible	B: Not visible			C.2
<i>See comments for details</i>					S 1 0								20+ yrs
					W 1 0								
H03													Estimated Measurements
Cherry Laurel		4	1	80	N 1.5 0 M A: 2.9	E 1.5 0 R: 0.96	Good	C: Good	S: Not visible	B: Not visible			C.2
<i>Prunus laurocerasus</i>					S 1.5 0								20+ yrs
					W 1.5 0								
Age Classifications:		N	Newly planted	EM	Early Mature	Condition:		C	Crown	Stems:		Ø Diameter	
		Y	Young	M	Mature			S	Stem			(Eq)	Equivalent stem diameter using BS5837:2012 definition
		SM	Semi-mature	OM	Over Mature			B	Basal area	ERC:		Estimated Remaining Contributio	


Tree and Tag No	Species	Hght (m)	Stems		Crown		Age	RP A (m ²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations		Cat ERC
			No	Ø (mm)	Spread (m)	Clear (m)					Survey Comment		
H04													Estimated Measurements
Cherry Laurel	<i>Prunus laurocerasus</i>	4	1	80	N 1	2 M	A: 2.9	Good	C: Good	S: Not visible	B: Not visible		C.2
					E 1	0	R: 0.96						20+ yrs
					S 1	0							
					W 1	0							
T01													
Sycamore	<i>Acer pseudoplatanus</i>	5	1	120	N 2	3 SM	A: 6.5	Good	C: Good	S: Not visible	B: Not visible		C.1
					E 2	3	R: 1.43						20+ yrs
					S 2	3							
					W 2	3							
T02													
Common Ash	<i>Fraxinus excelsior</i>	11	1	470	N 4	2 M	A: 99.9	Good	C: Good	S: Not visible	B: Not visible		B.1
					E 6	2	R: 5.63						20+ yrs
					S 5	4							
					W 4	2							
T03													
Common Ash	<i>Fraxinus excelsior</i>	12	1	480	N 5	2 M	A: 104.2	Good	C: Good	S: Good	B: Good		B.1
					E 5	2	R: 5.75						20+ yrs
					S 6	4							
					W 5	2							
T04													Estimated Measurements
Sycamore	<i>Acer pseudoplatanus</i>	11	2	255 (Eq)	N 4	2 M	A: 29.3	Good	C: Good	S: Not visible	B: Not visible		B.1
					E 4	2	R: 3.05						20+ yrs
					S 4	2							
					W 4	2							
Age Classifications:		N	Newly planted	EM	Early Mature	Condition:		C	Crown	Stems:		Ø Diameter	
		Y	Young	M	Mature			S	Stem			(Eq)	Equivalent stem diameter using BS5837:2012 definition
		SM	Semi-mature	OM	Over Mature			B	Basal area	ERC:		Estimated Remaining Contributio	

Tree and Tag No	Species	Hght (m)	Stems		Crown		Age	RP A (m ²) R (m)	Phys Condition	Structural Condition	Preliminary Recommendations		Cat ERC
			No	Ø (mm)	Spread (m)	Clear (m)					Survey Comment		
T05													Estimated Measurements
Common Ash	<i>Fraxinus excelsior</i>	12	1	550	N	7	4	M	A: 136.9	Fair	C: Fair S: Not visible B: Not visible		B.1
					E	5	4		R: 6.6				20+ yrs
					S	6	4						
					W	5	4						
T06	Common Hawthorn	5	2	322 (Eq)	N	2	2	M	A: 47.1	Good	C: Good S: Good B: Good		C.1
	<i>Crataegus monogyna</i>				E	2	2		R: 3.87				20+ yrs
					S	2	2						
					W	2	2						
T07	Lombardy Poplar	10	1	500	N	3	2	M	A: 113.1	Good	C: Fair S: Good B: Good		B.1
	<i>Populus nigra 'Italica'</i>				E	3	2		R: 6				20+ yrs
					S	3	2						
					W	3	2						
T08	Common or Black Elder	5	1	180	N	3	2	EM	A: 14.7	Good	C: Good S: Not visible B: Not visible		Estimated Measurements
	<i>Sambucus nigra</i>				E	3	2		R: 2.16				C.1
					S	3	2						20+ yrs
					W	3	2						
Age Classifications:		N	Newly planted	EM	Early Mature	Condition:		C	Crown	Stems:	Ø Diameter		
		Y	Young	M	Mature			S	Stem		(Eq)	Equivalent stem diameter using BS5837:2012 definition	
		SM	Semi-mature	OM	Over Mature			B	Basal area	ERC:		Estimated Remaining Contributio	



Appendix 3: Tree Constraints Plan



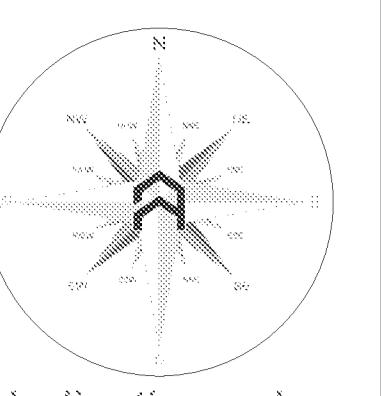

Indicative only

Tree Categories

Trees are categorised in accordance with the cascade chart in Table 1 of the British Standard BS 5837:2012 'Trees in relation to design, demolition and construction - Recommendations'

- Category 'U' - Trees in such condition that they cannot realistically be retained as living trees in context of the current land use for longer than 10 years.
- Category 'H' - Trees of high quality with an estimated remaining life expectancy of at least 40 years.
- Category 'M' - Trees of moderate quality with an estimated remaining life expectancy of at least 20 years.
- Category 'L' - Trees of low quality with an estimated remaining life expectancy of at least 10 years, or young trees with a stem diameter below 150mm.

Root Protection Area

In order to avoid damage to the roots or rooting environment of retained trees, the Root Protection Area (RPA) should be

retained trees, the Root Protection Areas (RPAs) are plotted around each of the category A, B and C trees. This is a minimum area in m^2 which should be left undisturbed around each retained tree.

The RPA is calculated using the British Standard BS 5837:2012 'Trees in relation to design, demolition and construction - Recommendations.'

The calculated RPA is capped to 707m^2 , which is the equivalent to a circle with a radius of 15m. Where there appears to be restrictions to root growth the root protection area is reshaped to more accurately reflect the likely distribution of the roots.

Tree Survey Report

woodlands and groups of trees/shrubs.

All trees were surveyed and categorised in accordance with the guidance as set out in the British Standard BS5837:2012 Tree in relation to design, demolition and construction - Recommendations.

We make the following recommendation to ensure that no conditions relating to arboriculture are attached to any planning consent secured:

Obtain and arboricultural report to include:

Obtain and arboricultural report to include:

- a) An arboricultural impact assessment (AIA).
- b) An arboricultural method statement (AMS).
- c) A tree protection plan (TPP).



Unit 3, Well House Barns, Chester, CH4 0DH
<https://arbitech.co.uk> 01244 661170

Project: Eastmere Stables,
Eastergate Lane,
Eastergate,
PO203SJ

Client: Eastmere Paddocks Ltd

Drawing: Tree Constraints Plan

Based on: EX01

Drawing No: Arbtech TCP 01

Rev:

Date:	Scale:	Drawn:
August 2024	1:200 @ A0	CP
Key:		
Tree Nos.:	T01	Tree Canopies:
RPAs:		Category 'B' trees:
Category 'C' trees:		Category 'C' groups:
Category 'U' groups:		Category 'U' groups:

'C' trees:  'C' groups:  'U' groups: 

All dimensions should be checked on site. No dimensions are to be scaled from this drawing. Please notify us of any discrepancies found. Arbtech Consulting Ltd. cannot be held responsible for inaccuracies in the base drawing in which this plan is based. This drawing is designed to reflect the principles of the layout or design only, and relates only to the protection of retained trees. This drawing is not to be read as a definitive part of the engineering or construction designs or method statement. An architect or structural engineer should be contacted over any matters of construction, detailing or specification and for any standards or regulatory requirements relating to proposed structures, hard surfacing or underground services. This drawing was generated in advance, measurements may not be scaled accurately.

9. Document Production Record

Document number	Editor	Signature	Position	Issue number	Date
Arbtech TSR 01	Chris Poplett	[REDACTED]	Arboricultural Consultant	01	15/08/24

Limitations

Arbtech Consulting Ltd has prepared this report for the sole use of the above-named Client/Agent in accordance with our terms of business, under which our services were performed. No other warranty, expressed or implied, is made as to the professional advice included in this report or any other services provided by us. This report may not be relied upon by any other party without the prior and express written agreement of Arbtech Consulting Ltd. The assessments made assume that the sites and facilities will continue to be used for their current purpose without significant change. The conclusions and recommendations contained in this report are based upon information provided by others and upon the assumption that all relevant information has been provided by those parties from whom it has been requested. Information obtained from third parties has not been independently verified by Arbtech Consulting Ltd.

Copyright

© This Report is the copyright of Arbtech Consulting Ltd. Any unauthorised reproduction or usage by any person other than the addressee is strictly prohibited.