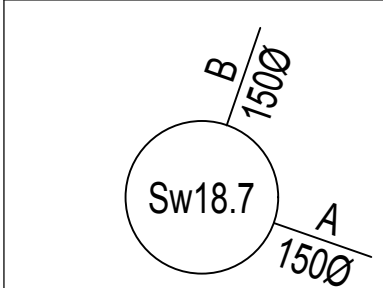
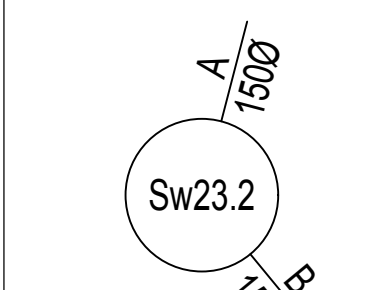
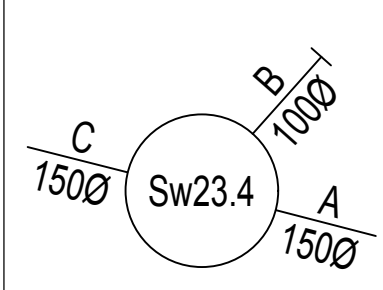
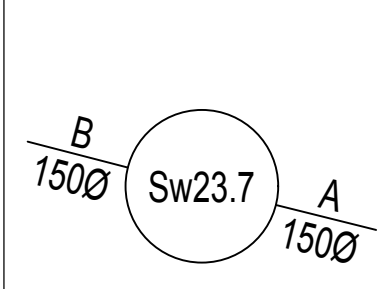
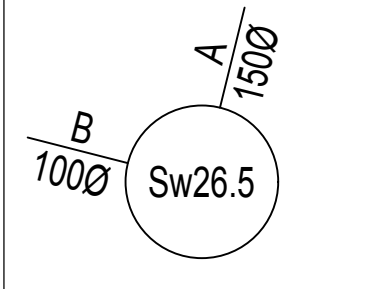
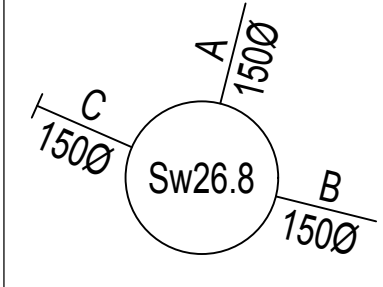
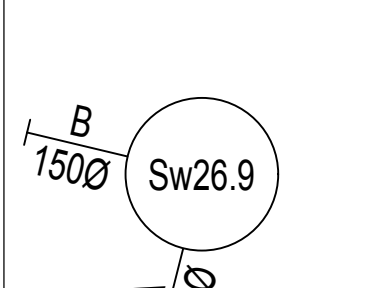
	COVER	I	A	4.612m
	5.595m	N	B	4.612m
	DIAMETER	V	C	
	450mm	E	D	
	450 Inspection	R	E	
	COVER	I	A	4.75m
	5.444m	N	B	4.75m
	DIAMETER	V	C	
	250mm	E	D	
	250 Inspection	R	E	
	COVER	I	A	4.852m
	5.518m	N	B	4.852m
	DIAMETER	V	C	
	450mm	E	D	
	450 Inspection	R	E	
	COVER	I	A	4.343m
	5.800m	N	B	4.393m
	DIAMETER	V	C	4.343m
	450mm	E	D	
	450 Inspection	R	E	
	COVER	I	A	4.645m
	5.695m	N	B	4.645m
	DIAMETER	V	C	
	450mm	E	D	
	450 Inspection	R	E	
	COVER	I	A	4.880m
	5.705m	N	B	4.930m
	DIAMETER	V	C	
	250mm	E	D	
	250 Inspection	R	E	
	COVER	I	A	4.70m
	5.485m	N	B	4.70m
	DIAMETER	V	C	4.70m
	450mm	E	D	
	450 Inspection	R	E	
	COVER	I	A	4.90m
	5.450m	N	B	4.90m
	DIAMETER	V	C	
	250mm	E	D	
	250 Inspection	R	E	

Setting Out Schedule								
MH No.	MANHOLE DIAMETER (mm)	MANHOLE TYPE	COVER LEVEL (m)	INVERT LEVEL (m)	DEPTH TO SOFFIT (m)	EASTING (m)	NORTHING (m)	
PP16	250	250 Inspection	5.436	4.80	0.536	489010.528	98570.252	
PP55	450	450 Inspection	5.666	4.70	0.816	488938.844	98530.234	
PP67	450	450 Inspection	6.104	5.40	0.604	488924.567	98581.156	
PP69	250	250 Inspection	5.965	5.30	0.565	488923.820	98565.790	
PS1	450	450 Inspection	5.532	4.606	0.776	489018.345	98559.563	
PS12	450	450 Inspection	5.406	4.648	0.608	489088.555	98578.242	
PS13	450	450 Inspection	5.647	4.572	0.975	489058.691	98558.017	
PS18	450	450 Inspection	5.487	4.519	0.818	488963.587	98525.133	
PS19	250	250 Inspection	5.464	4.686	0.628	489079.744	98520.992	
PS20	450	450 Inspection	5.434	4.811	0.472	489076.835	98508.748	
PS21	450	450 Inspection	5.464	4.137	1.177	489042.205	98646.448	
PS22	450	450 Inspection	5.604	4.490	0.964	489040.632	98639.002	
PS27	450	450 Inspection	5.416	4.367	0.899	488923.889	98505.646	
PS28	450	450 Inspection	5.489	4.493	0.846	488923.773	98493.051	
PS29	450	450 Inspection	5.420	4.540	0.730	488941.127	98505.682	
PS30	450	450 Inspection	5.716	4.40	1.216	488958.434	98533.666	
PS34	450	450 Inspection	5.542	4.80	0.642	488950.604	98549.335	
PS38	450	450 Inspection	5.906	3.984	1.772	488954.348	98601.687	
PS41	450	450 Inspection	5.445	4.445	0.90	488969.330	98573.599	
PS46	450	450 Inspection	5.493	4.60	0.743	488908.37	98483.577	
PS47	450	450 Inspection	5.614	4.724	0.740	488922.213	98482.545	
PS48	450	450 Inspection	5.501	4.775	0.577	488907.713	98466.292	
PS49	450	450 Inspection	5.440	4.390	0.900	488912.476	98505.656	
PS50	450	450 Inspection	5.477	4.531	0.796	488912.279	98491.535	
PS51	450	450 Inspection	5.493	4.443	0.900	488896.351	98497.231	
S27.1	450	450 Inspection	6.068	3.834	2.084	488941.935	98599.462	
S27.2	450	450 Inspection	5.960	3.955	1.854	488953.249	98603.857	
S27.3	450	Unknown	5.692	4.066	1.476	488957.550	98593.683	
S27.4	450	450 Inspection	5.592	4.786	0.657	488953.765	98579.859	
S29.1	450	450 Inspection	5.598	4.548	0.900	488971.820	98598.345	
S29.2	450	450 Inspection	5.586	4.630	0.856	488971.215	98595.270	
S33.1	450	450 Inspection	5.673	4.673	0.90	488906.181	98548.076	
S33.2	450	450 Inspection	5.857	3.732	1.975	488916.913	98554.266	
S33.3	450	450 Inspection	5.673	3.879	1.643	488927.498	98543.737	
S33.4	450	450 Inspection	5.634	3.97	1.514	488934.574	98549.352	
S33.5	450	450 Inspection	5.656	4.116	1.390	488941.347	98562.309	
S33.6	450	450 Inspection	5.647	4.244	1.253	488944.401	98574.356	
S33.7	450	450 Inspection	5.812	4.378	1.284	488944.381	98588.130	
S34.1	450	450 Inspection	5.698	4.698	0.90	488896.080	98522.321	
S34.2	450	450 Inspection	5.679	4.629	0.900	488895.873	98534.998	
S34.3	450	450 Inspection	5.538	4.749	0.639	488907.843	98535.134	
S34.4	450	450 Inspection	5.579	4.380	1.049	488862.701	98532.483	
S34.5	450	450 Inspection	5.493	4.75	0.593	488862.042	98495.958	
S35.1	450	450 Inspection	5.524	4.542	0.832	488922.944	98532.661	
S35.2	450	450 Inspection	5.750	4.638	0.963	488934.920	98535.067	
S35.3	450	450 Inspection	5.522	4.472	0.900	488906.274	98515.405	
S36.1	600	600 Inspection	5.397	3.882	1.290	488946.671	98507.622	
S36.2	900x675	Type D	5.734	4.737	0.772	488945.260	98461.576	
S36.3	450	450 Inspection	5.920	5.008	0.762	488925.399	98462.357	
S36.4	250	250 Inspection	5.611	5.00	0.461	488926.483	98484.410	
S39.1	450	450 Inspection	5.625	4.526	0.950	488949.683	98569.681	
S39.2	450	450 Inspection	5.587	4.718	0.719	488944.702	98551.103	
S39.3	450	450 Inspection	5.644	4.808	0.686	488941.356	98542.705	
S42.1	450	450 Inspection	6.140	5.140	0.90	488923.878	98588.971	
S42.2	450	450 Inspection	6.081	5.285	0.696	488927.287	98593.649	
S42.3	250	250 Inspection	6.034	5.393	0.541	488926.163	98584.450	
S43.1	450	450 Inspection	5.746	4.602	0.995	488826.996	98519.851	
S43.2	450	450 Inspection	5.787	4.737	0.900	488836.704	98529.298	
S44.1	450	450 Inspection	5.929	4.266	1.513	488836.601	98533.299	
S44.2	450	450 Inspection	5.732	4.298	1.284	488838.229	98530.701	
S44.3	450	450 Inspection	5.774	4.448	1.175	488851.497	98523.184	
S44.4	450	450 Inspection	5.654	4.48	1.024	488859.273	98536.711	
S44.5	450	450 Inspection	5.653	4.521	0.982	488856.346	98539.551	
S44.6	250	250 Inspection	5.489	4.75	0.589	488868.048	98552.960	
S45.1	450	450 Inspection	5.464	3.79	1.524	488821.748	98494.803	
S45.2	450	450 Inspection	5.484	3.86	1.474	488827.757	98497.405	
S45.3	450	450 Inspection	5.571	4.117	1.303	488847.868	98491.325	
S45.4	450	450 Inspection	5.455	4.33	0.975	488869.091	98490.023	
S45.5	450	450 Inspection	5.459	4.417	0.892	488875.408	98484.771	
S45.6	450	450 Inspection	5.388	4.65	0.588	488874.911	98467.405	
S45.7	450	450 Inspection	5.45	4.40	0.90	488861.999	98485.554	
S45.8	450	450 Inspection	5.651	4.601	0.900	488860.080	98464.744	
S45.9	450	450 Inspection	5.230	4.180	0.900	488830.697	98471.773	
S45.10	450	450 Inspection	5.496	4.453	0.893	488820.116	98509.508	

Setting Out Schedule							
MH No.	MANHOLE DIAMETER (mm)	MANHOLE TYPE	COVER LEVEL (m)	INVERT LEVEL (m)	DEPTH TO SOFFIT (m)	EASTING (m)	NORTHING (m)
S45.11	450	Unknown	5.301	3.69	1.461	488813.455	98500.052
S45.12	450	450 Inspection	5.490	4.440	0.900	488849.416	98486.667
SW16.3	250	250 Inspection	5.415	4.70	0.615	489051.445	98672.095
SW17.3	250	250 Inspection	5.166	4.65	0.366	489058.426	98642.795
SW18.1	450	450 Inspection	5.515	4.465	0.900	489024.708	98619.632
SW18.3	250	250 Inspection	5.342	4.70	0.492	489010.183	98608.039
SW18.4	450	450 Inspection	5.527	4.631	0.746	489034.117	98619.315
SW18.5	450	450 Inspection	5.640	4.785	0.705	489030.930	98605.705
SW18.6	450	450 Inspection	5.538	4.633	0.755	489019.600	98641.168
SW18.8	250	250 Inspection	5.566	4.836	0.580	489024.343	98628.536
SW19.1	450	450 Inspection	5.765	4.675	0.940	489043.176	98606.928
SW21.1	450	450 Inspection	5.611	4.30	1.161	489054.778	98586.583
SW22.1	450	450 Inspection	5.378	4.70	0.578	489068.015	98563.412
SW23.1	450	450 Inspection	5.566	4.557	0.859	489014.407	98554.646
SW23.3	250	250 Inspection	5.588	4.90	0.538	489014.540	98535.368
SW23.5	450	450 Inspection	5.657	4.517	0.990	489062.334	98545.746
SW23.6	450	450 Inspection	5.629	4.707	0.821	489063.452	98550.401
SW23.8	450	450 Inspection	5.578	4.816	0.613	489056.572	98525.074
SW23.9	250	250 Inspection	5.470	4.941	0.379	489053.522	98512.917
SW23.10	250	250 Inspection	5.587	4.993	0.444	489048.447	98514.171
SW24.1	450	450 Inspection	5.600	4.50	0.950	489042.712	98505.347
SW24.3	450	450 Inspection	5.573	4.612	0.810	489040.074	98494.426
SW25.1	450	450 Inspection	5.410	4.363	0.898	489059.482	98509.181
SW26.1	450	450 Inspection	5.672	4.546	0.975	489012.493	98512.513
SW26.2	450	450 Inspection	5.716	4.716	0.850	489010.171	98503.603
SW26.3	450	450 Inspection	5.624	4.73	0.744	489014.177	98502.527
SW26.4	250	250 Inspection	5.695	4.82	0.725	489013.653	98498.223
SW26.6	250	250 Inspection	5.719	5.00	0.619	489005.978	98493.986
SW26.7	450	450 Inspection	5.687	4.50	1.037	489014.643	98520.823
SW27.1	450	450 Inspection	5.550	4.481	0.918	489035.247	98595.302
SW27.2	450	450 Inspection	5.552	4.558	0.844	489027.791	98597.051
SW27.3	250	250 Inspection	5.600	4.560	0.889	489087.215	98554.923
SW27.4	250	250 Inspection	5.525	4.762	0.613	489082.819	98535.280
SW27.5	450	450 Inspection	5.599	4.867	0.582	489072.645	98537.898
SW27.6	450	450 Inspection	5.535	4.90	0.535	489075.200	98553.534
SW28.2	450	450 Inspection	5.303	4.539	0.613	489005.240	98575.098
SW28.3	450	450 Inspection	5.379	4.642	0.587	489000.414	98572.939
SW28.4	450	450 Inspection	5.409	4.748	0.511	488996.543	98557.847
SW28.5	450	450 Inspection	5.348	4.502	0.696	489014.606	98578.948
SW28.6	450	450 Inspection	5.396	4.631	0.615	489002.076	98582.212
SW28.7	450	450 Inspection	5.479	4.673	0.656	489018.504	98595.593
SW28.8	250	250 Inspection	5.335	4.796	0.388	489006.420	98598.212
SW16.1	250	250 Inspection	5.312	3.942	1.220	489022.630	98659.978
SW16.2	450	450 Inspection	5.505	4.569	0.786	489021.804	98650.339
SW17.1	450	450 Inspection	5.380	4.02	1.210	489042.702	98658.131
SW17.2	250	250 Inspection	5.493	4.173	1.170	489058.416	98658.296
SW18.2	450	450 Inspection	5.595	4.612	0.833	489021.036	98605.403
SW18.7	250	250 Inspection	5.444	4.75	0.544	489016.236	98631.382
SW23.2	450	450 Inspection	5.518	4.852	0.516	489010.613	98540.142
SW23.4	450	450 Inspection	5.800	4.343	1.308	489045.204	98550.189
SW23.7	450	450 Inspection	5.695	4.645	0.900	489040.018	98529.189
SW26.5	250	250 Inspection	5.705	4.880	0.675	489012.223	98492.39
SW26.8	450	450 Inspection	5.485	4.70	0.635	489000.227	98524.435
SW26.9	250	250 Inspection	5.450	4.90	0.400	489004.159	98540.081