





Outfall location (1:500)

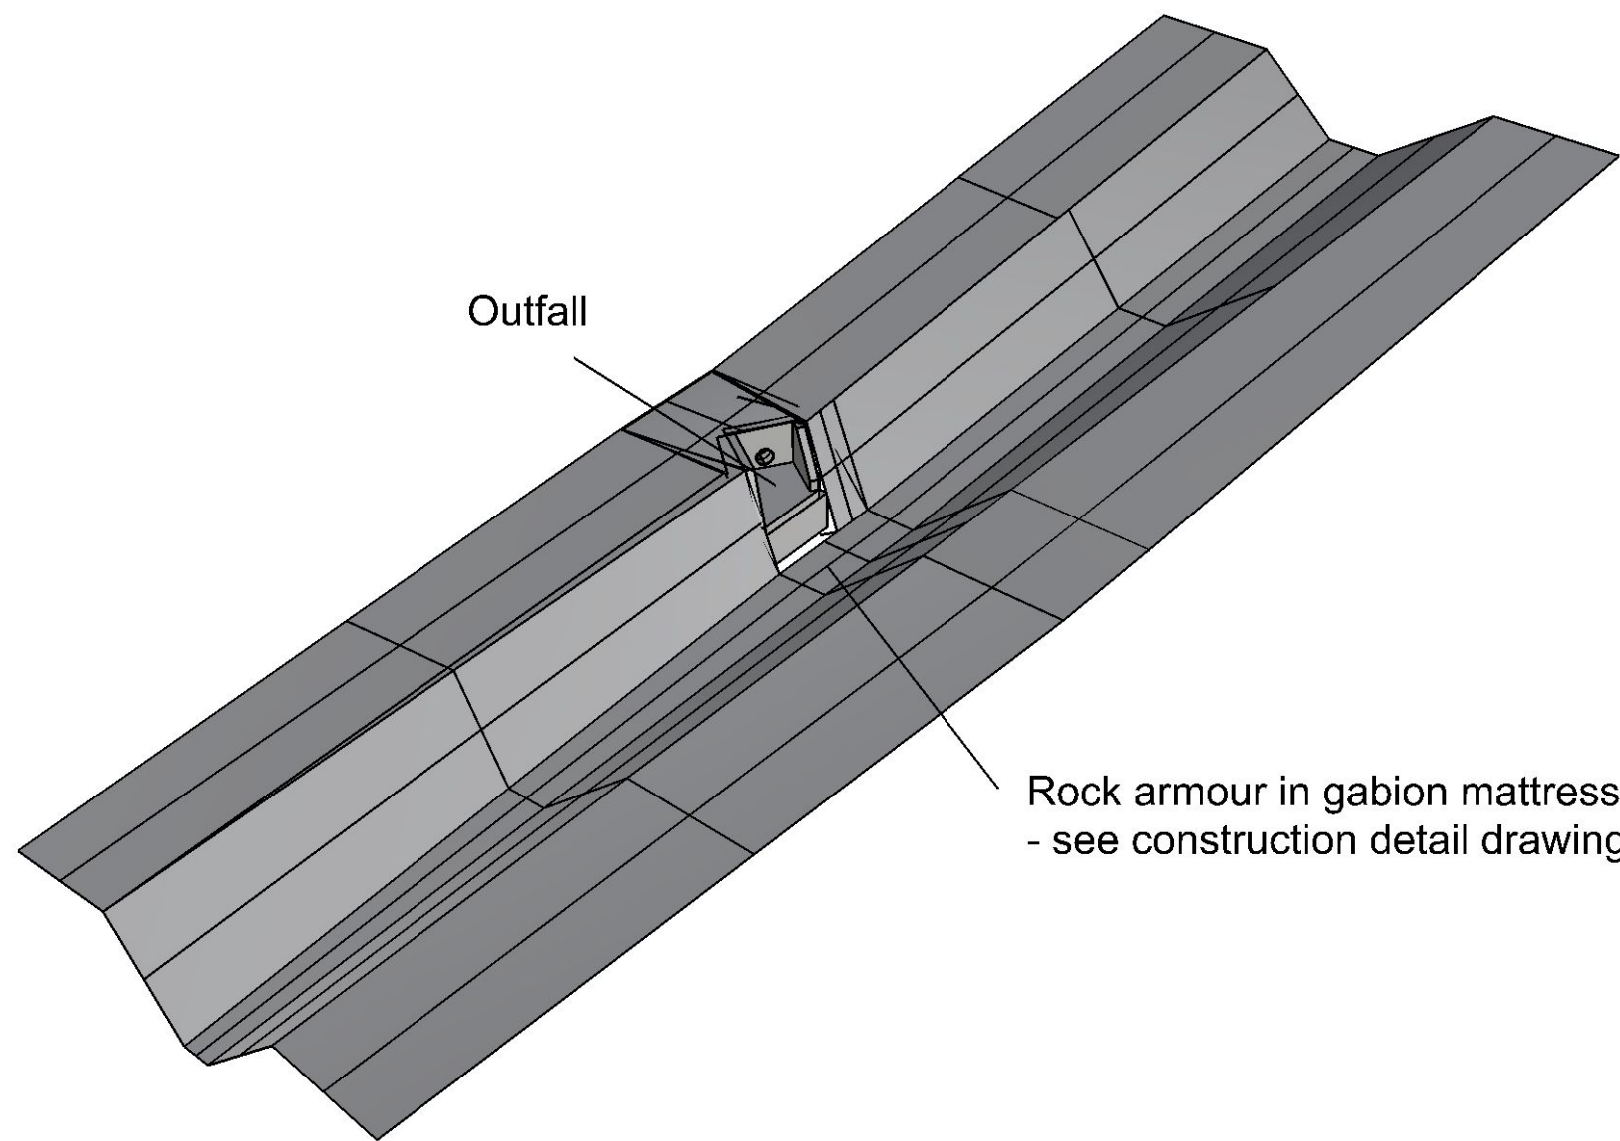


Perspective

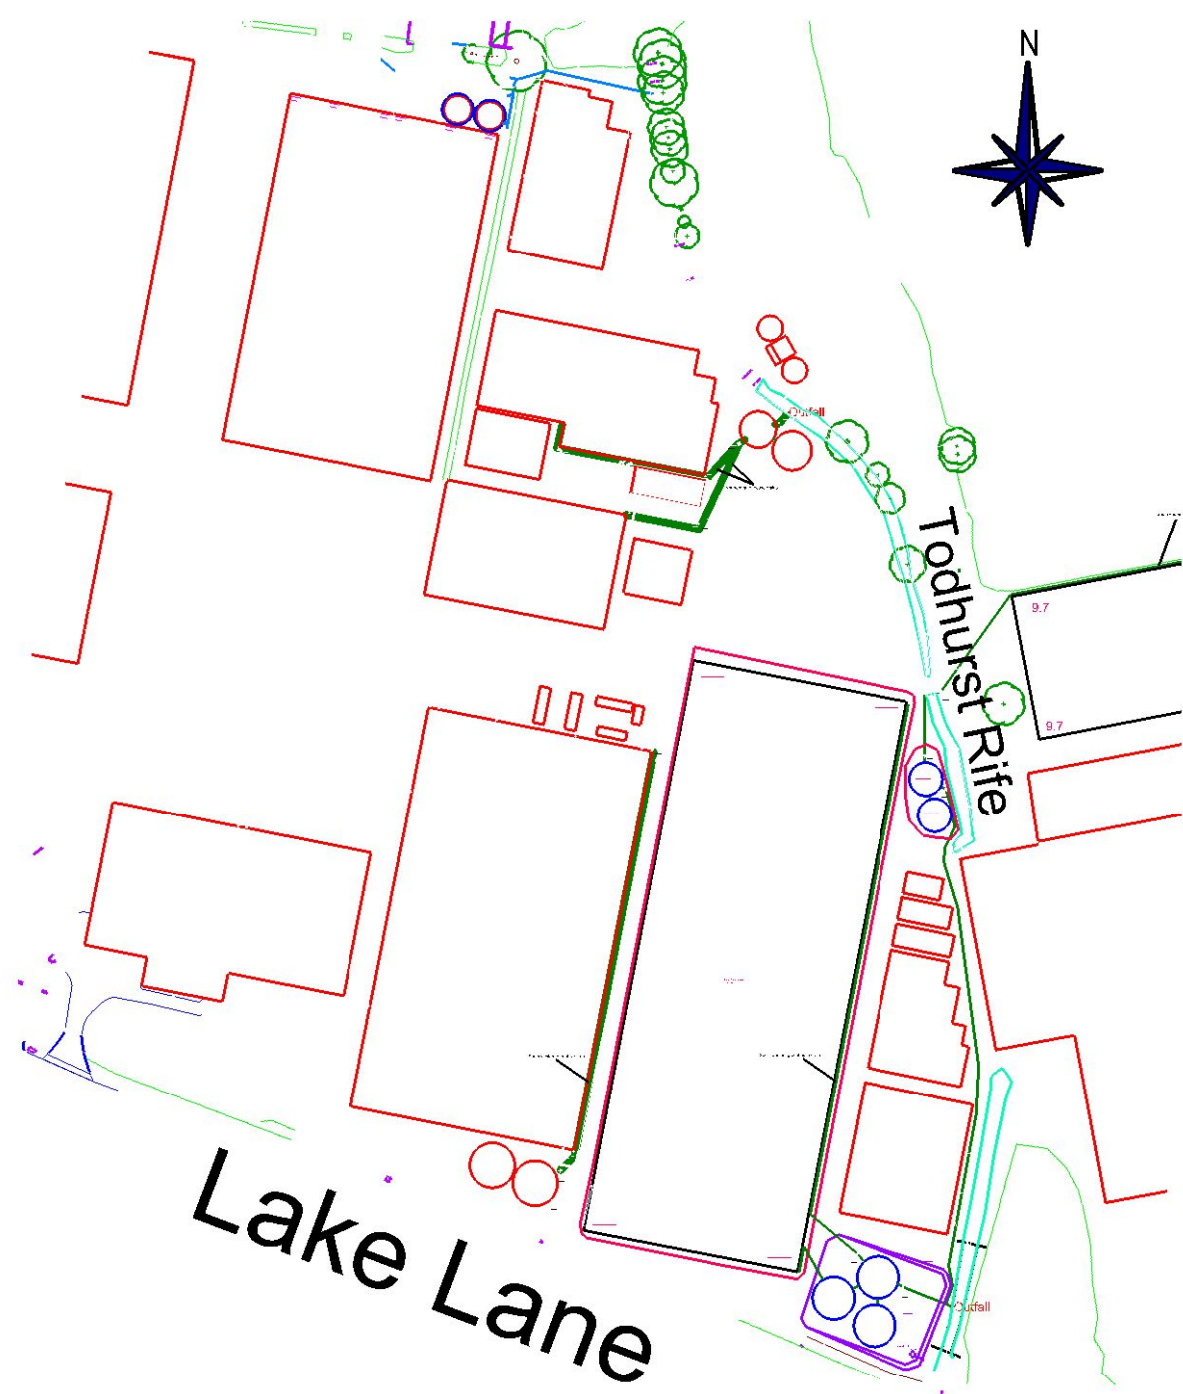

Site location (1:2500)


For headwall installation and rock armour details see construction notes.

Discharge rates: 6.1 l/s normal, 10.57 l/s for 1:100 events.

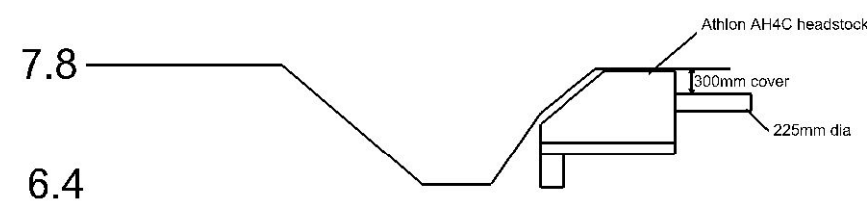

Upstream section (1:100)


(Marked U-U on plan above).

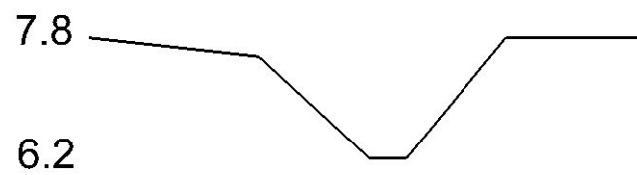


Downstream section (1:100)

(Marked D-D on plan above).

Upstream / downstream sectional views looking downstream.
Longitudinal view from west to east.

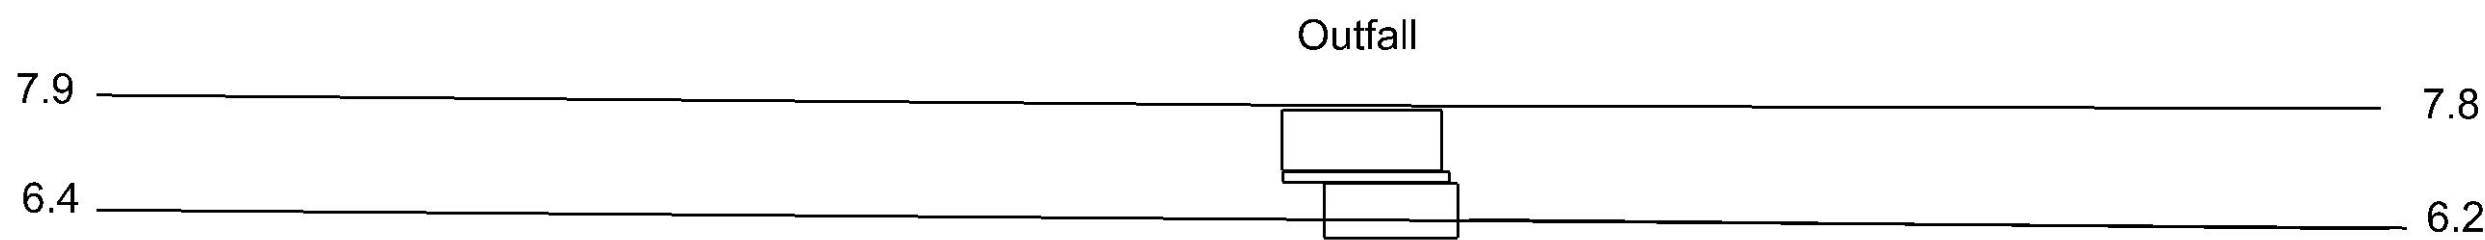

Longitudinal section (1:100)

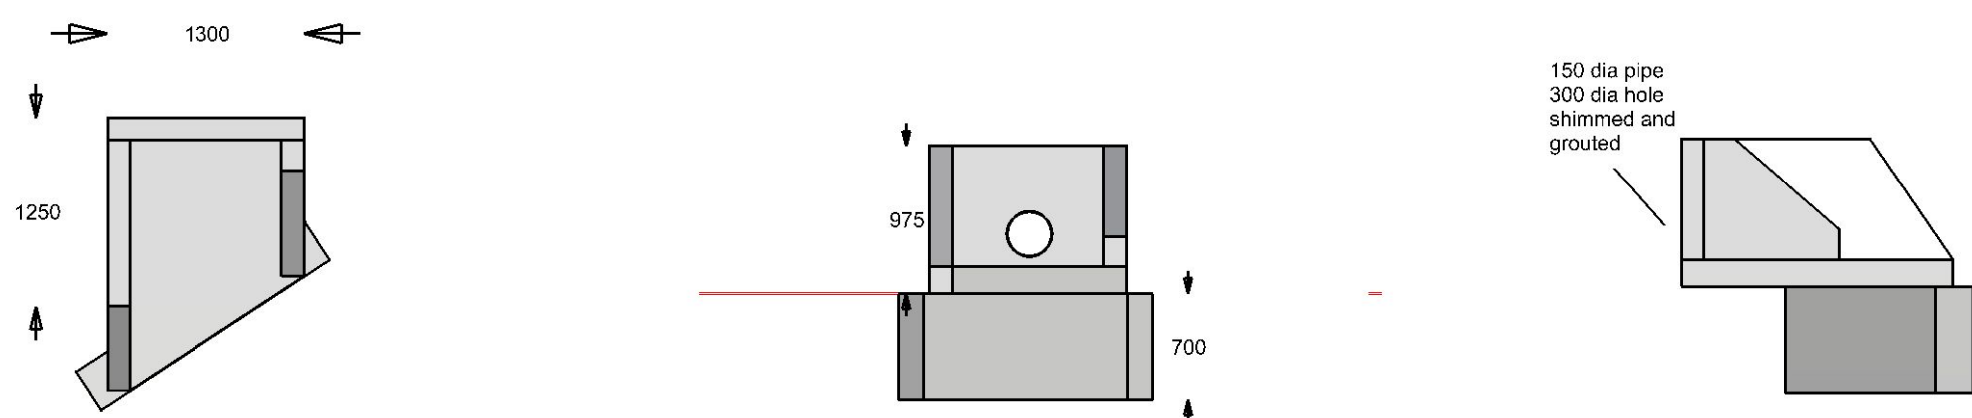

Top

Front

Side

Athlon AH4C headstock (1:50)

(Flap valve not shown for clarity)

Fleurie Nursery
Lake Lane
Barnham

Outfall B (South)

Date: 23.02.24
Scale As marked for A1
Drawn AM

Revisions

Hennock International Ltd

Church Road
Hennock
Newton Abbot
Devon TQ13 9QE